
MILLS FOREST LOT 35 II

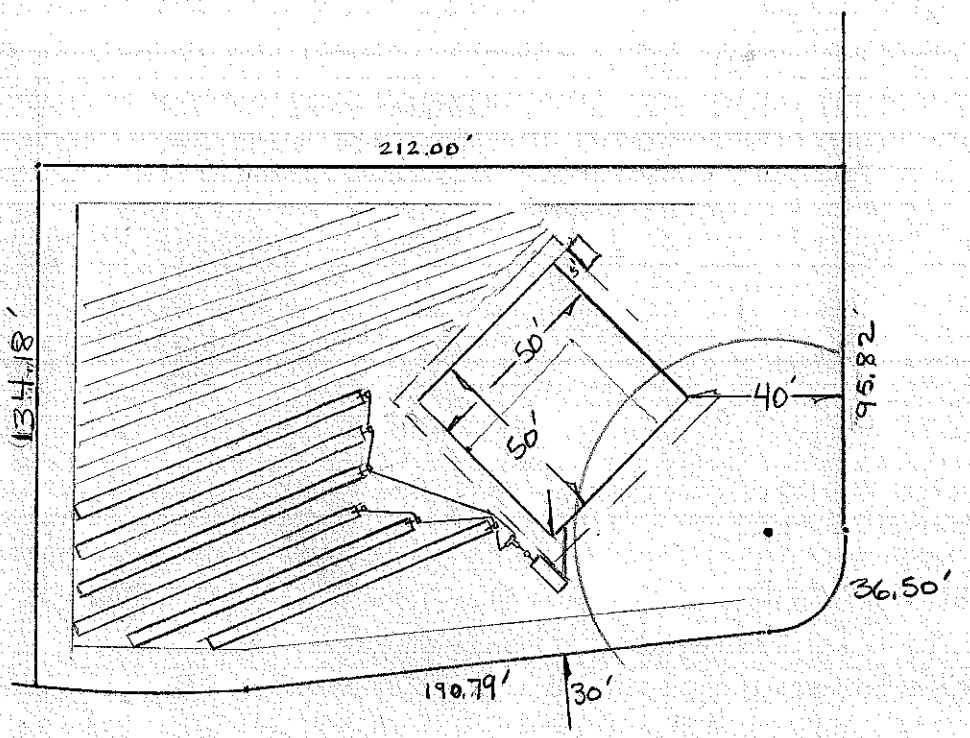

LATERALS SKETCHED MAY NOT SHOW EXACT CONTOURS, BUT DO INDICATE THE LOT CAN ACCOMODATE GRAVITY CONVENTIONAL ORIGINAL AND REPAIR SYSTEMS. REPAIR CAN BE ACCESSED BY MEANS OF AN ALTERNATING VALVE BETWEEN THE TANK AND FLOW DIVIDER TEE.

date:
property description: Mills Forest II
topography:
weather:
~~34 (43)~~ 35
excavation:

0-4
color: —
texture: cl
structure grade: mod
size: med
form: granular sbk
consistence: mft - msfi
boundary: clear

4-
color: —
texture: <
structure grade: mod
size: med
form: sbk
consistence: mvfi - mfi
boundary: diffuse LTAR 0.25

- 36
color: —
texture: cl
structure grade: mod
size: med
form: sbk
consistence: mfi - msfi
boundary: diffuse LTAR 0.25-0.3

color:
texture: cl saprolite
structure grade:
size:
form:
consistence:
boundary:

color:
texture:
structure grade:
size:
form:
consistence:
boundary:

color:
texture:
structure grade:
size:
form:
consistence:
boundary:

color:
texture:
structure grade:
size:
form:
consistence:
boundary: