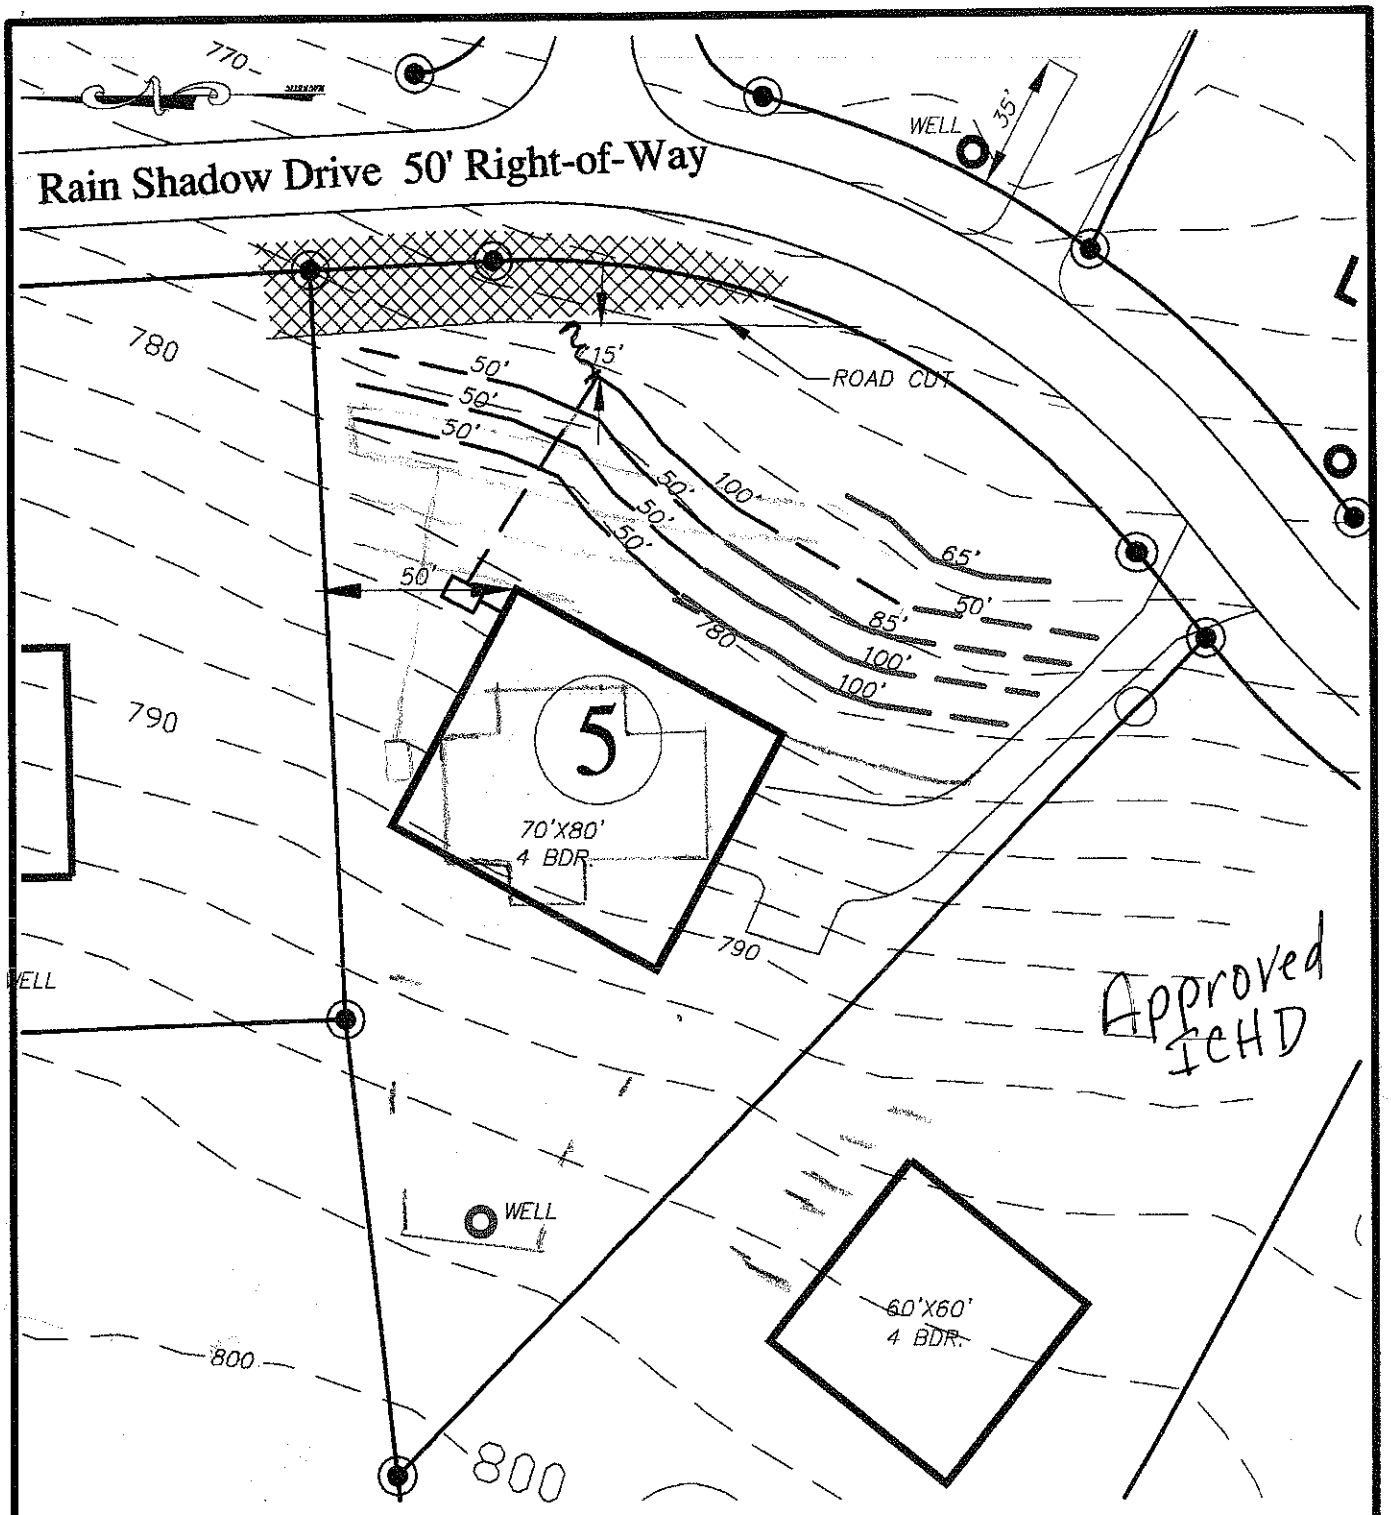


Hollybrook

FOR

DAVID R. MCKAY, LLC. & BETTY MCKAY, LLC.

505 TEETER ROAD
Mooresville, NC 28115
(704) 664-9080

IREDELL COUNTY; CODDLE CREEK NORTH CAROLINA

SEPTIC FIELD LAYOUT
LOT # 5


BAR SCALE 1"=50'

0 25 50 100

RST - STB
825 - 1000

8-01-13

Lot	
15	28 - 32
24	32 - 64
30	36 - 84
31	31 end fed
100	

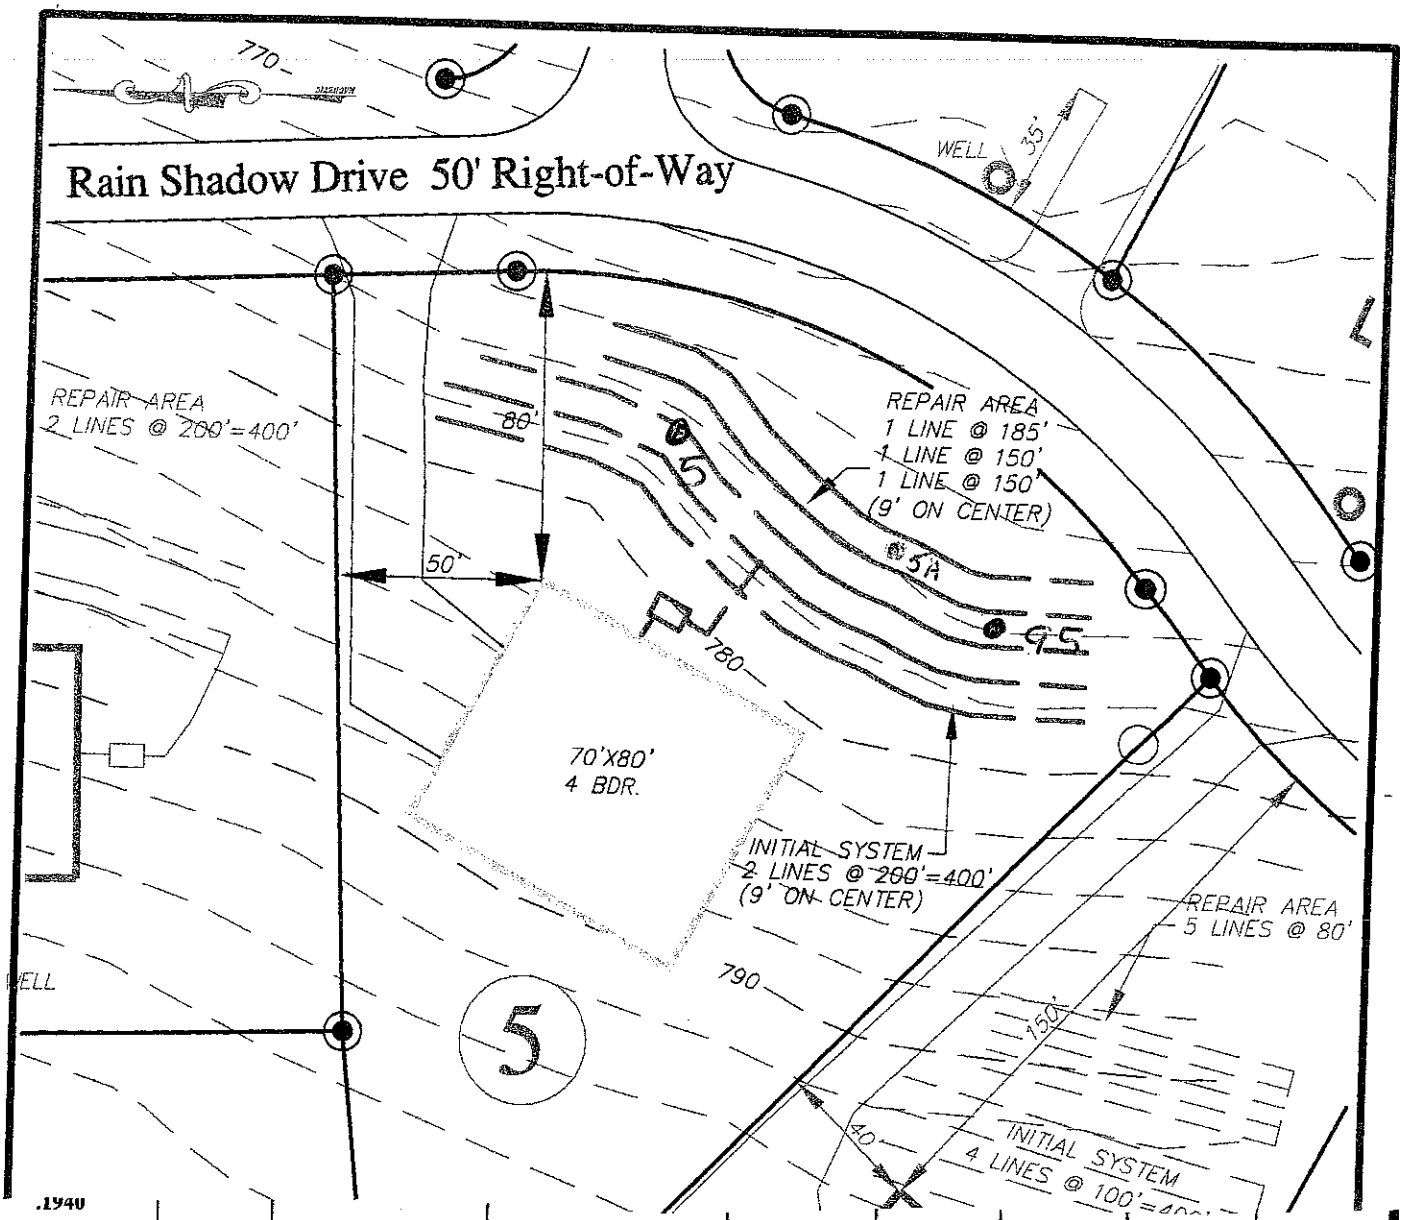

LE #	.1940 LANDSCAPE POSITION/ SLOPE %	HORIZON DEPTH (IN.)	.1941 STRUCTURE/ TEXTURE	.1941 CONSISTENCE/ MINERALOGY	.1942 SOIL WETNESS/ COLOR	.1943 SOIL DEPTH	.1956 SAPRO CLASS	.1944 RESTR HORIZ	PROFILE CLASS & LTAR
5	As (1)	A&B 0-6	SBK SCL	SEXP FR S SP	10YR 4/6	48"+	N/A	N/A	II 0.3 Hac
		B+t 6-28	" C	" " " P					
		B+t 28-48+	" C	" " " "	10YR 4/6 Matrix w/ 10YR 6/4 Secondary	28" rl -48"	+ sap	gm	3 OK
95	L/CC In shallow draw 15-20 smooth	Ao 0-4	SBK CL	SEXP FR S P	2.5YR 4/6 5YR 4/4	48"+ Dark soil inc	N/A	N/A	IV 3 0.3 Hac. landscape position .25
		B+t 4-30	" C	" " " "					
		B+t 30-48+	" "	" " " "					

may be mg or om

over →