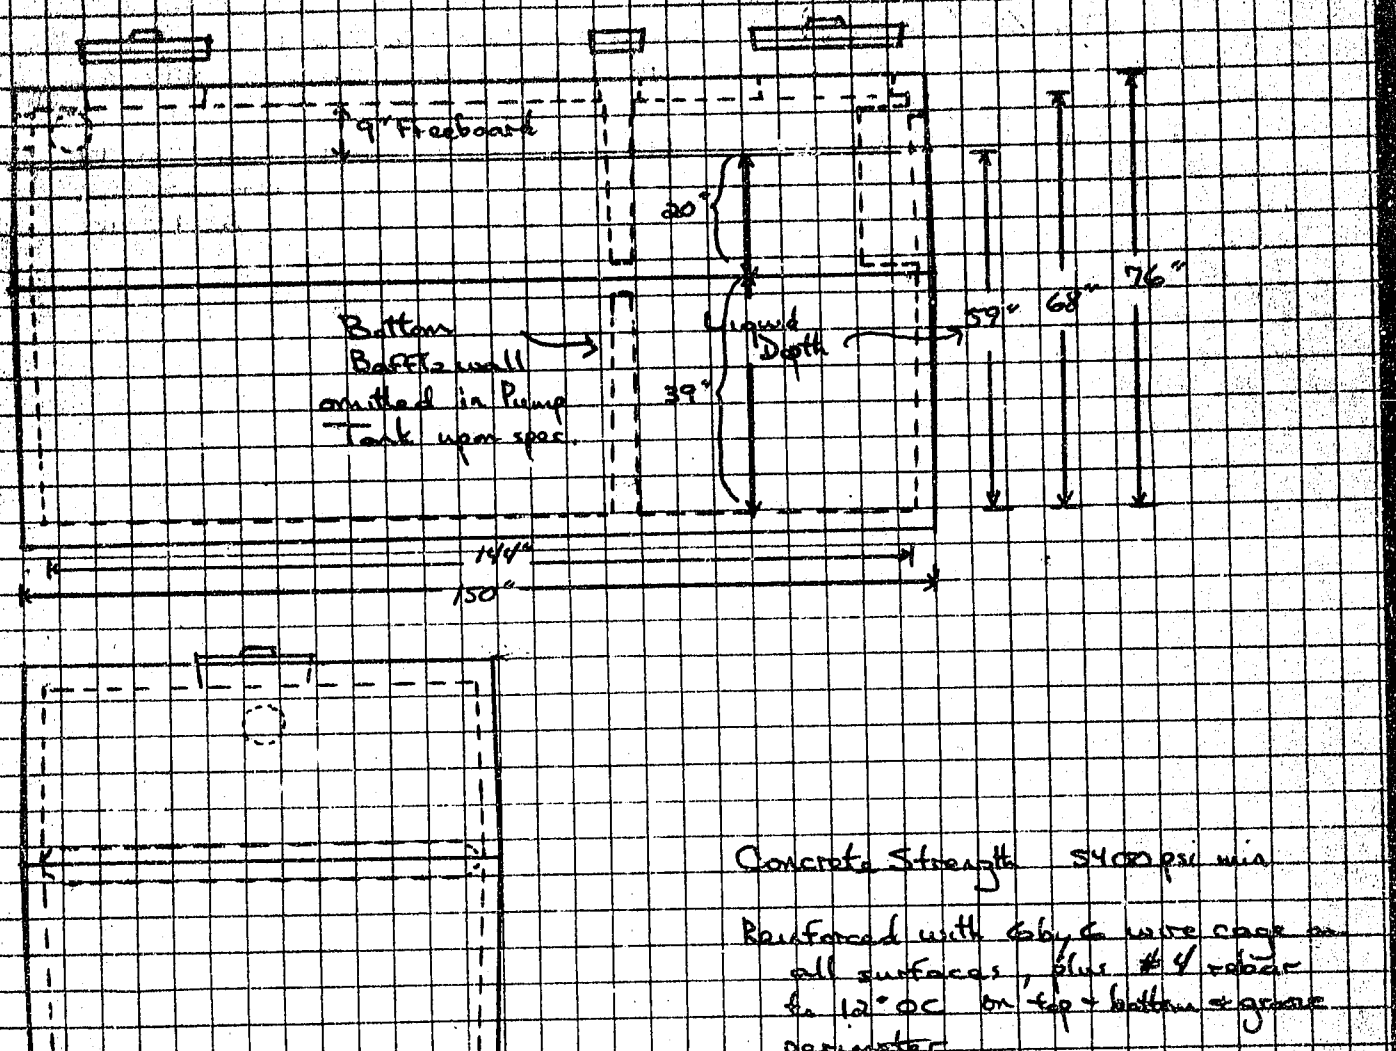


Concrete Strength 5400 psi min

Reinforced with 6by6 wire cage on all surfaces, plus #4 rebar @ 12" OC on top + bottom + grade perimeter

L/W ratio 2:1

Sealed with double strip CS-101 butyl rubber sealant plus CS prime coat

Follow standards set by IAPMO IAS 16-1 1997

Cast in place tee extends excess on I.D.

HRCP 2500
STB 53

Built for Denver Septic Tank Service
Tantrum Job

Mfrs. note: These tanks were built to spec. requirements. The reason for the bottom piece being larger than the top was to take advantage of the cast in place tee available in the 2000 gal top form, and the requirement by the engineer to eliminate the wet area in the pump tanks baffle wall.