DEPARTMENT OF HEALTH AND HUMAN SERVICES
DIVISION OF PUBLIC HEALTH, ENVIRONMENTAL HEALTH SECTION
ON-SITE WATER PROTECTION BRANCH

Sheet 1 of 1
PROPERTY ID #: 3783465147
COUNTY: Iredell

SOIL/SITE EVALUATION
for ON-SITE WASTEWATER SYSTEM
(Complete all fields in full)

OWNER: Martin Hendricks — APPLICATION DATE: 4-5-16
ADDRESS: 346 New Sterling Rd — DATE EVALUATED: 5-11-16
PROPOSED FACILITY: SFD — PROPOSED DESIGN FLOW (.1949): 240gpd — PROPERTY SIZE: 4.14 acres
LOCATION OF SITE: 374 Lookout Dam Rd — PROPERTY RECORDED: Yes
WATER SUPPLY: ☑ Private ☐ Public ☐ Well ☐ Spring ☐ Other N/A
EVALUATION METHOD: ☑ Auger Boring ☐ Pit ☐ Cut — TYPE OF WASTEWATER: ☑ Sewage ☐ Industrial Process ☐ Mixed

PROFILE #	.1940 LANDSCAPE POSITION/ SLOPE %	HORIZON DEPTH (IN.)	SOIL MORPHOLOGY (.1941) .1941 STRUCTURE/ TEXTURE	SOIL MORPHOLOGY (.1941) .1941 CONSISTENCE/ MINERALOGY	OTHER PROFILE FACTORS .1942 SOIL WETNESS/ COLOR	.1943 SOIL DEPTH	.1956 SAPRO CLASS	.1944 RESTR HORIZ	PROFILE CLASS & LTAR
1	1% NS	0-10	SCL SBK	Fr mod SE	>48"	>48"	>48"	>48"	PS 0.275
		10-23	RC Y/B mottles ABK	Fr mod SE					
		23-48	BC common sap SBK	Incl Fr mod SE					
2	6% NS	0-11	SCL SBK	Fr mod SE	>48"	>48"	>48"	>48"	PS 0.25
		11-26	C common mag staining; few Y/B mottles SBK	Fr mod SE					
		26-48	BC few Y/B mottles SBK	Fr mod SE					
3	17% NS	0-15	SCL SBK	Fr mod SE	>48"	>48"	>48"	>48"	PS 0.275
		15-32	RC ABK	Fr mod SE					
		32-48	BC sap Incl WABK	Fr mod SE					
4	10% NS	0-8	SCL SBK	Fr mod SE	>48"	40"	40"	40"	PS 0.275
		8-22	RC few Y/B ABK	Fr mod SE					
		22-40	BC common sap WSBK	Inc Fr mod SE					
		40-48	SAP	W					

DESCRIPTION	INITIAL SYSTEM	REPAIR SYSTEM
Available Space (.1945)	PS	PS
System Type(s)	III	III
Site LTAR	0.25	0.275

OTHER FACTORS (.1946): N/A
SITE CLASSIFICATION (.1948): PS
EVALUATED BY: Justin Henderson
OTHER(S) PRESENT: N/A

COMMENTS: TBC 36" Initial System

LEGEND

use the following standard abbreviations

LANDSCAPE POSITION	GROUP	SOIL TEXTURE	CONVENTIONAL .1955 LTAR*	LPP .1957 LTAR*	MINERALOGY/ CONSISTENCE	STRUCTURE
CC (Concave Slope)	I	S (Sand)	1.2 - 0.8	0.6 - 0.4	SEXP (Slightly Expansive)	G (Single Grain)
CV (Convex Slope)		LS (Loamy Sand)			EXP (Expansive)	M (Massive)
D (Drainage Way)						CR (Crumb)
DS (Debris Slump)	II	SL (Sandy Loam)	0.8 - 0.6	0.4 - 0.3		GR (Granular)
FP (Flood Plain)		L (Loam)				SBK (Subangular Blocky)
FS (Foot Slope)						ABK (Angular Blocky)
H (Head Slope)	III	Si (Silt)	0.6 - 0.3	0.3 - 0.15		PL (Platy)
L (Linear Slope)		SiCL (Silty Clay Loam)				PR (Prismatic)
N (Nose Slope)		CL (Clay Loam)				
R (Ridge)		SCL (Sandy Clay Loam)			MOIST	WET
S (Shoulder Slope)		SiL (Silt Loam)				
T (Terrace)					VFR (Very Friable)	NS (Non-sticky)
	IV	SC (Sandy Clay)	0.4 - 0.1	0.2 - 0.05	FR (Friable)	SS (Slightly Sticky)
		SiC (Silty Clay)			FI (Firm)	S (Sticky)
		C (Clay)			VFI (Very Firm v. Very Sticky)	VS (Very Sticky)
		O (Organic)	None	None	EFI (Extremely Firm)	NP (Non-plastic)
						SP (Slightly Plastic)
						P (Plastic)
						VP (Very Plastic)

*Adjust LTAR due to depth, consistence, structure, soil wetness, landscape, position, wastewater flow and quality.


NOTES


HORIZON DEPTH	In inches below natural soil surface
DEPTH OF FILL	In inches from land surface
RESTRICTIVE HORIZON	Thickness and depth from land surface
SAPROLITE	S(suitable) or U(unsuitable)
SOIL WETNESS	Inches from land surface to free water or inches from land surface to soil colors with chroma 2 or less - record Munsell color chip designation
CLASSIFICATION	S (Suitable), PS (Provisionally Suitable), or U (Unsuitable)

Evaluation of saprolite shall be by pits.

Long-term Acceptance Rate (LTAR): gal/day/ft²

Show profile locations and other site features (dimensions, reference or benchmark, and North).

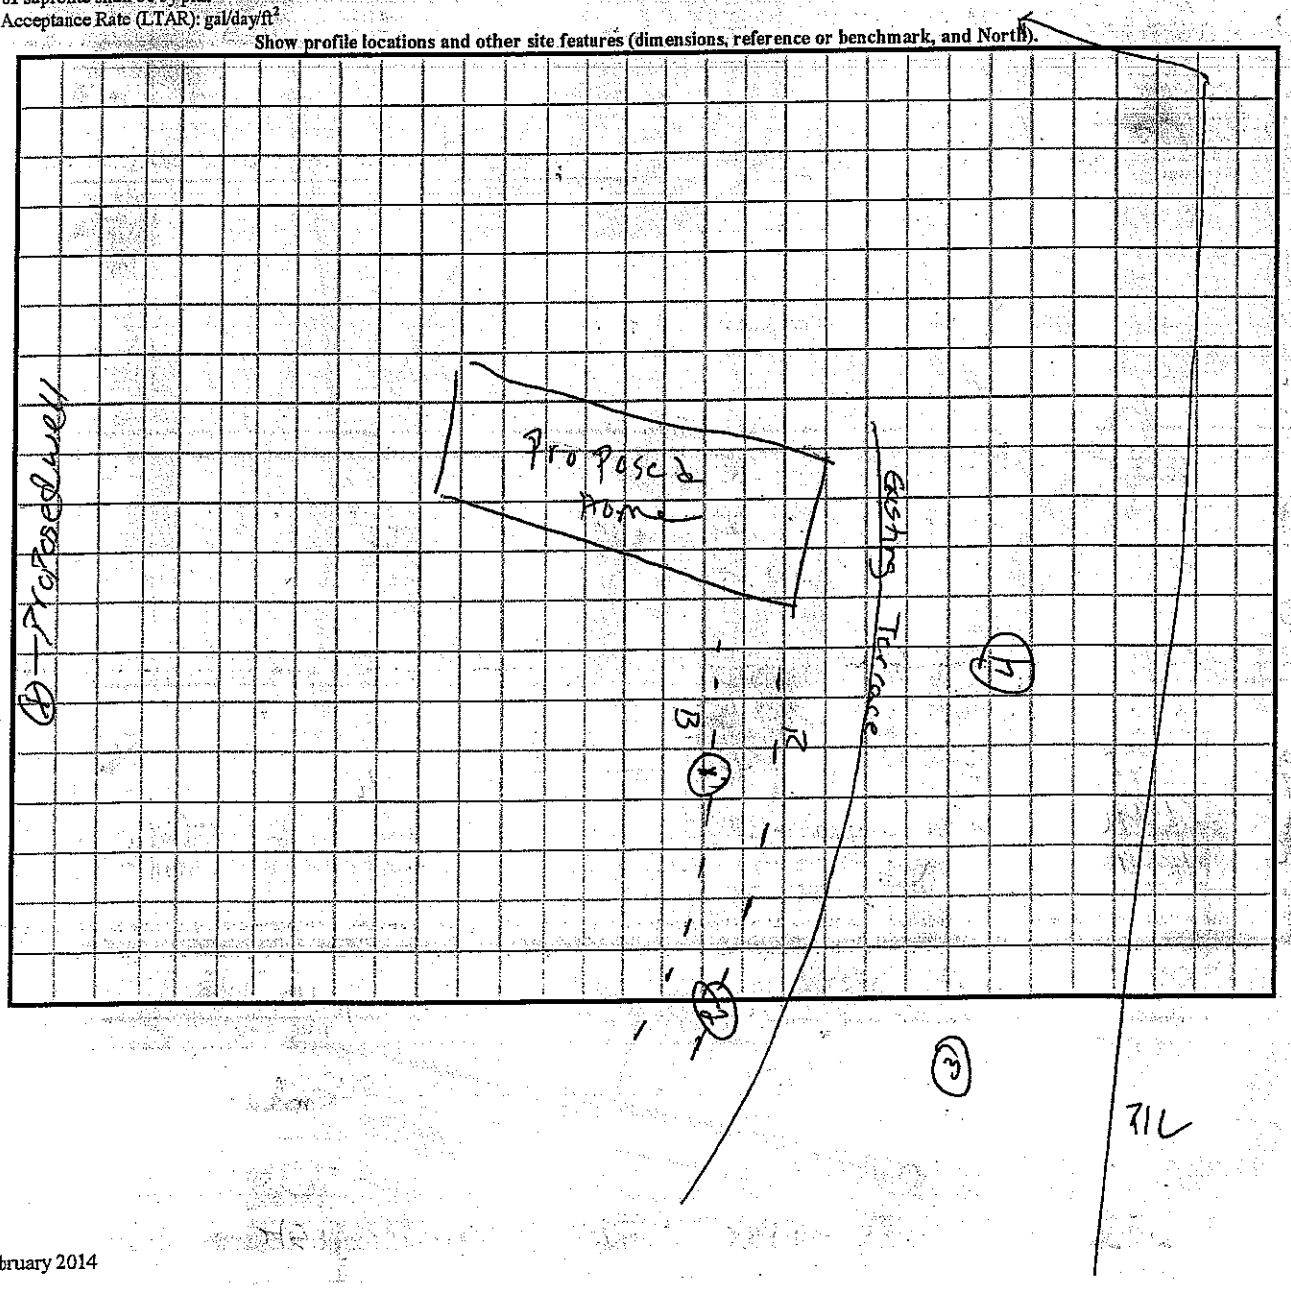

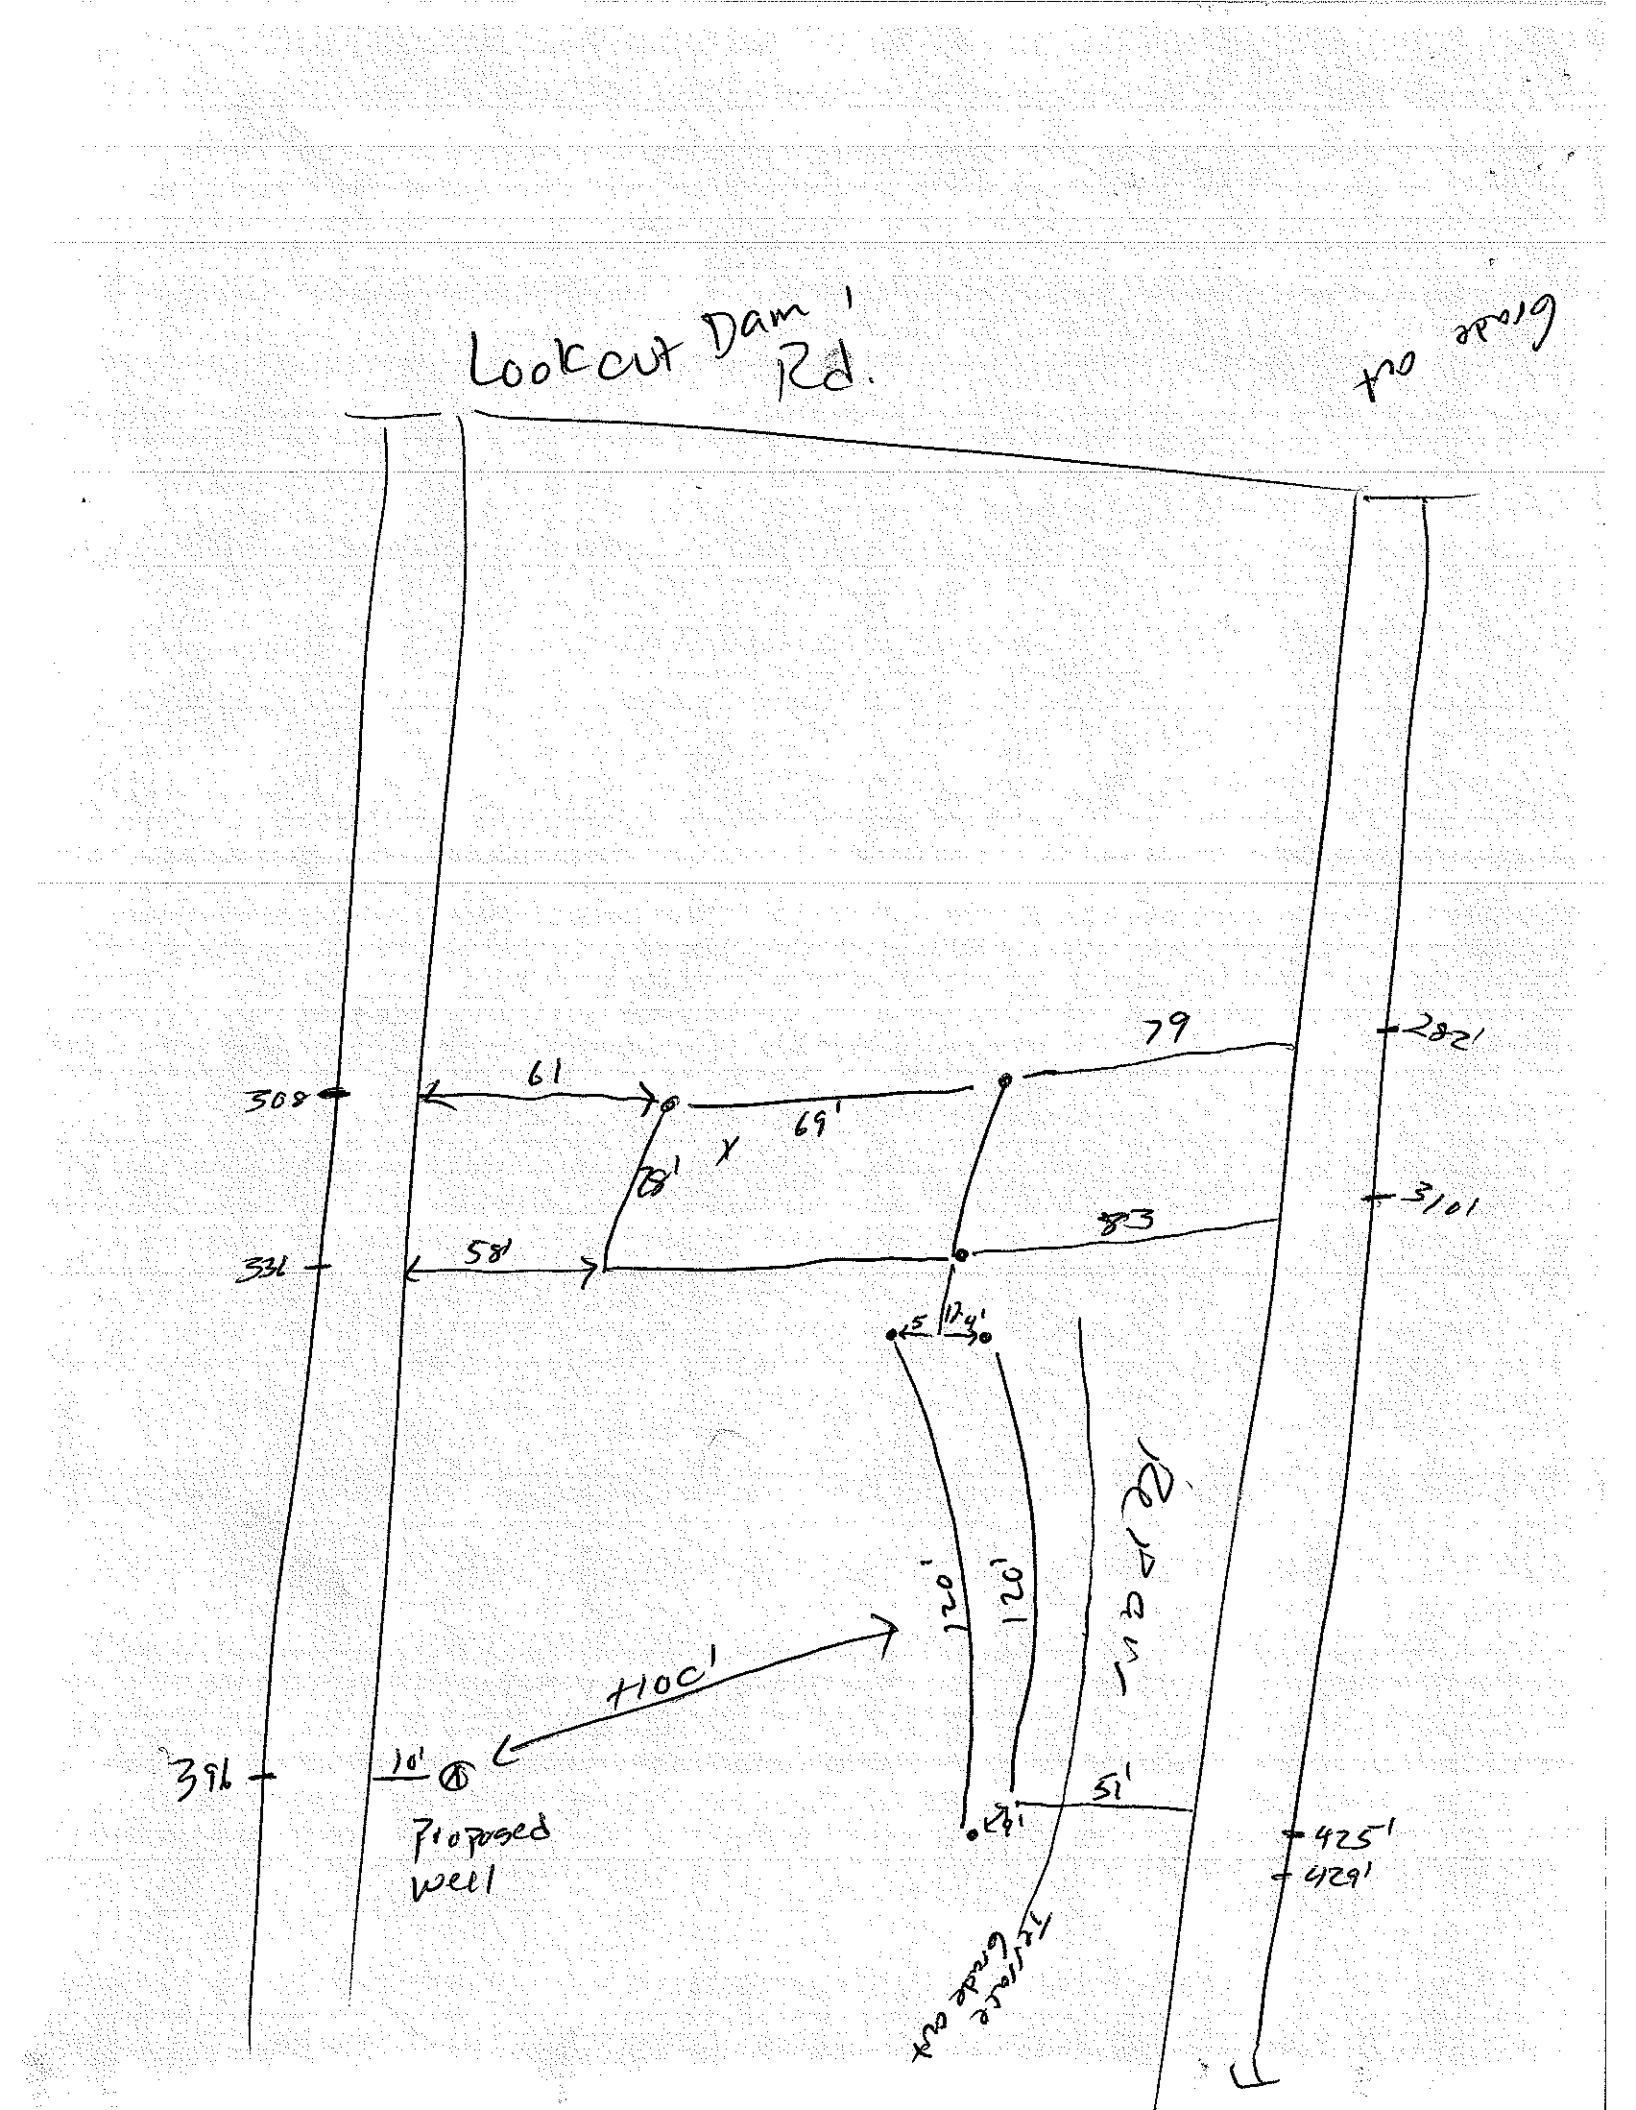
Lookout Dam Rd.
no grade
308
336
396
61
58'
69'
78'
X
79
83
282'
310'
425'
429'
5
17.4'
120'
120'
110C'
51'
10'
Proposed well
Existing Grade out