DIVISION OF ENVIRONMENTAL HEALTH
ON-SITE WASTEWATER SECTION

Sheet ___ of ___
PROPERTY ID #: _____
COUNTY: _____

SOIL/SITE EVALUATION
for ON-SITE WASTEWATER SYSTEM

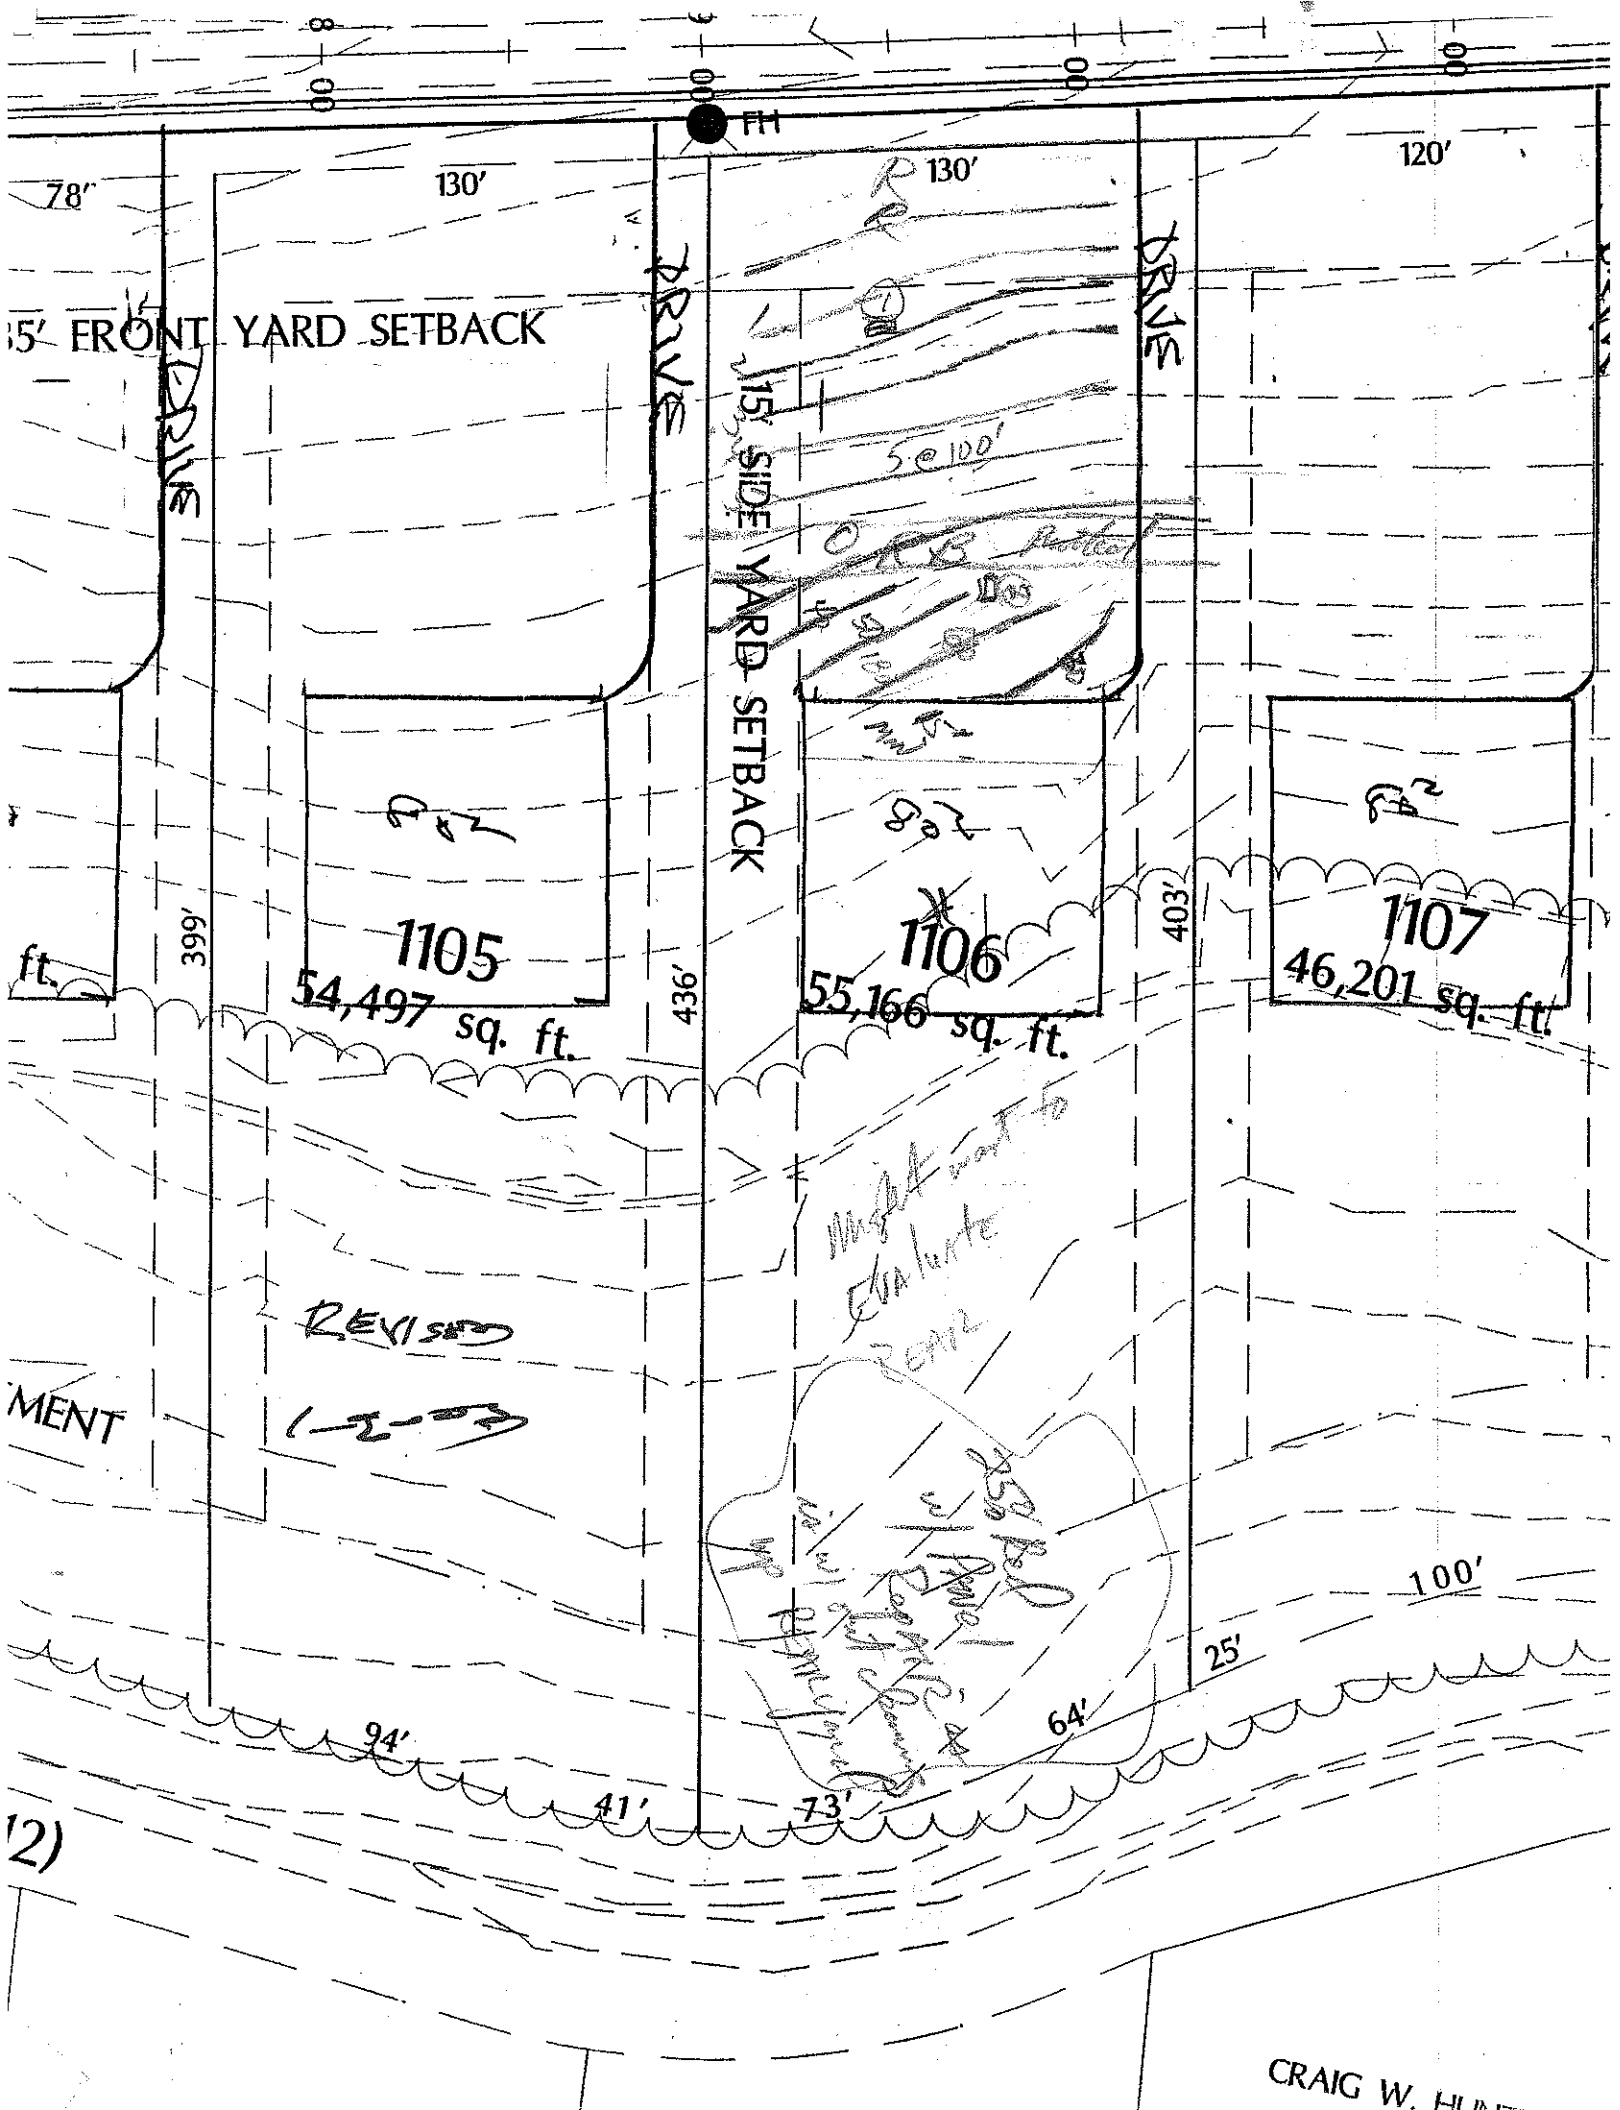
OWNER: CRI APPLICATION DATE: _____
ADDRESS: _____
PROPOSED FACILITY: _____ PROPOSED DESIGN FLOW (.1949): 480 gpd DATE EVALUATED: 4-7-03
LOCATION OF SITE: Lot 116 Lot 7 Loop PROPERTY SIZE: _____
WATER SUPPLY: ☐ Private ☒ Public ☒ Well ☐ Spring ☐ Other _____ PROPERTY RECORDED: _____
EVALUATION METHOD: ☐ Auger Boring ☒ Pit ☐ Cut
TYPE OF WASTEWATER: ☒ Sewage ☐ Industrial Process ☐ Mixed

PROFILE #	.1940 LAND-SCAPE POSITION/ SLOPE %	HORI-ZON DEPTH (IN.)	SOIL MORPHOLOGY (.1941) .1941 STRUCTURE/ TEXTURE	SOIL MORPHOLOGY (.1941) .1941 CONSISTENCE/ MINERALOGY	OTHER PROFILE FACTORS .1942 SOIL WETNESS/ COLOR	.1943 SOIL DEPTH	.1956 SAPRO CLASS	.1944 RESTR HORIZ	PROFILE CLASS & LTAR
1		0-9	wk sbk lmsl	lo ss sp					.225-.25
		9-33	wm sbk sc	fr sp	few manganese coatings				
		33-56	m lpr	fr sl p	for common lmsn				
						maybe FR. Rest			
2	4-6%	0-6	wk sbk sl clay lm	fr ss sp					.37 18"
		6-18	wk fm sbk lm sc cl	fr ss p	few mn				
		18-60	m fm sbk sl cl	fr ss sp	few mn				
3									
4									

DESCRIPTION	INITIAL SYSTEM	REPAIR SYSTEM
Available Space (.1945)		
System Type(s)	gm 25% Red	LPP PBBS
Site LTAR	.225 -.3	.225 -.3

OTHER FACTORS (.1946): _____
SITE CLASSIFICATION (.1948): SP
EVALUATED BY: DPH
OTHER(S) PRESENT: Paul Pennington

COMMENTS: REAR yard not evaluated, CRI did not want to clean up and dig Hpotes


78'
130'
130'
120'
35' FRONT YARD SETBACK
DRIVE
DRIVE
15' SIDE YARD SETBACK
1105
54,497 sq. ft.
1106
55,166 sq. ft.
1107
46,201 sq. ft.
399'
436'
403'
ft.
REVISED
MENT
94'
41'
73'
64'
25'
100'
12)
CRAIG W. HUN