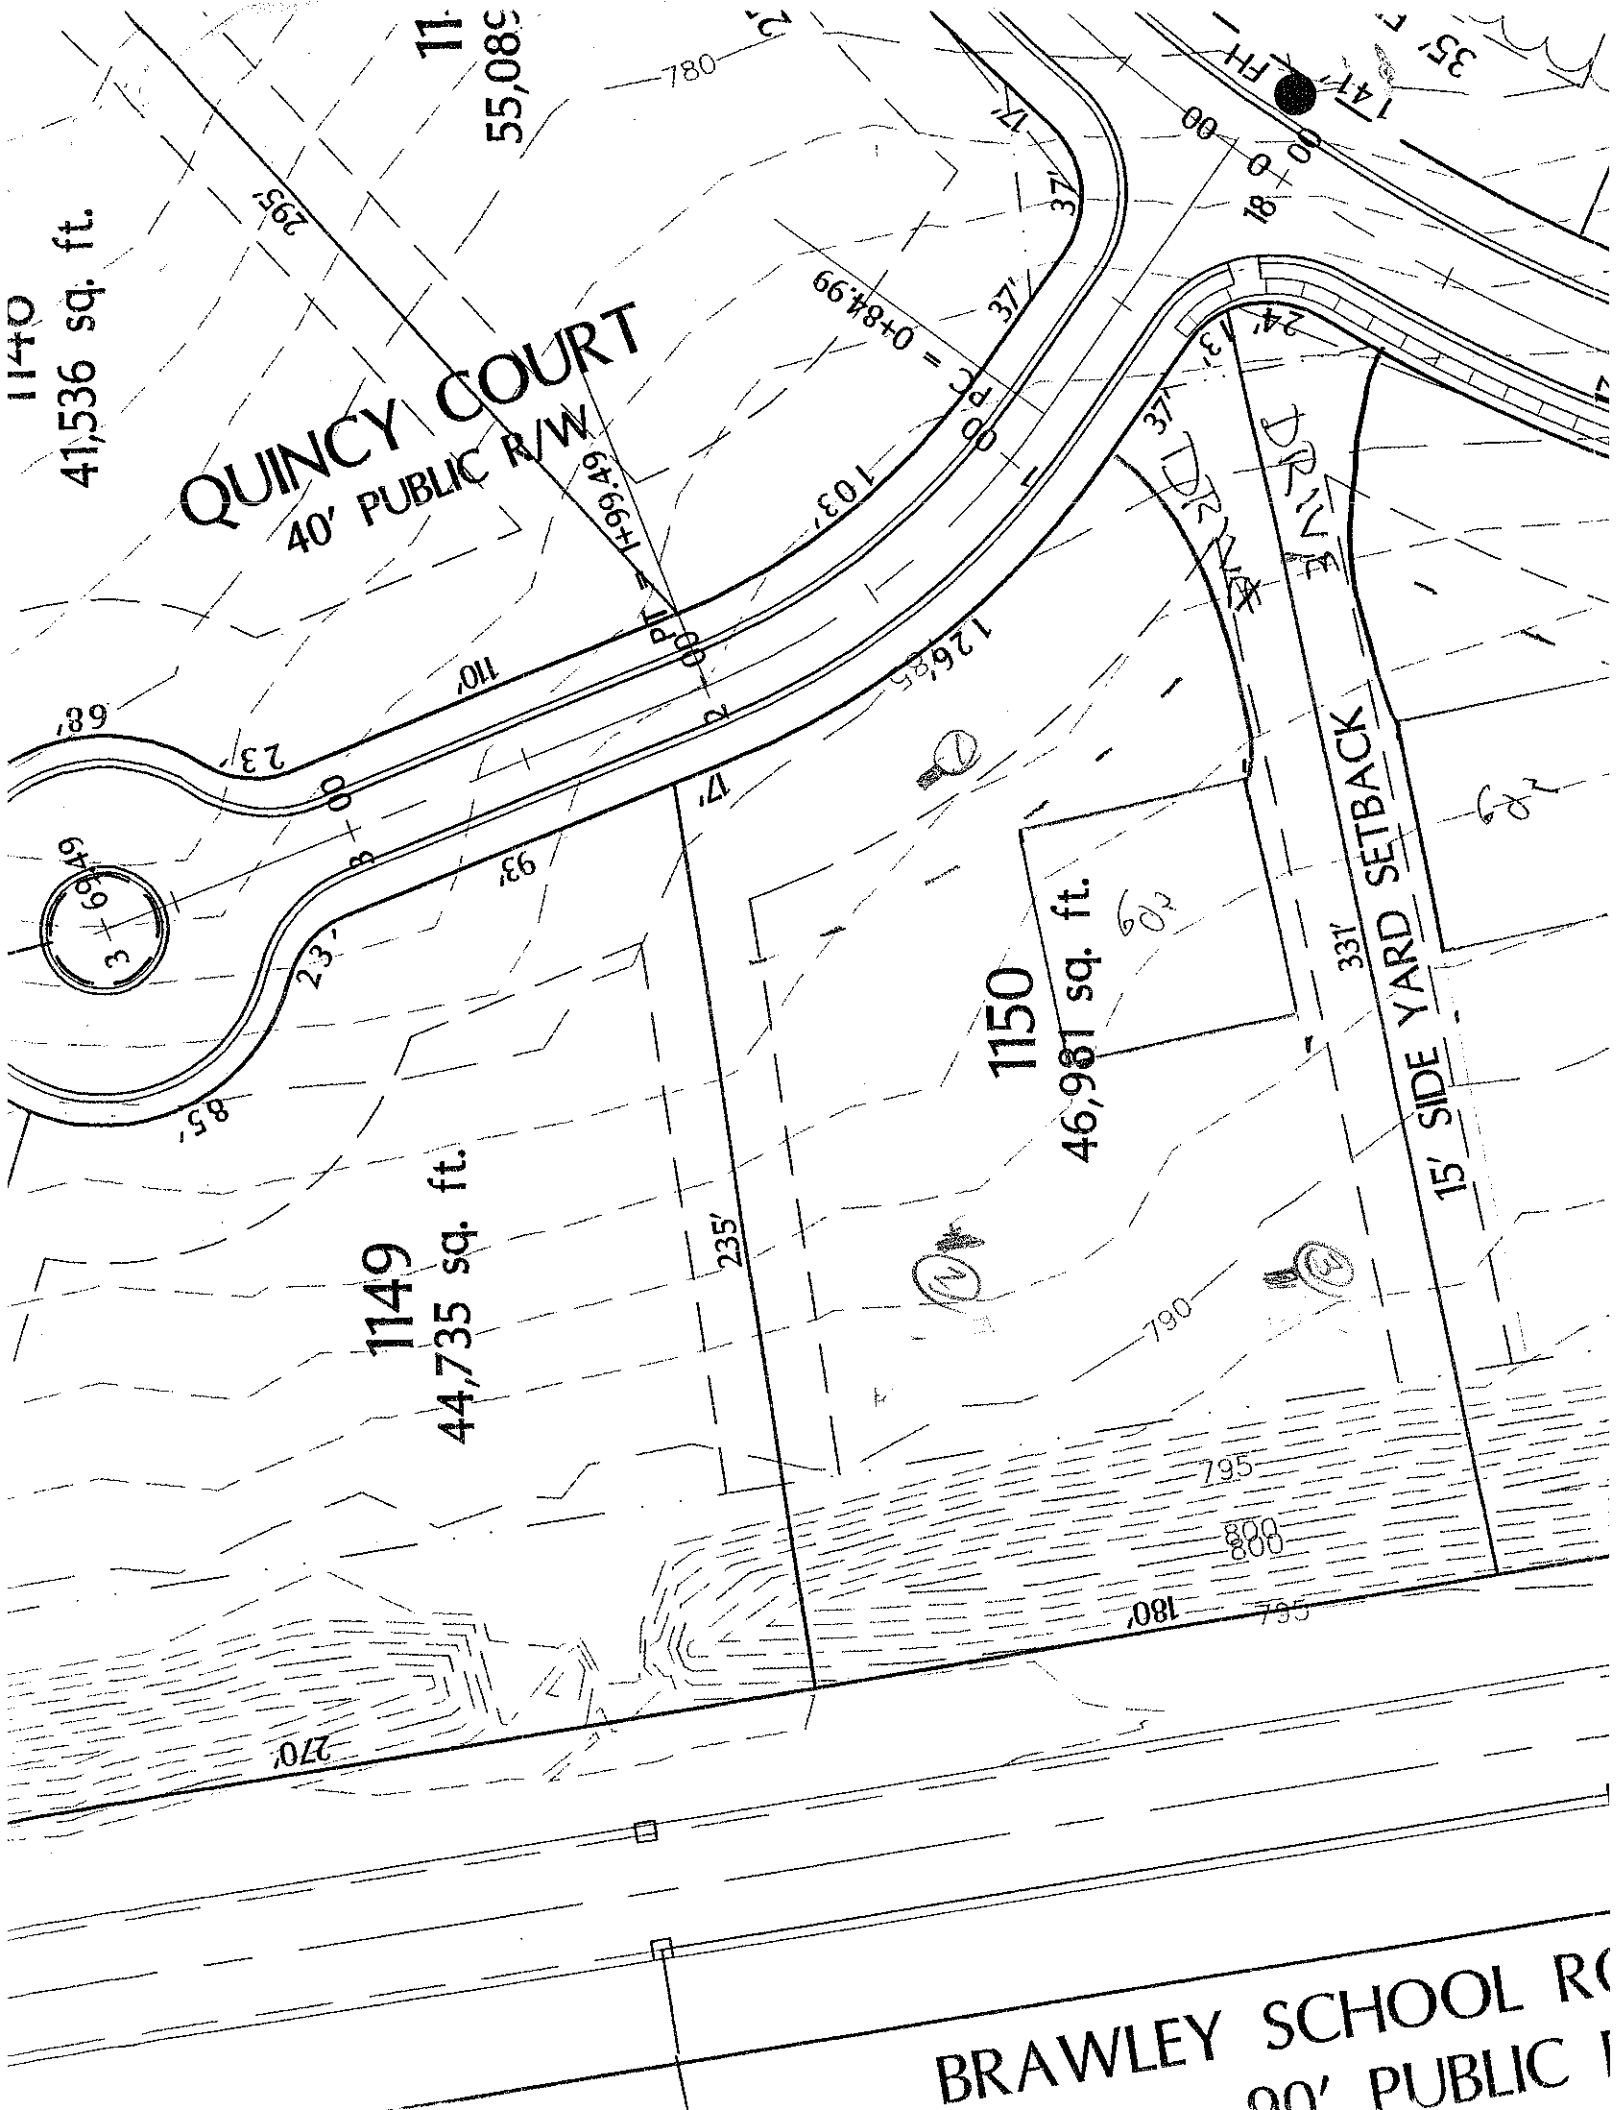

QUINCY COURT
40' PUBLIC R/W
1140
41,536 sq. ft.
1149
44,735 sq. ft.
1150
46,981 sq. ft.
15' SIDE YARD SETBACK
BRAWLEY SCHOOL RO
90' PUBLIC

DIVISION OF ENVIRONMENTAL HEALTH
ON-SITE WASTEWATER SECTION

Sheet ___ of ___
PROPERTY ID #: _____
COUNTY: _____

SOIL/SITE EVALUATION
for ON-SITE WASTEWATER SYSTEM

OWNER: CRT APPLICATION DATE _____
ADDRESS: _____
PROPOSED FACILITY: _____ PROPOSED DESIGN FLOW (.1949): 480 gpd DATE EVALUATED: 12-11-02
LOCATION OF SITE: Lot 1150 Thrift PROPERTY SIZE: _____
WATER SUPPLY: ☐ Private ☒ Public ☐ Well ☐ Spring ☐ Other _____ PROPERTY RECORDED: _____
EVALUATION METHOD: ☐ Auger Boring ☒ Pit ☐ Cut
TYPE OF WASTEWATER: ☒ Sewage ☐ Industrial Process ☐ Mixed Pat system in front

PROFILE #	.1940 LAND-SCAPE POSITION/ SLOPE %	HORI-ZON DEPTH (IN.)	SOIL MORPHOLOGY (.1941) .1941 STRUCTURE/ TEXTURE	SOIL MORPHOLOGY (.1941) .1941 CONSISTENCE/ MINERALOGY	OTHER PROFILE FACTORS .1942 SOIL WETNESS/ COLOR	.1943 SOIL DEPTH	.1956 SAPRO CLASS	.1944 RESTR HORIZ	PROFILE CLASS & LTAR
1	3-4%	0-7	wk sbk loam cl	fr ss sp	Subsoil				.3
		7-49	mf sbk loam sicl to ls sp / Lo and mc /	fr to ss sp					
2		0-5	Compact sandy soil						
		5-30	MPAB RC	fr ss sp	Low to low matrix				.25-.3
		30-49	mf sbk RCL	fr ss sp	Low mat loam sandy loam				
3		0-15	Compact sandy soil lcl						
		15-58	mf sbk RCL to fr SP SCL						.25 > .5
4									

DESCRIPTION	INITIAL SYSTEM	REPAIR SYSTEM
Available Space (.1945)		
System Type(s)	LPPBRS	LPPBRS
Site LTAR	.25-.3	.25-.3

OTHER FACTORS (.1946): _____
SITE CLASSIFICATION (.1948): PS per .1956
EVALUATED BY: DAH
OTHER(S) PRESENT: Heal Reenvironmen

COMMENTS: _____