PARTMENT OF ENVIRONMENT AND NATURAL RESOURCES
VISION OF ENVIRONMENTAL HEALTH
SITE WASTEWATER SECTION

Sheet ____ of ____
PROPERTY ID #: _____
COUNTY: _____

SOIL/SITE EVALUATION
for ON-SITE WASTEWATER SYSTEM

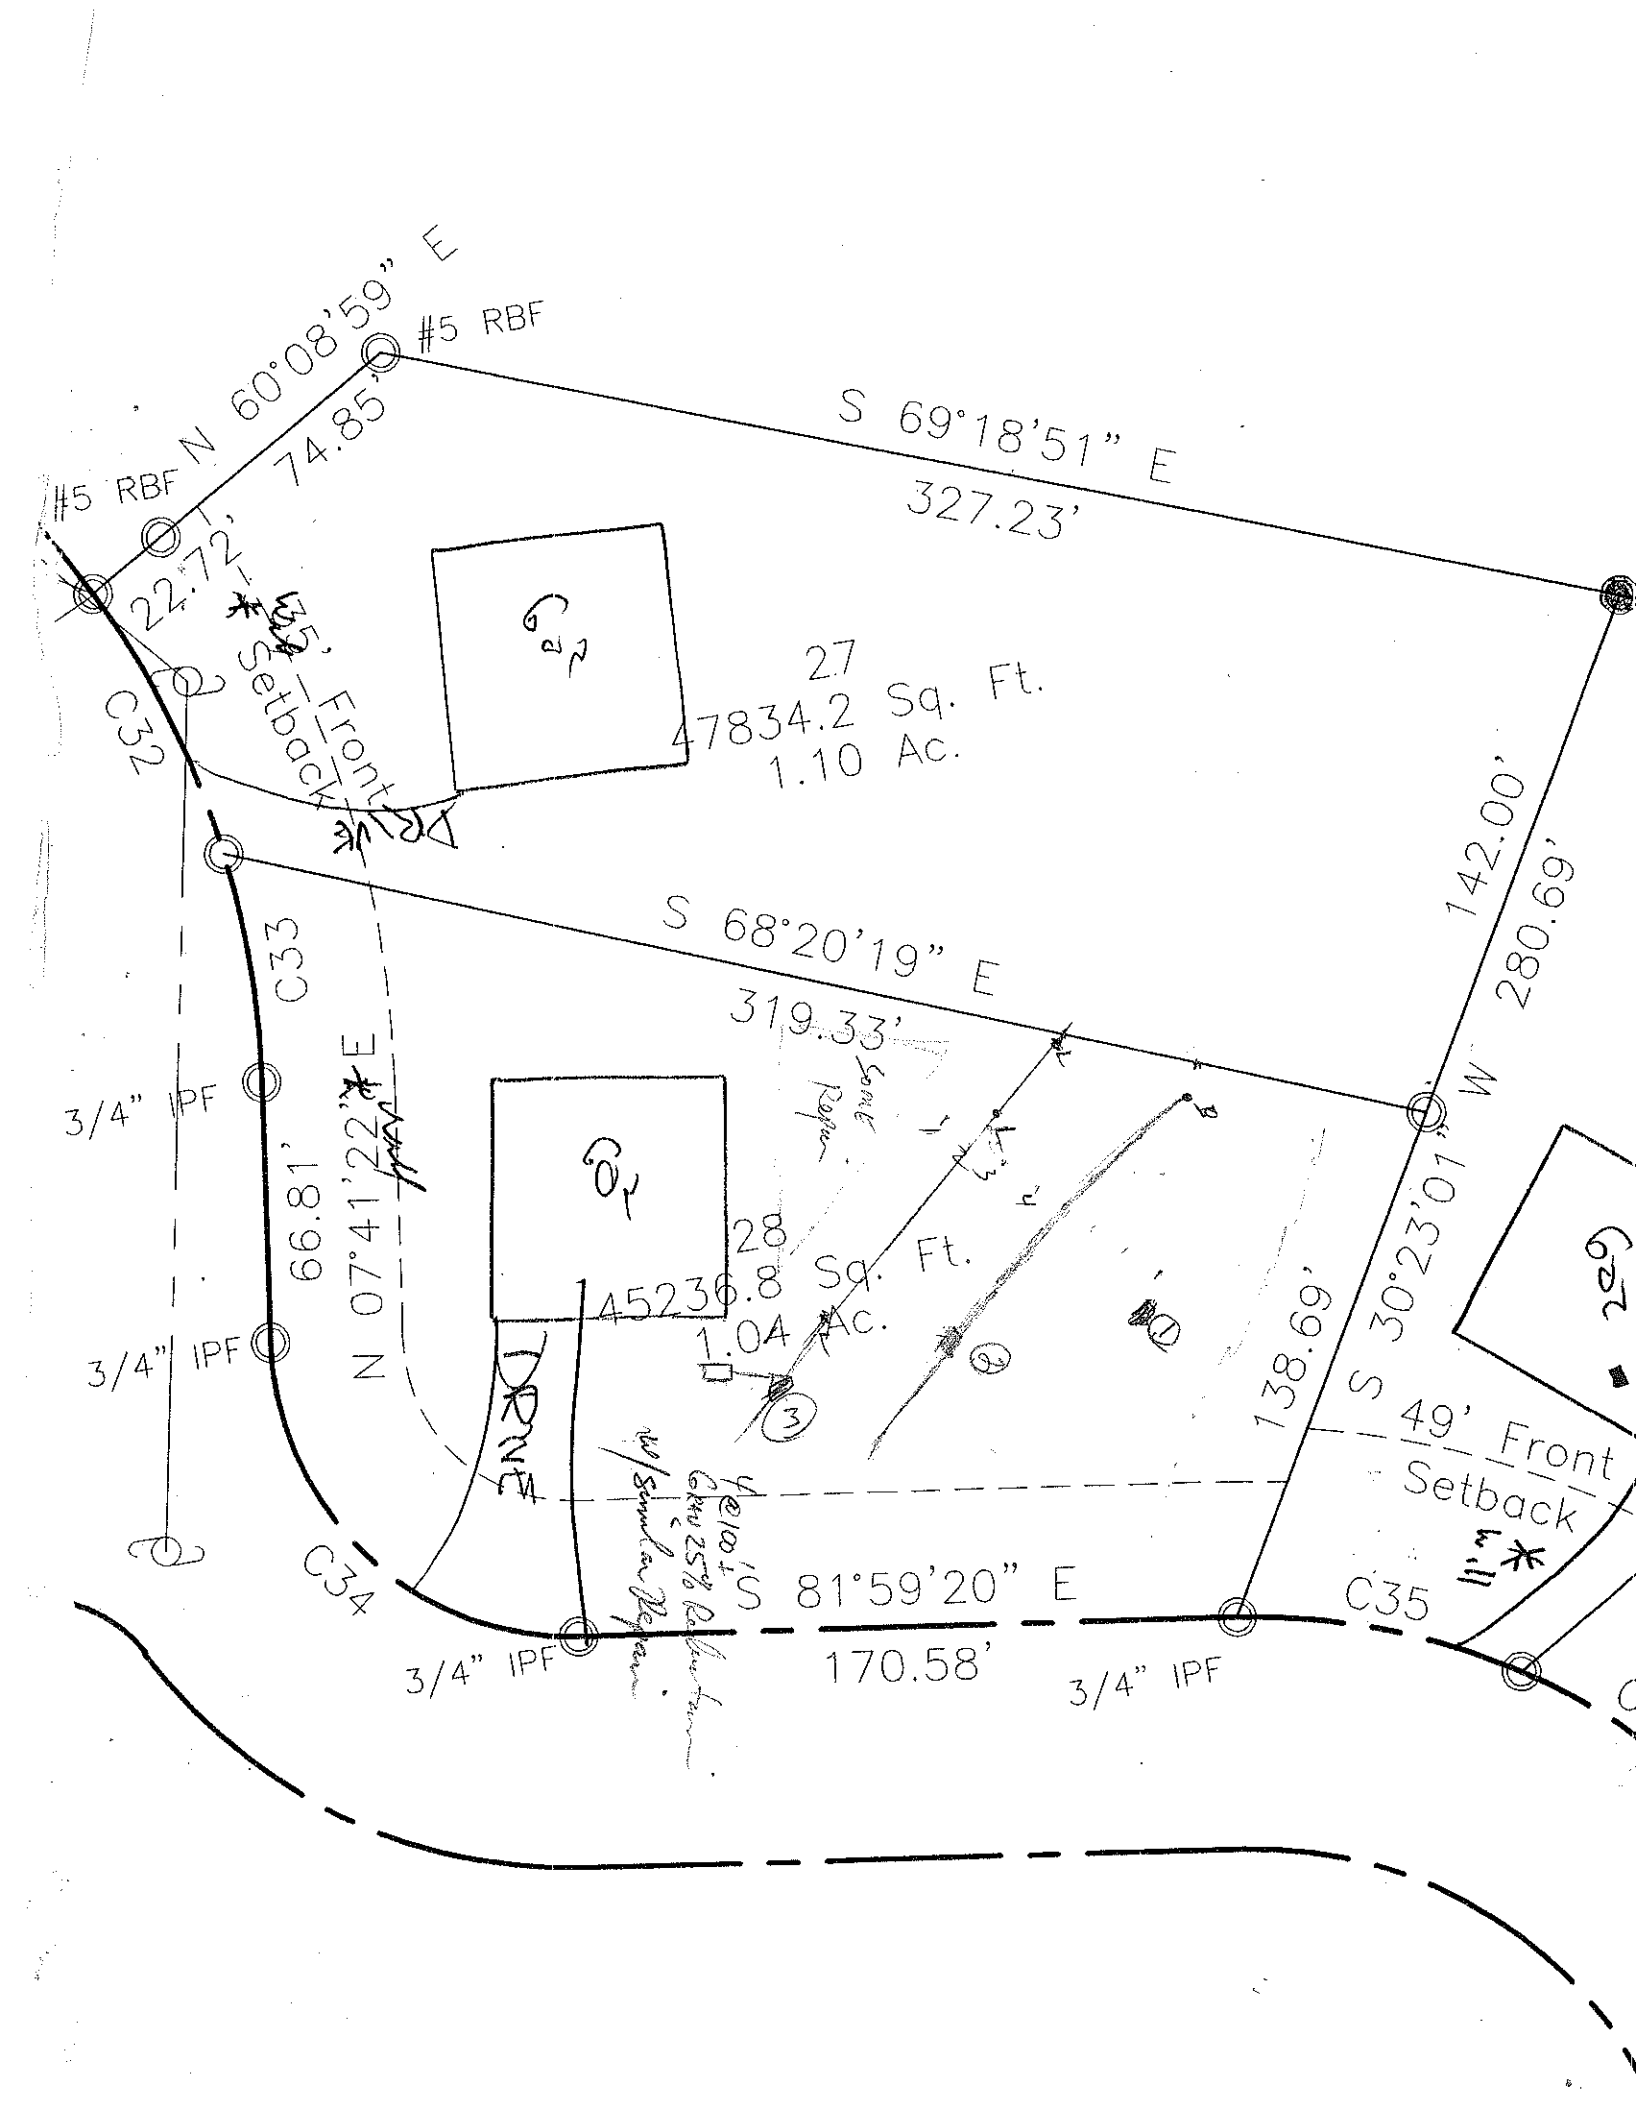
OWNER: _____ APPLICATION DATE _____
ADDRESS: _____
PROPOSED FACILITY: _____ PROPOSED DESIGN FLOW (.1949): 400gpd DATE EVALUATED: 8-7-03
LOCATION OF SITE: lot 28 Greenbay PROPERTY SIZE: _____
WATER SUPPLY: ☒ Private ☐ Public ☒ Well ☐ Spring ☐ Other _____ PROPERTY RECORDED: _____
EVALUATION METHOD: ☐ Auger Boring ☒ Pit ☐ Cut
TYPE OF WASTEWATER: ☒ Sewage ☐ Industrial Process ☐ Mixed

PROFILE #	.1940 LAND-SCAPE POSITION/ SLOPE %	HORI-ZON DEPTH (IN.)	SOIL MORPHOLOGY (.1941) .1941 STRUCTURE/ TEXTURE	.1941 CONSISTENCE/ MINERALOGY	OTHER PROFILE FACTORS .1942 SOIL WETNESS/ COLOR	.1943 SOIL DEPTH	.1956 SAPRO CLASS	.1944 RESTR HORIZ	PROFILE CLASS & LTAR
1		0-8	gr, gSL	fr SSS p					.3
		8-19	gr-wk sbk gSCL	fr SSS p					
		19-37	m sbk RSC	fr SSS p					
		37-60	wk sbk scl	fr SSS p					
2		0-19	gr wk sbk brwn SL	fr SSS p					.3
		19-50	m sbk gr sc/scl few banks SKP	fi-fr SSS p					
3		0-6	gr brwn SL	fr SSS p					.3
		6-20	gr brwn sl/scl	fr SSS p					
		20-38	m sbk R brwn C	fr SSS p SOM					
		38-48	m-f sbk RC	fr SSS p many relic mottles, few banks SKP					
		48-52	wk f sbk gr scl	fr SSS p					
4									

DESCRIPTION	INITIAL SYSTEM	REPAIR SYSTEM
Available Space (.1945)	PS	PS
System Type(s)	Conv 25% Red	Conv 25% Red
Site LTAR	.3	.3

OTHER FACTORS (.1946): _____
SITE CLASSIFICATION (.1948): PS
EVALUATED BY: [signature]
OTHER(S) PRESENT: Paul Rominger

COMMENTS: _____


#5 RBF
N 60°08'59" E
74.85'
#5 RBF
S 69°18'51" E
327.23'
#5 RBF
22.72'
C32
35' Front Setback
27
47834.2 Sq. Ft.
1.10 Ac.
S 68°20'19" E
319.33'
142.00'
S 30°23'01" W
280.69'
C33
3/4" IPF
66.81'
N 07°41'22" E
28
45236.8 Sq. Ft.
1.04 Ac.
3/4" IPF
138.69'
S 49' Front Setback
C34
S 81°59'20" E
C35
3/4" IPF
170.58'
3/4" IPF