DIVISION OF ENVIRONMENTAL HEALTH
ON-SITE WASTEWATER SECTION

Sheet ___ of ___
PROPERTY ID #: _____
COUNTY: _____

SOIL/SITE EVALUATION
for ON-SITE WASTEWATER SYSTEM

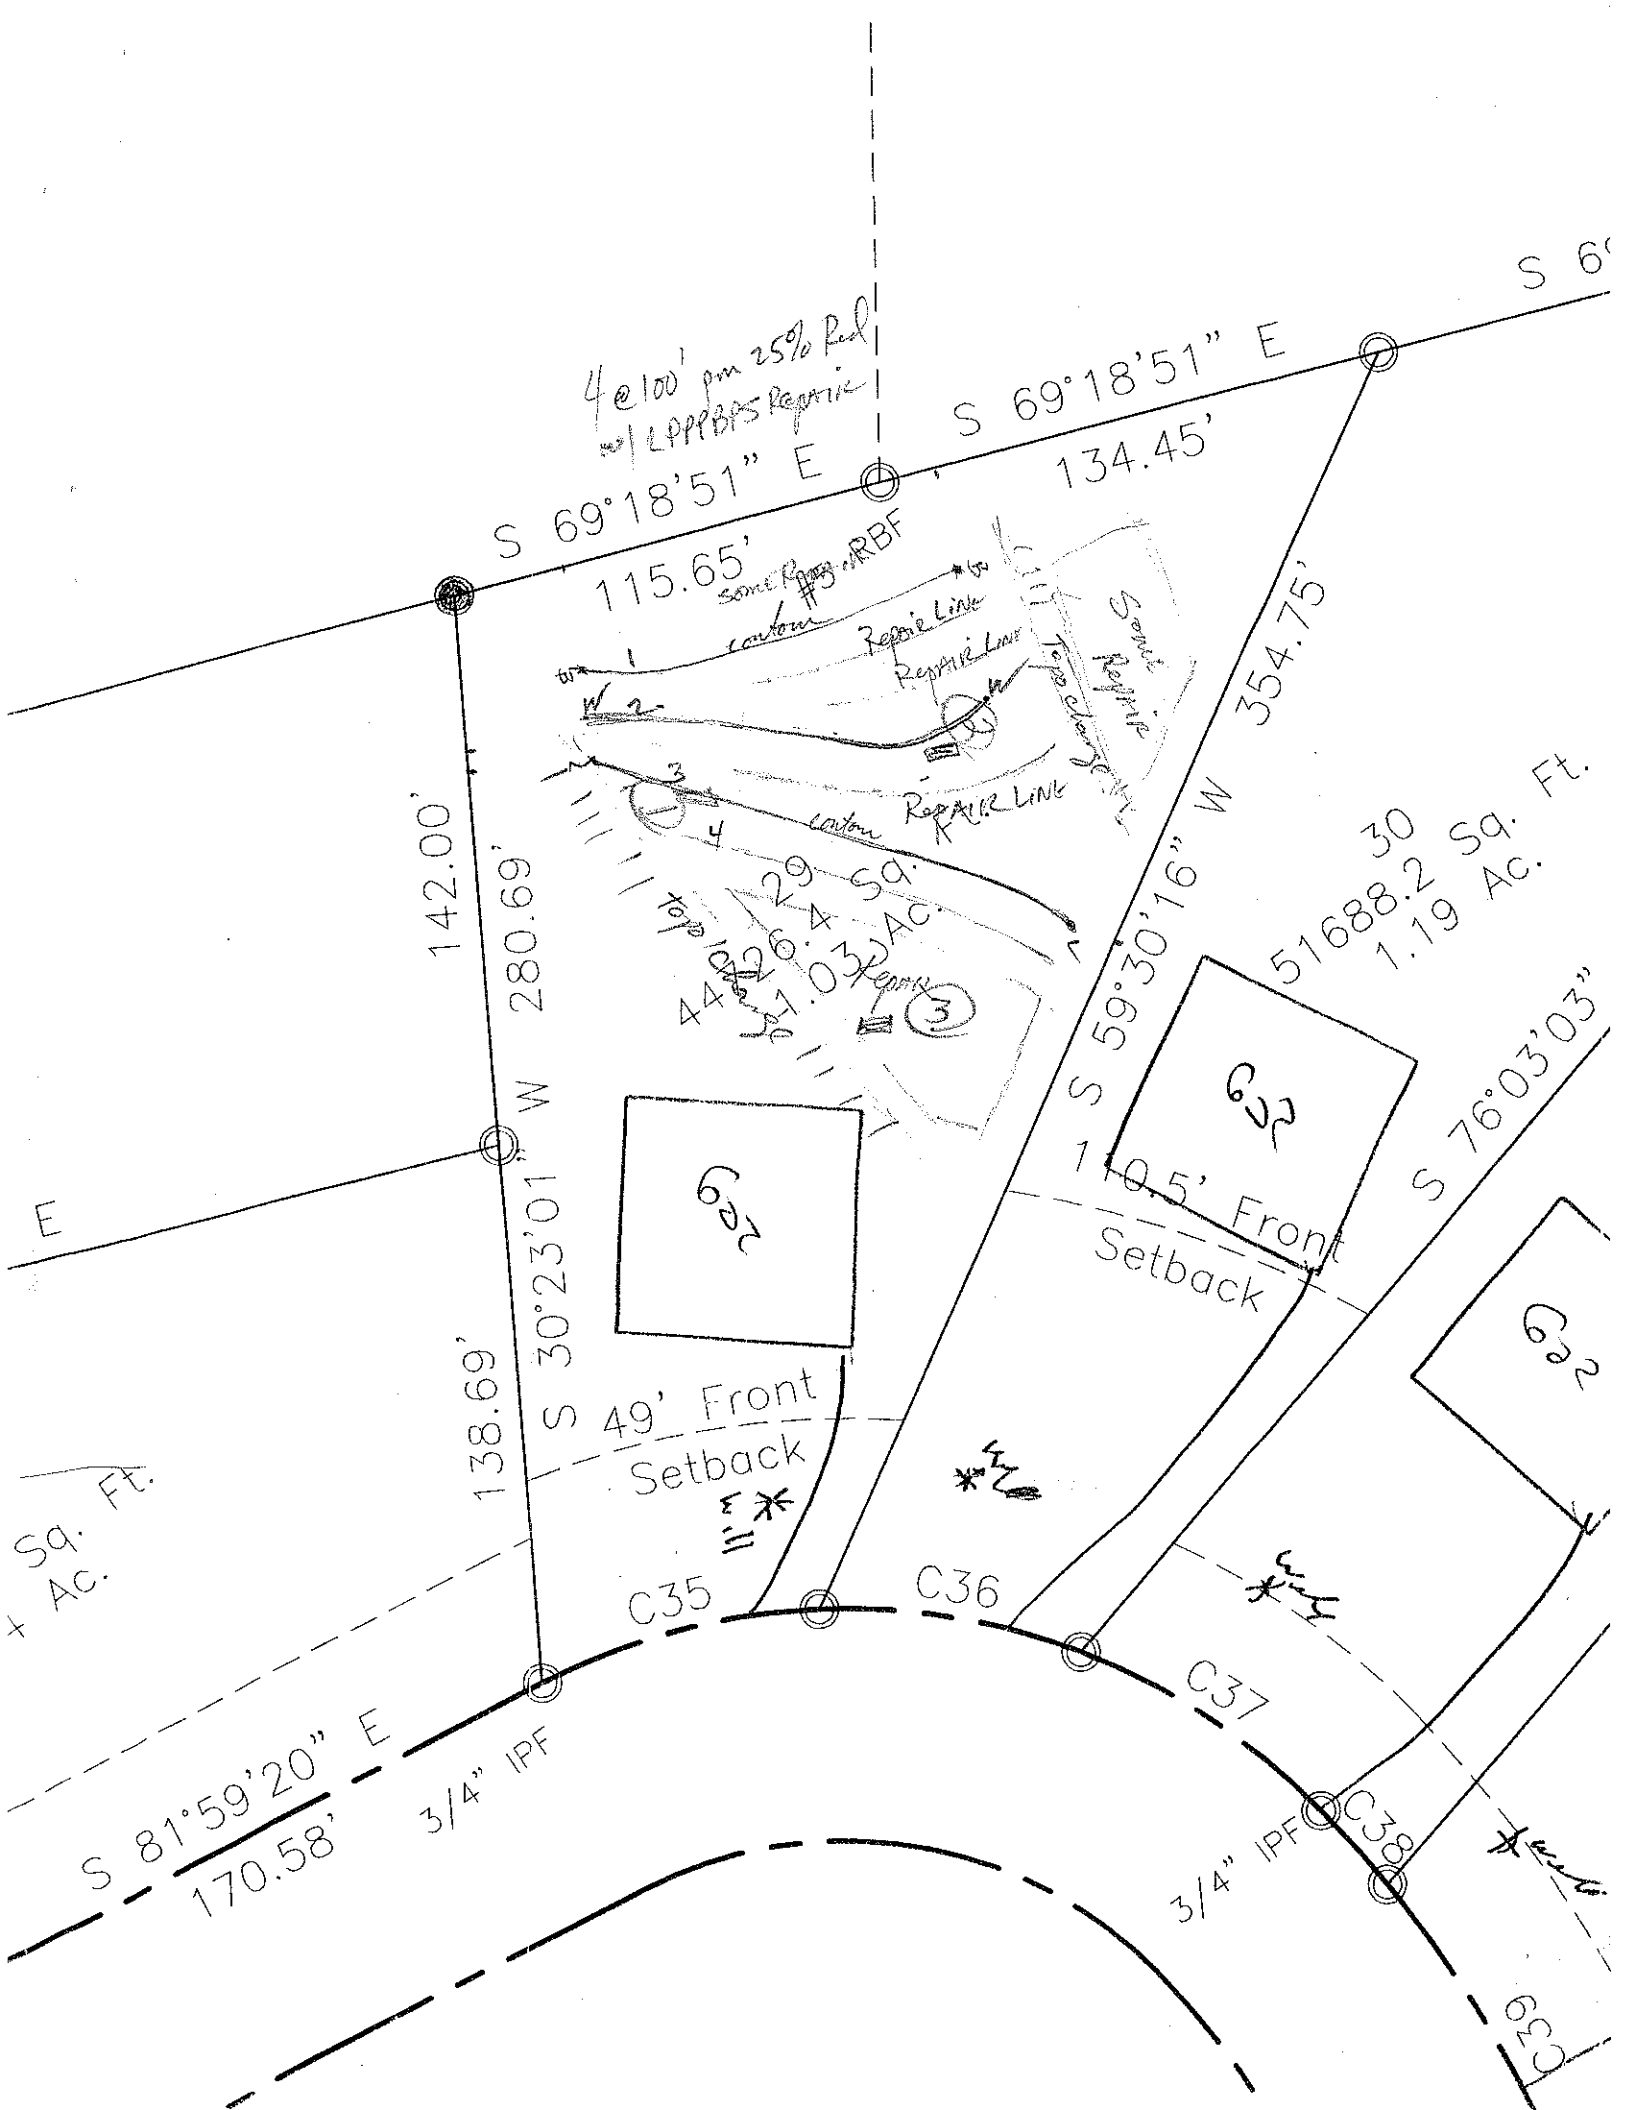
OWNER: _____ APPLICATION DATE _____
ADDRESS: _____ DATE EVALUATED: 7-20-23
PROPOSED FACILITY: _____ PROPOSED DESIGN FLOW (.1949): _____ PROPERTY SIZE: _____
LOCATION OF SITE: lot 29 Greenbrier PROPERTY RECORDED: _____
WATER SUPPLY: ☒ Private ☐ Public ☒ Well ☐ Spring ☐ Other _____
EVALUATION METHOD: ☐ Auger Boring ☒ Pit ☐ Cut
TYPE OF WASTEWATER: ☒ Sewage ☐ Industrial Process ☐ Mixed

PROFILE #	.1940 LANDSCAPE POSITION/ SLOPE %	HORIZON DEPTH (IN.)	SOIL MORPHOLOGY (.1941) .1941 STRUCTURE/ TEXTURE	SOIL MORPHOLOGY (.1941) .1941 CONSISTENCE/ MINERALOGY	OTHER PROFILE FACTORS .1942 SOIL WETNESS/ COLOR	.1943 SOIL DEPTH	.1956 SAPRO CLASS	.1944 RESTR HORIZ	PROFILE CLASS & LTAR
1		0-10	gr brn sl	fr sss p					.3
		10-37	wk mod rc	fr sp sop					
		37-50	wk sbk yr sdl	fr sss p fam mi sap					
2	6%	0-6	gr brn sl	fr					.3
		6-24	wk sbk rc	fr ss p so p					
		24-33	wk mod yr sbk	fr ss p					
		33-57	wk mod yr sbk	fr ss p	common mi sap				
3		0-13	gr brn sl	fr ss p					.3
		13-33	wk sbk rc	fr ss p so p					
		33-39	wk mod yr sbk	fr ss p	common mi sap				
		39-50	mod thick yr sbk	fr ss p					
4									

DESCRIPTION	INITIAL SYSTEM	REPAIR SYSTEM
Available Space (.1945)	PS	PS
System Type(s)	gm - 25% red	LPP BPS
Site LTAR	.3	.3

OTHER FACTORS (.1946): _____
SITE CLASSIFICATION (.1948): PS
EVALUATED BY: DRH
OTHER(S) PRESENT: Paul Pennington

COMMENTS: _____


4 @ 100' pm 25% Red w/ LPPPBAS Reprint
S 69°18'51" E
115.65'
S 69°18'51" E
134.45'
S 6
some #5 RBF
custom
Repair Line
Repair Line
Top of Slope
Some Repair
custom Repair Line
1
2
3
4
29 Sq.
426 Ac.
1.03 Ac.
Repair
3
142.00'
280.69'
S 30°23'01" W
138.69'
S 59°30'16" W
354.75'
30
51688.2 Sq. Ft.
1.19 Ac.
S 76°03'03"
110.5' Front
Setback
49' Front
Setback
C35
C36
C37
C38
C39
S 81°59'20" E
170.58'
3/4" IPF
3/4" IPF
E
Sq. Ft.
+ Ac.