DEPARTMENT OF ENVIRONMENT AND NATURAL RESOURCES
DIVISION OF ENVIRONMENTAL HEALTH
ON-SITE WASTEWATER SECTION

Sheet ___ of ___
PROPERTY ID #: _____
COUNTY: _____

SOIL/SITE EVALUATION
for ON-SITE WASTEWATER SYSTEM

OWNER: All Star Homes — APPLICATION DATE _____
ADDRESS: _____ — DATE EVALUATED: 7-12-07
PROPOSED FACILITY: _____ — PROPOSED DESIGN FLOW (.1949): 480 — PROPERTY SIZE: _____
LOCATION OF SITE: Marietta Overlook #3 — PROPERTY RECORDED: _____
WATER SUPPLY: ☐ Private ☐ Public ☒ Well ☐ Spring ☐ Other _____
EVALUATION METHOD: ☒ Auger Boring ☐ Pit ☐ Cut — TYPE OF WASTEWATER: ☒ Sewage ☐ Industrial Process ☐ Mixed

PROFILE #	.1940 LANDSCAPE POSITION/ SLOPE %	HORIZON DEPTH (IN.)	SOIL MORPHOLOGY (.1941) .1941 STRUCTURE/ TEXTURE	SOIL MORPHOLOGY (.1941) .1941 CONSISTENCE/ MINERALOGY	OTHER PROFILE FACTORS .1942 SOIL WETNESS/ COLOR	OTHER PROFILE FACTORS .1943 SOIL DEPTH	OTHER PROFILE FACTORS .1956 SAPRO CLASS	OTHER PROFILE FACTORS .1944 RESTR HORIZ	PROFILE CLASS & LTAR
1	10%	0-4	Br scl	fr ss sp	c-m sap	42			.3
		4-17	m/w K sbk C. Red	fr ss sp st					
		17-28	sbk R cl	fr ss sp					
		28-42	wK sbk cl	fr ss sp					
		42-48+	L sap						
2		0-20	sbk cl	fi/fr ss sp		20			.3 suitable sap
		20-48	si/L sap						
3		0-20	sbk C	fr ss sp					.3
		20-48	si/L sap	fr ss sp					
4									

DESCRIPTION	INITIAL SYSTEM	REPAIR SYSTEM
Available Space (.1945)	yes	yes
System Type(s)	LP pump	same
Site LTAR	.3	.3

OTHER FACTORS (.1946): _____
SITE CLASSIFICATION (.1948): _____
EVALUATED BY: J. Melville
OTHER(S) PRESENT: _____
COMMENTS: _____

DEPARTMENT OF ENVIRONMENT AND NATURAL RESOURCES
DIVISION OF ENVIRONMENTAL HEALTH
ON-SITE WASTEWATER SECTION

Sheet ___ of ___
PROPERTY ID #: _____
COUNTY: _____

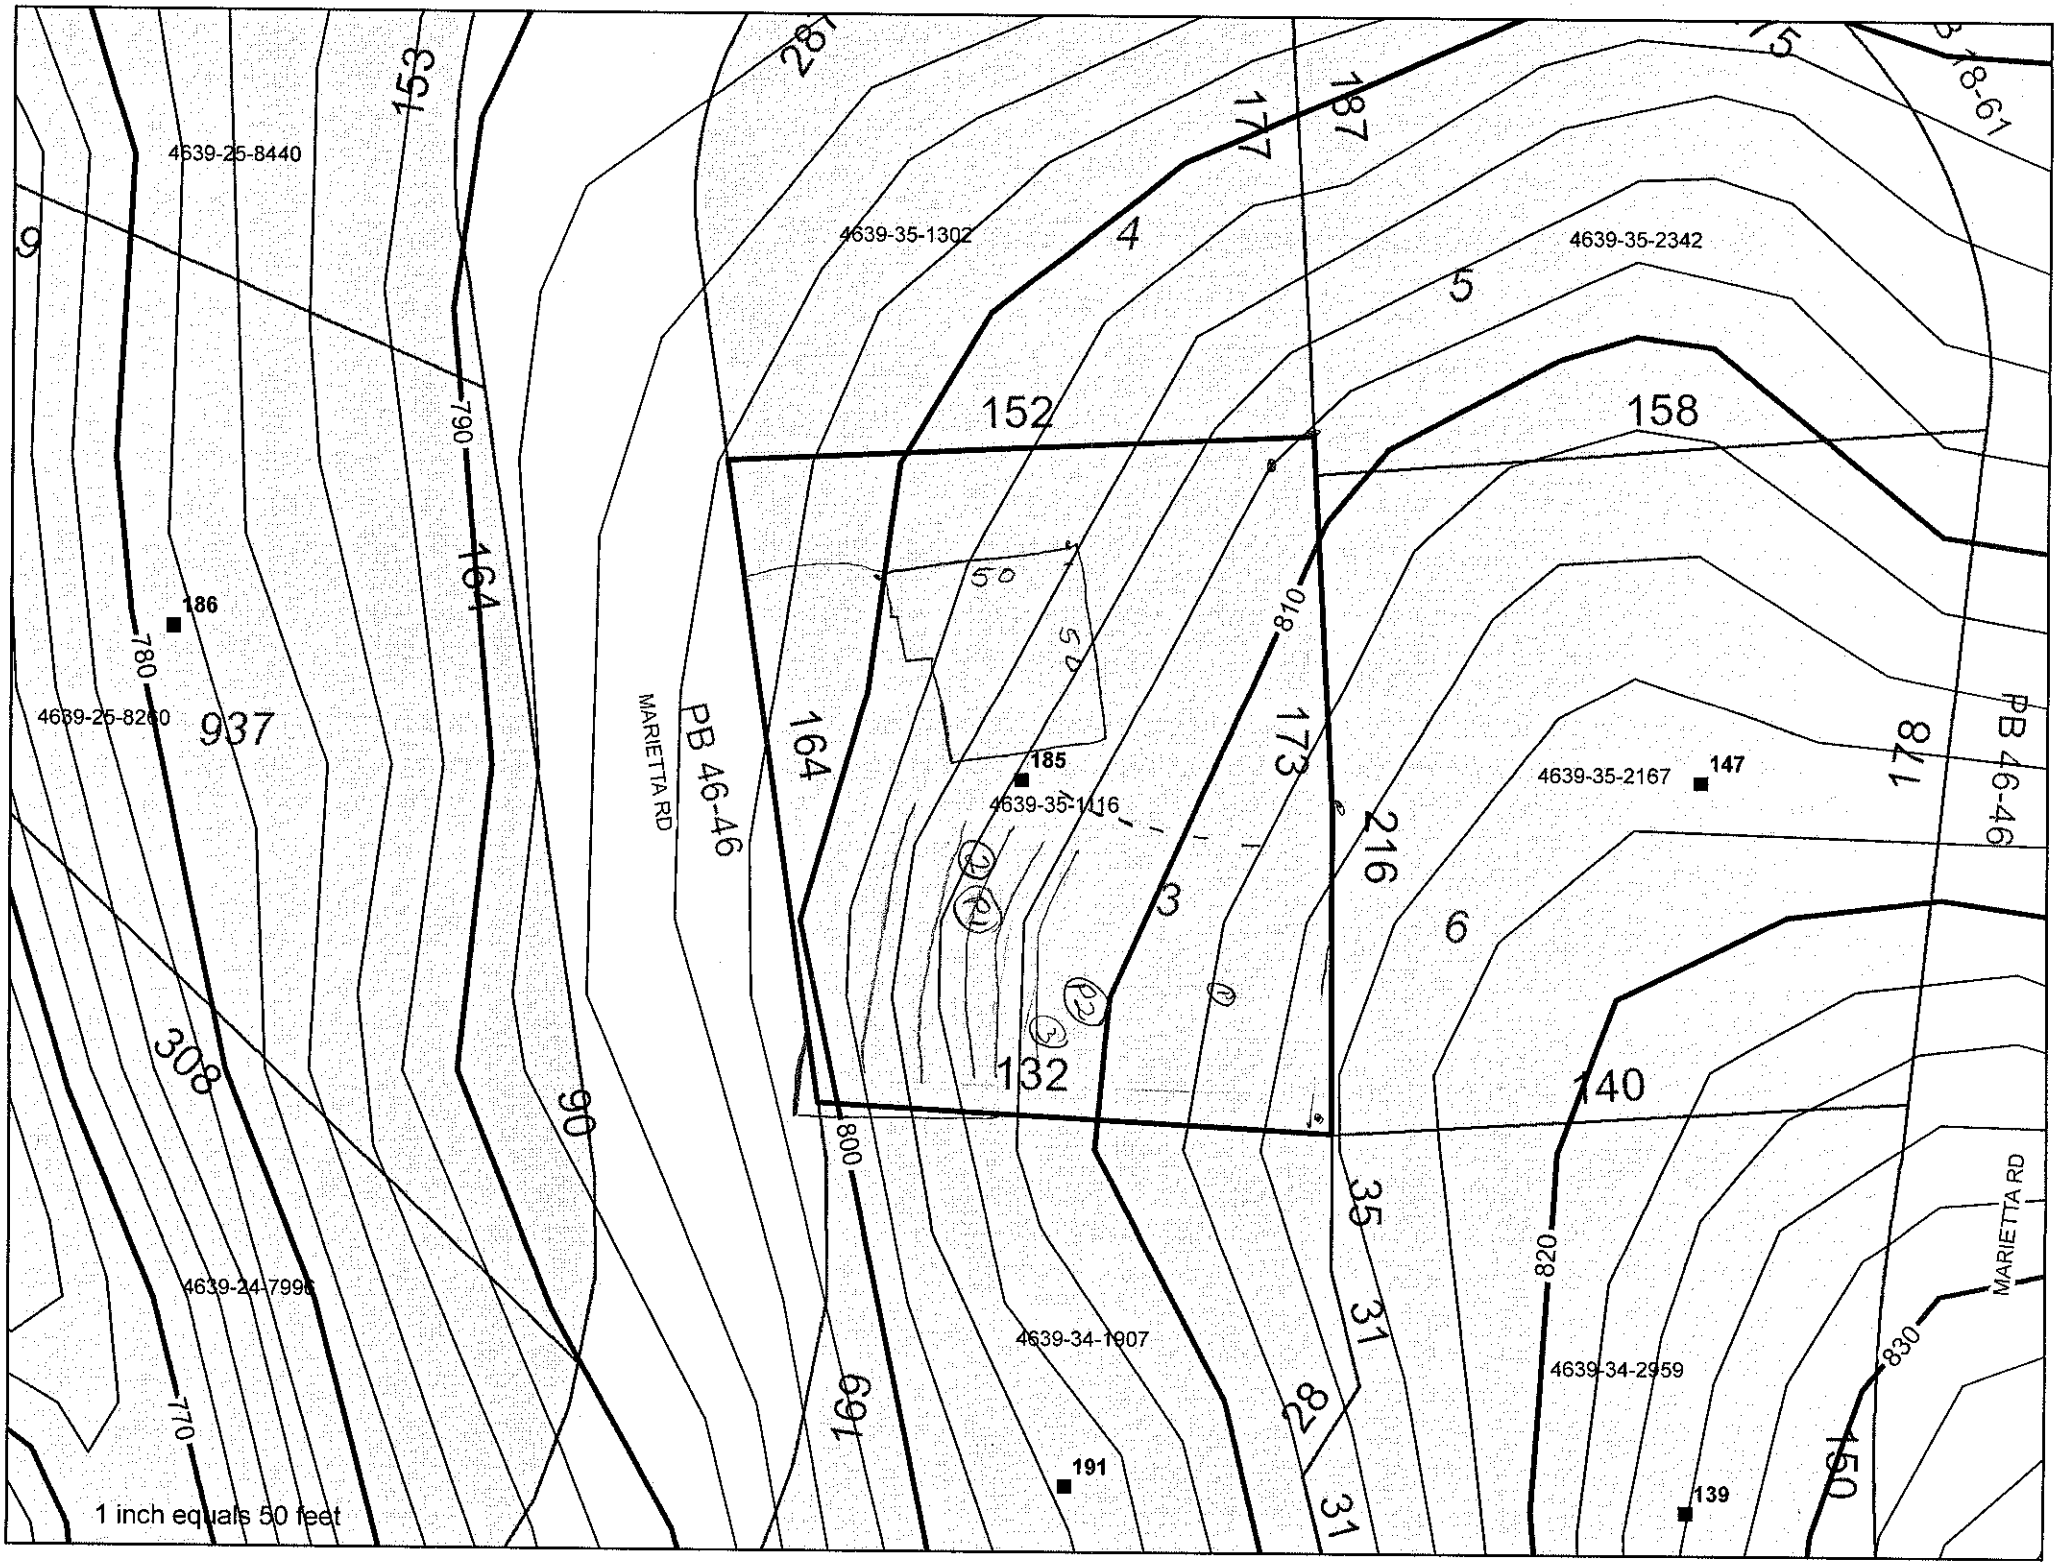
SOIL/SITE EVALUATION
for ON-SITE WASTEWATER SYSTEM

OWNER: All Star _____ APPLICATION DATE _____
ADDRESS: _____ DATE EVALUATED: 7-18-07
PROPOSED FACILITY: _____ PROPOSED DESIGN FLOW (.1949): 480 PROPERTY SIZE: _____
LOCATION OF SITE: _____ PROPERTY RECORDED: _____
WATER SUPPLY: ☐ Private ☐ Public ☐ Well ☐ Spring ☐ Other _____
EVALUATION METHOD: ☐ Auger Boring ☒ Pit ☐ Cut TYPE OF WASTEWATER: ☐ Sewage ☐ Industrial Process ☐ Mixed

PROFILE #	.1940 LANDSCAPE POSITION/ SLOPE %	HORIZON DEPTH (IN.)	SOIL MORPHOLOGY (.1941) .1941 STRUCTURE/ TEXTURE	SOIL MORPHOLOGY (.1941) .1941 CONSISTENCE/ MINERALOGY	OTHER PROFILE FACTORS .1942 SOIL WETNESS/ COLOR	.1943 SOIL DEPTH	.1956 SAPRO CLASS	.1944 RESTR HORIZ	PROFILE CLASS & LTAR
1 near AA-8	Lower pit 11.0	0-4	wksbkscl	fr		26	f-sap	f-WR	.3 suit. sap
		4-26	mdsbkc	fr sss pse					
		26-60	s1/ro.s1	sap f-WR					
2 near AA-3	upper pit	0-18	mdsbkc	fr sssp		18			.3 suit. sap
		18-60	s1/ls sap	fr ns np f inc. cl					
3									
4									

DESCRIPTION	INITIAL SYSTEM	REPAIR SYSTEM
Available Space (.1945)		
System Type(s)		
Site LTAR		

OTHER FACTORS (.1946): _____
SITE CLASSIFICATION (.1948): _____
EVALUATED BY: _____
OTHER(S) PRESENT: pits by Lamberth Grading


4639-25-8440
4639-35-1302
4639-35-2342
4639-25-8260
937
4639-35-1116
4639-35-2167
4639-24-7996
4639-34-1907
4639-34-2959
MARIETTA RD
PB 46-46
186
185
147
191
139
152
158
132
140
153
164
90
308
216
178
173
187
177
810
800
820
830
790
780
770
1 inch equals 50 feet