DEPARTMENT OF ENVIRONMENT AND NATURAL RESOURCES
DIVISION OF ENVIRONMENTAL HEALTH
ON-SITE WASTEWATER SECTION

Sheet 1 of 1
PROPERTY ID #:
COUNTY: Brunswick

# SOIL/SITE EVALUATION
## *for* ON-SITE WASTEWATER SYSTEM

OWNER: Harmony Baptist Church APPLICATION DATE
ADDRESS: DATE EVALUATED: 7/28/08
PROPOSED FACILITY: PROPOSED DESIGN FLOW (.1949): PROPERTY SIZE:
LOCATION OF SITE: Little Wilkesboro Rd. PROPERTY RECORDED:
WATER SUPPLY: ☐ Private ☑ Public ☐ Well ☐ Spring ☐ Other
EVALUATION METHOD: ☑ Auger Boring ☐ Pit ☐ Cut
TYPE OF WASTEWATER: ☑ Sewage ☐ Industrial Process ☐ Mixed

| PROFILE # | .1940 LAND-SCAPE POSITION/ SLOPE % | HORI-ZON DEPTH (IN.) | SOIL MORPHOLOGY (.1941) .1941 STRUCTURE/ TEXTURE | SOIL MORPHOLOGY (.1941) .1941 CONSISTENCE/ MINERALOGY | OTHER PROFILE FACTORS .1942 SOIL WETNESS/ COLOR | .1943 SOIL DEPTH | .1956 SAPRO CLASS | .1944 RESTR HORIZ | PROFILE CLASS & LTAR |
|---|---|---|---|---|---|---|---|---|---|
| 1 | linear 8% | 0-36 | CL wSBK | fr SS SP SEXP | | 42" | unsuitable | | PS .4 |
| | | 36-42 | CL wSBK | vfr SS SP SEXP | | | | | |
| | | 42-48 | SAP | | | | | | |
| 2 | linear 8% | 0-48 | CL WABK | vfr SEXP | | 48" | | | PS .3 |
| 3 | linear 8% | 0-13 | CL wSBK | fr SEXP | | 13" | unsuitable | | unsuitable |
| | | 13-19 | SAP | | | | | | |
| 4 | | | | | | | | | |

| DESCRIPTION | INITIAL SYSTEM | REPAIR SYSTEM |
|---|---|---|
| Available Space (.1945) | | |
| System Type(s) | conventional | |
| Site LTAR | .3 | .3 |

OTHER FACTORS (.1946):
SITE CLASSIFICATION (.1948): Provisionally suitable
EVALUATED BY: Kyle Baker
OTHER(S) PRESENT: Steve Hedrick

COMMENTS: system shall be installed on contour

# LEGEND

*use the following standard abbreviations*

| LANDSCAPE POSITION | GROUP | SOIL TEXTURE | CONVENTIONAL .1955 LTAR* | LPP .1957 LTAR* | MINERALOGY/ CONSISTENCE | STRUCTU |
|---|---|---|---|---|---|---|
| CC (Concave Slope) | I | S (Sand) | 1.2 - 0.8 | 0.6 - 0.4 | NEXP (Non-expansive) | G (Single Grain) |
| CV (Convex Slope) | | LS (Loamy Sand) | | | SEXP (Slightly Expansive) | M (Massive) |
| D (Drainage Way) | | | | | EXP (Expansive) | CR (Crumb) |
| DS (Debris Slump) | II | SL (Sandy Loam) | 0.8 - 0.6 | 0.4 - 0.3 | | GR (Granular) |
| FP (Flood Plain) | | L (Loam) | | | | SBK (Subangular Blocky, |
| FS (Foot Slope) | | | | | | ABK (Angular Blocky) |
| H (Head Slope) | III | SCL (Sandy Clay Loam) | 0.6 - 0.3 | 0.3 - 0.15 | | PL (Platy) |
| L (Linear Slope) | | SiL (Silt Loam) | | | | PR (Prismatic) |
| N (Nose Slope) | | CL (Clay Loam) | | | | |
| R (Ridge) | | SiCL (Silty Clay Loam) | | | MOIST | WET |
| S (Shoulder Slope) | | Si (Silt) | | | | |
| T (Terrace) | | | | | VFR (Very Friable) | NS (Non-sticky) |
| | IV | SC (Sandy Clay) | 0.4 - 0.1 | 0.2 - 0.05 | FR (Friable) | SS (Slightly Sticky) |
| | | SiC (Silty Clay) | | | FI (Firm) | S (Sticky) |
| | | C (Clay) | | | VFI (Very Firm v. Very Sticky) | VS (Very Sticky) |
| | | O (Organic) | None | | EFI (Extremely Firm) | NP (Non-plastic) |
| | | | | | | SP (Slightly Plastic) |
| | | | | | | P (Plastic) |
| | | | | | | VP (Very Plastic) |

*Adjust LTAR due to depth, consistence, structure, soil wetness, landscape, position, wastewater flow and quality.


***NOTES***

| | |
|---|---|
| *HORIZON DEPTH* | In inches below natural soil surface |
| *DEPTH OF FILL* | In inches from land surface |
| *RESTRICTIVE HORIZON* | Thickness and depth from land surface |
| *SAPROLITE* | S(suitable) or U(unsuitable) |
| *SOIL WETNESS* | Inches from land surface to free water or inches from land surface to soil colors with chroma 2 or less - record Munsell color chip designation |
| *CLASSIFICATION* | S (Suitable), PS (Provisionally Suitable), or U (Unsuitable) |

Evaluation of saprolite shall be by pits.

Long-term Acceptance Rate (LTAR): gal/day/ft$^2$

**Show profile locations and other site features (dimensions, reference or benchmark, and North).**

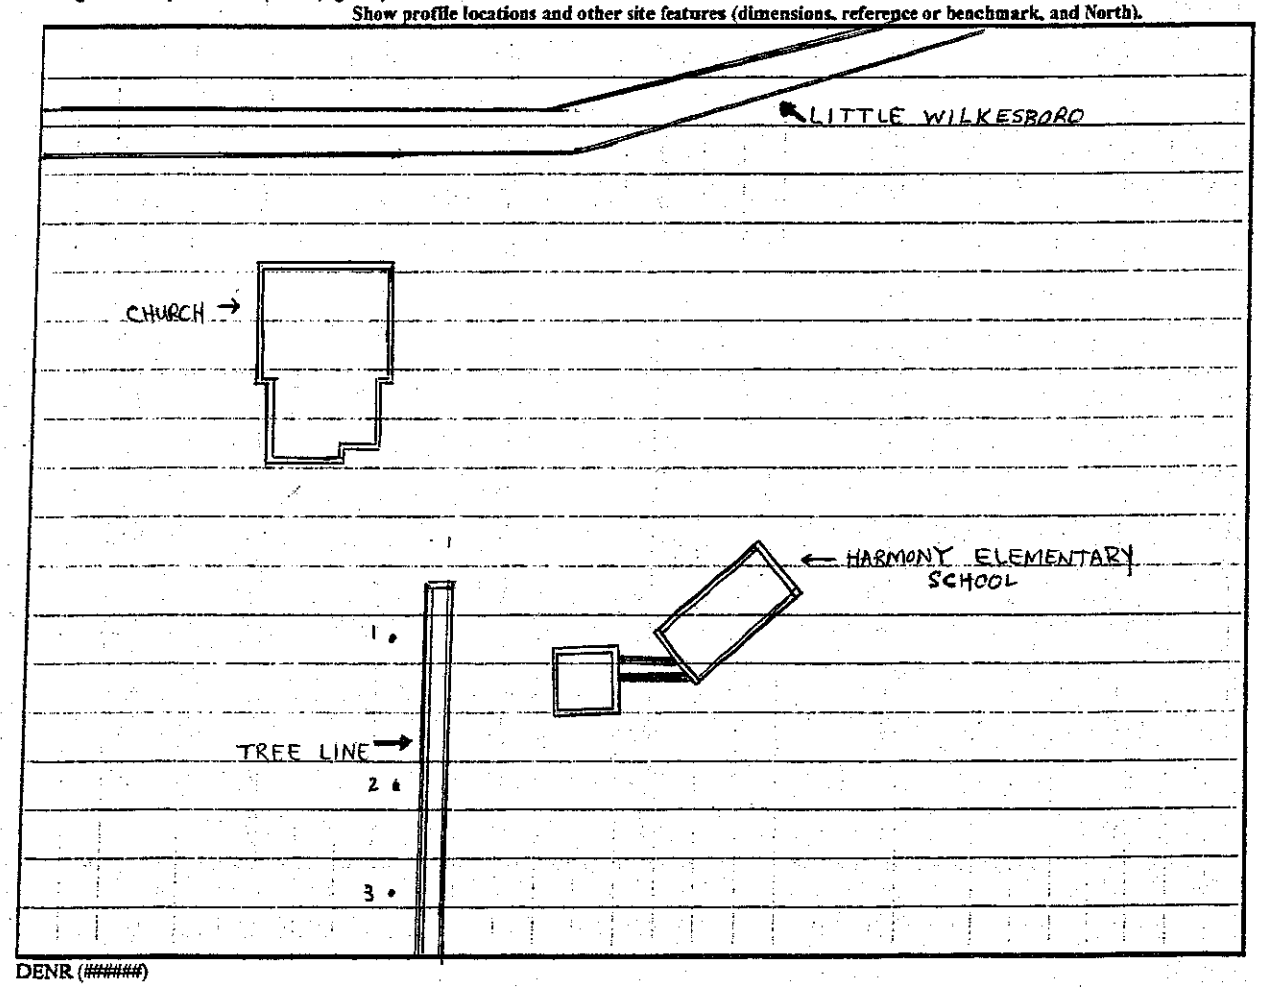


DENR (######)

Review (#####)