159457
3774-82-4876

DENR/DEH

ON-SITE WASTEWATER SECTION

Sheet 1 of 1
PROPERTY ID #:
COUNTY: Iredell

SOIL/SITE EVALUATION
for ON-SITE WASTEWATER SYSTEM

OWNER: Richard & Joyce Renz
ADDRESS:
APPLICATION DATE 1-15-10
DATE EVALUATED: 2-23-10
PROPOSED FACILITY: Home PROPOSED DESIGN FLOW (.1949): 360
PROPERTY SIZE: .98ac
LOCATION OF SITE: Sharon School TO Stewart Rock TO Selbourne
PROPERTY RECORDED:
WATER SUPPLY: • Private • Public • Well • Spring • Other Pre-existing
EVALUATION METHOD: • Auger Boring • Pit • Cut
TYPE OF WASTEWATER: • Sewage • Industrial Process • Mixed

PROFILE #	.1940 LANDSCAPE POSITION/ SLOPE %	HORIZON DEPTH (IN.)	SOIL MORPHOLOGY (.1941) .1941 STRUCTURE/ TEXTURE	SOIL MORPHOLOGY (.1941) .1941 CONSISTENCE/ MINERALOGY	OTHER PROFILE FACTORS .1942 SOIL WETNESS/ COLOR	.1943 SOIL DEPTH	.1956 SAPRO CLASS	.1944 RESTR HORIZ	PROFILE CLASS & LTAR
1	12%	0-8	CwBk	SSSPSexpfi	NA	56	silt loam	NA	3
		8-40	C wBk	SSSPSexpfr					
		40-56	SL SMP	SSSPSexpfr					
2	12%	0-9	C wBk	SSSPSexpfr	NA	54	silt loam SL	NA	.3
		9-21	CwBk	SSSPSexpfr					
		21-37	SCwBk	SSSPSexpfr					
		37-54	SL SMP	SSSPSexpfr					
3	12%	0-8	CwBk	SSSPSexpfr	NA	54	silt loam SL	NA	.3
		8-36	CwBk	SSSPSexpfr					
		36-54	SL SMP	SSSPSexpfr					
4	11%	0-8	CwBk	SSSPSexpfr	NA	54	silt loam	42"	.3
		8-42	CwBk	SSSPSexpfr					
		42-54	SL SMP	SSSPSexpfr	← Slop Some Rock				

DESCRIPTION	INITIAL SYSTEM	REPAIR SYSTEM
Available Space (.1945)	1200 / 300	1200 / 200
System Type(s)	25% 6	50% Low Pr
Site LTAR	.3	.3

OTHER FACTORS (.1946): NA
SITE CLASSIFICATION (.1948): RS
EVALUATED BY Kelly Cook
OTHER(S) PRESENT:

COMMENTS:

LEGEND

use the following standard abbreviations

LANDSCAPE POSITION	GROUP	SOIL TEXTURE	CONVENTIONAL .1955 LTAR*	LPP .1957 LTAR*	MINERALOGY/ CONSISTENCE	STRUCTURE
CC (Concave Slope)	I	S (Sand)	1.2 - 0.8	0.6 - 0.4	NEXP (Non-expansive)	G (Single Grain)
CV (Convex Slope)		LS (Loamy Sand)			SEXP (Slightly Expansive)	M (Massive)
D (Drainage Way)					EXP (Expansive)	CR (Crumb)
DS (Debris Slump)	II	SL (Sandy Loam)	0.8 - 0.6	0.4 - 0.3		GR (Granular)
FP (Flood Plain)		L (Loam)				SBK (Subangular Blocky)
FS (Foot Slope)						ABK (Angular Blocky)
H (Head Slope)	III	Si (Silt)	0.6 - 0.3	0.3 - 0.15		PL (Platy)
L (Linear Slope)		SiCL (Silty Clay Loam)				PR (Prismatic)
N (Nose Slope)		CL (Clay Loam)				
R (Ridge)		SCL (Sandy Clay Loam)			**MOIST**	**WET**
S (Shoulder Slope)		SiL (Silt Loam)				
T (Terrace)					VFR (Very Friable)	NS (Non-sticky)
	IV	SC (Sandy Clay)	0.4 - 0.1	0.2 - 0.05	FR (Friable)	SS (Slightly Sticky)
		SiC (Silty Clay)			FI (Firm)	S (Sticky)
		C (Clay)			VFI (Very Firm v. Very Sticky)	VS (Very Sticky)
		O (Organic)	None	None	EFI (Extremely Firm)	NP (Non-plastic)
						SP (Slightly Plastic)
						P (Plastic)
						VP (Very Plastic)

*Adjust LTAR due to depth, consistence, structure, soil wetness, landscape, position, wastewater flow and quality.


NOTES

HORIZON DEPTH	In inches below natural soil surface
DEPTH OF FILL	In inches from land surface
RESTRICTIVE HORIZON	Thickness and depth from land surface
SAPROLITE	S(suitable) or U(unsuitable)
SOIL WETNESS	Inches from land surface to free water or inches from land surface to soil colors with chroma 2 or less - record Munsell color chip designation
CLASSIFICATION	S (Suitable), PS (Provisionally Suitable), or U (Unsuitable)

Evaluation of saprolite shall be by pits.

Long-term Acceptance Rate (LTAR): gal/day/ft^2

Show profile locations and other site features (dimensions, reference or benchmark, and North).

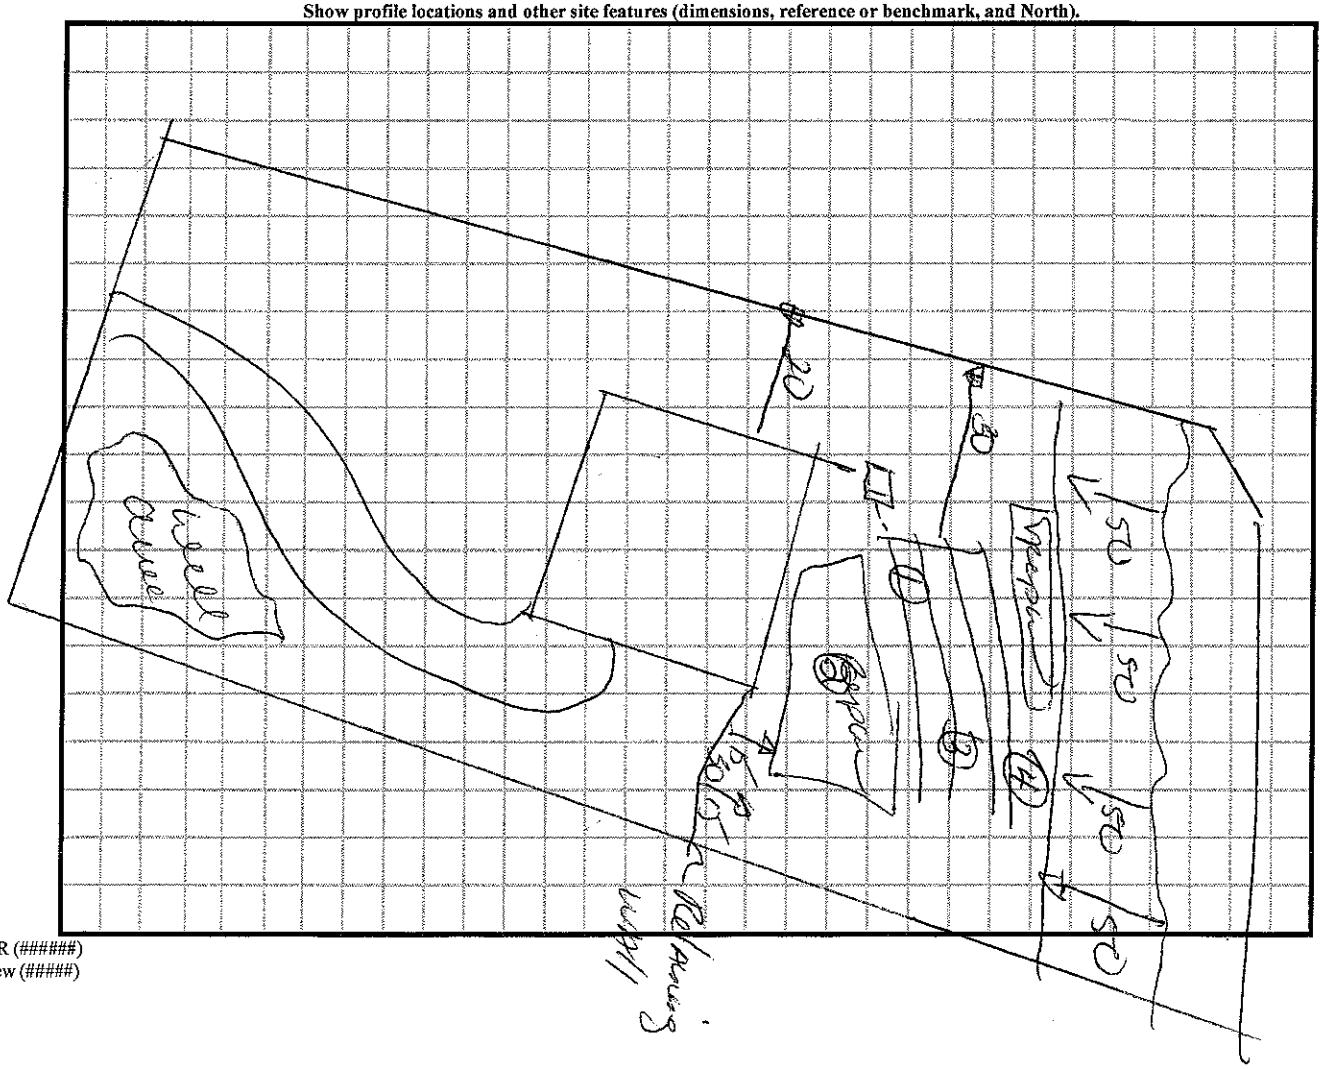

DENR (######)
Review (#####)