DEPARTMENT OF ENVIRONMENT AND NATURAL RESOURCES
DIVISION OF ENVIRONMENTAL HEALTH
ON-SITE WASTEWATER SECTION

Sheet ___
PROPERTY ID #: ____
COUNTY: ____

# SOIL/SITE EVALUATION
## *for* ON-SITE WASTEWATER SYSTEM

OWNER: Martin Hendricks APPLICATION DATE ____
ADDRESS: 346 New Sterling Rd Stony Point N.C. 28678 DATE EVALUATED: 8/2
PROPOSED FACILITY: 3BRM House PROPOSED DESIGN FLOW (.1949): 360 PROPERTY SIZE: 220+/00
LOCATION OF SITE: Ground PROPERTY RECORDED: Yes
WATER SUPPLY: ☐ Private ☒ Public ☐ Well ☐ Spring ☐ Other ____
EVALUATION METHOD: ☒ Auger Boring ☐ Pit ☐ Cut
TYPE OF WASTEWATER: ☒ Sewage ☐ Industrial Process ☐ Mixed Sharon Ridge Lot #2 SD

| PROFILE # | .1940 LAND-SCAPE POSITION/ SLOPE % | HORI-ZON DEPTH (IN.) | SOIL MORPHOLOGY (.1941) .1941 STRUCTURE/ TEXTURE | .1941 CONSISTENCE/ MINERALOGY | OTHER PROFILE FACTORS .1942 SOIL WETNESS/ COLOR | .1943 SOIL DEPTH | .1956 SAPRO CLASS | .1944 RESTR HORIZ | PROFILE CLASS & LTAR |
|---|---|---|---|---|---|---|---|---|---|
| 1 | Linear 5½% | 0-12 | cr | SE/P | | | | | PS .25 |
| | | 12-48 | c Sbk | Fi SS SP SE/P | | | | | |
| 2 | Linear 5% | 0-13 | c/cr wSbk | vfr SS NP SE/P | | | | | PS .30 |
| | | 13-48 | cr Sbk | fr SS SP SE/P | 24"-48" Blk mottles | 48 | | | |
| 3 | Linear 5% | 0-14 | c/cr g | fr NS SE/P | OK BRN | | | | PS .30 |
| | | 14-38 | cr Sbk | Fr SE/P | | | | | |
| | | 38-48 | Scr wSbk | fr SS NP SE/P | 30" Blk mottles | 48 | | | |
| 4 | | | | | | | | | |

| DESCRIPTION | INITIAL SYSTEM | REPAIR SYSTEM |
|---|---|---|
| Available Space (.1945) | PS | PS |
| System Type(s) | Gravity 25% red | Pump Gravity 40% |
| Site LTAR | .30 | .25 |

OTHER FACTORS (.1946): ____
SITE CLASSIFICATION (.1948): ____
EVALUATED BY: Bill Johnson
OTHER(S) PRESENT: M. Hendricks

COMMENTS: ____

# LEGEND

***use the following standard abbreviations***

| LANDSCAPE POSITION | GROUP | SOIL TEXTURE | CONVENTIONAL .1955 LTAR* | LPP .1957 LTAR* | MINERALOGY/ CONSISTENCE | STRUCTURE |
|---|---|---|---|---|---|---|
| CC (Concave Slope) | I | S (Sand) | 1.2 - 0.8 | 0.6 - 0.4 | NEXP (Non-expansive) | G (Single Grain) |
| CV (Convex Slope) | | LS (Loamy Sand) | | | SEXP (Slightly Expansive) | M (Massive) |
| D (Drainage Way) | | | | | EXP (Expansive) | CR (Crumb) |
| DS (Debris Slump) | II | SL (Sandy Loam) | 0.8 - 0.6 | 0.4 - 0.3 | | GR (Granular) |
| FP (Flood Plain) | | L (Loam) | | | | SBK (Subangular Blocky) |
| FS (Foot Slope) | | | | | | ABK (Angular Blocky) |
| H (Head Slope) | III | SCL (Sandy Clay Loam) | 0.6 - 0.3 | 0.3 - 0.15 | | PL (Platy) |
| L (Linear Slope) | | SiL (Silt Loam) | | | | PR (Prismatic) |
| N (Nose Slope) | | CL (Clay Loam) | | | | |
| R (Ridge) | | SiCL (Silty Clay Loam) | | | **MOIST** | **WET** |
| S (Shoulder Slope) | | Si (Silt) | | | | |
| T (Terrace) | | | | | VFR (Very Friable) | NS (Non-sticky) |
| | IV | SC (Sandy Clay) | 0.4 - 0.1 | 0.2 - 0.05 | FR (Friable) | SS (Slightly Sticky) |
| | | SiC (Silty Clay) | | | FI (Firm) | S (Sticky) |
| | | C (Clay) | | | VFI (Very Firm v. Very Sticky) | VS (Very Sticky) |
| | | O (Organic) | None | | EFI (Extremely Firm) | NP (Non-plastic) |
| | | | | | | SP (Slightly Plastic) |
| | | | | | | P (Plastic) |
| | | | | | | VP (Very Plastic) |

***Adjust LTAR due to depth, consistence, structure, soil wetness, landscape, position, wastewater flow and quality.**


***NOTES***

| | |
|---|---|
| *HORIZON DEPTH* | In inches below natural soil surface |
| *DEPTH OF FILL* | In inches from land surface |
| *RESTRICTIVE HORIZON* | Thickness and depth from land surface |
| *SAPROLITE* | S(suitable) or U(unsuitable) |
| *SOIL WETNESS* | Inches from land surface to free water or inches from land surface to soil colors with chroma 2 or less - record Munsell color chip designation |
| *CLASSIFICATION* | S (Suitable), PS (Provisionally Suitable), or U (Unsuitable) |

Evaluation of saprolite shall be by pits.

Long-term Acceptance Rate (LTAR): gal/day/ft$^2$

**Show profile locations and other site features (dimensions, reference or benchmark, and North).**

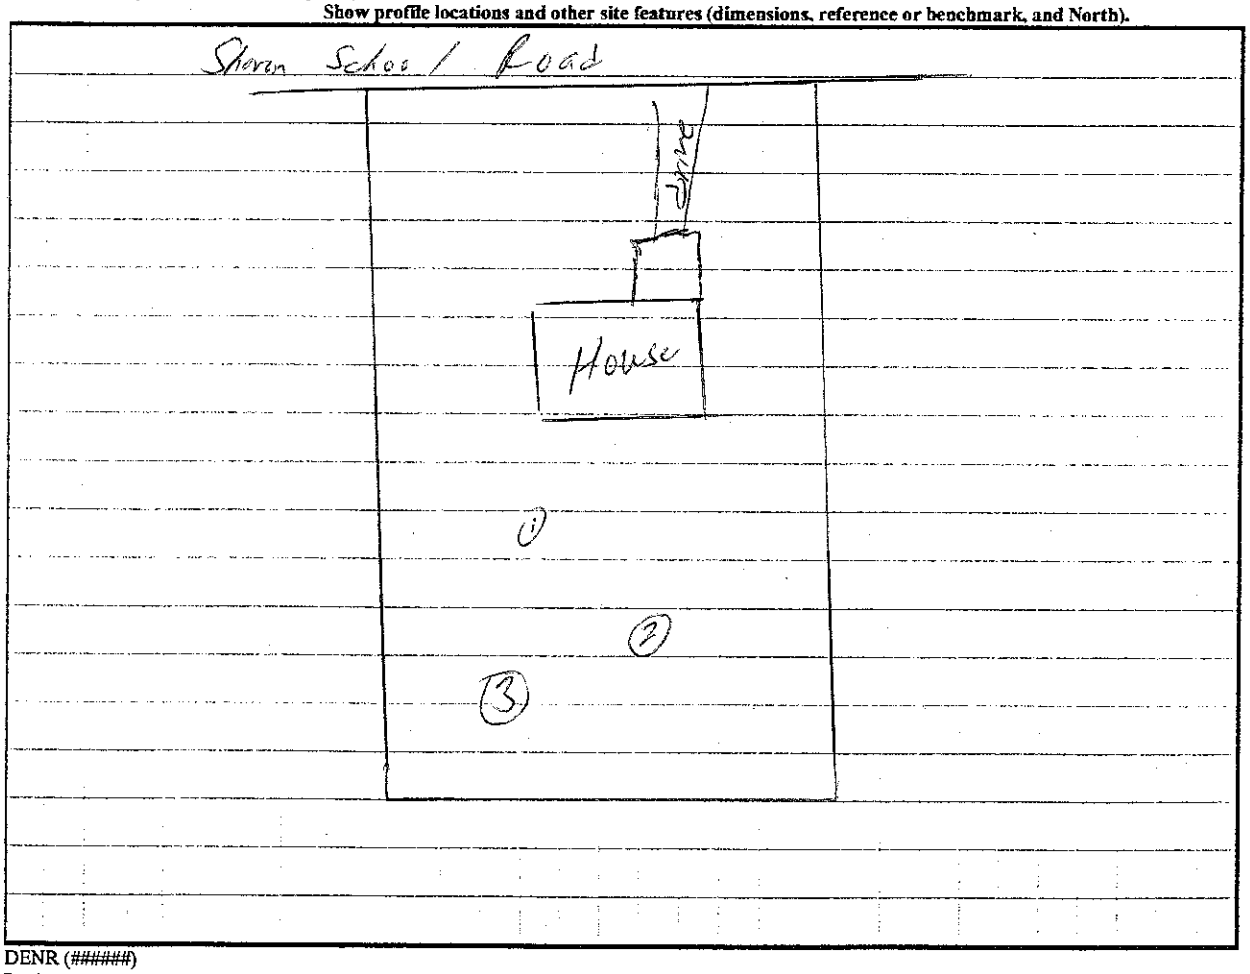


DENR (######)

Review (#####)