DEPARTMENT OF ENVIRONMENT AND NATURAL RESOURCES
DIVISION OF ENVIRONMENTAL HEALTH
ON-SITE WASTEWATER SECTION

Sheet ____ *of* ____
PROPERTY ID #: _____
COUNTY: _____

SOIL/SITE EVALUATION
for ON-SITE WASTEWATER SYSTEM

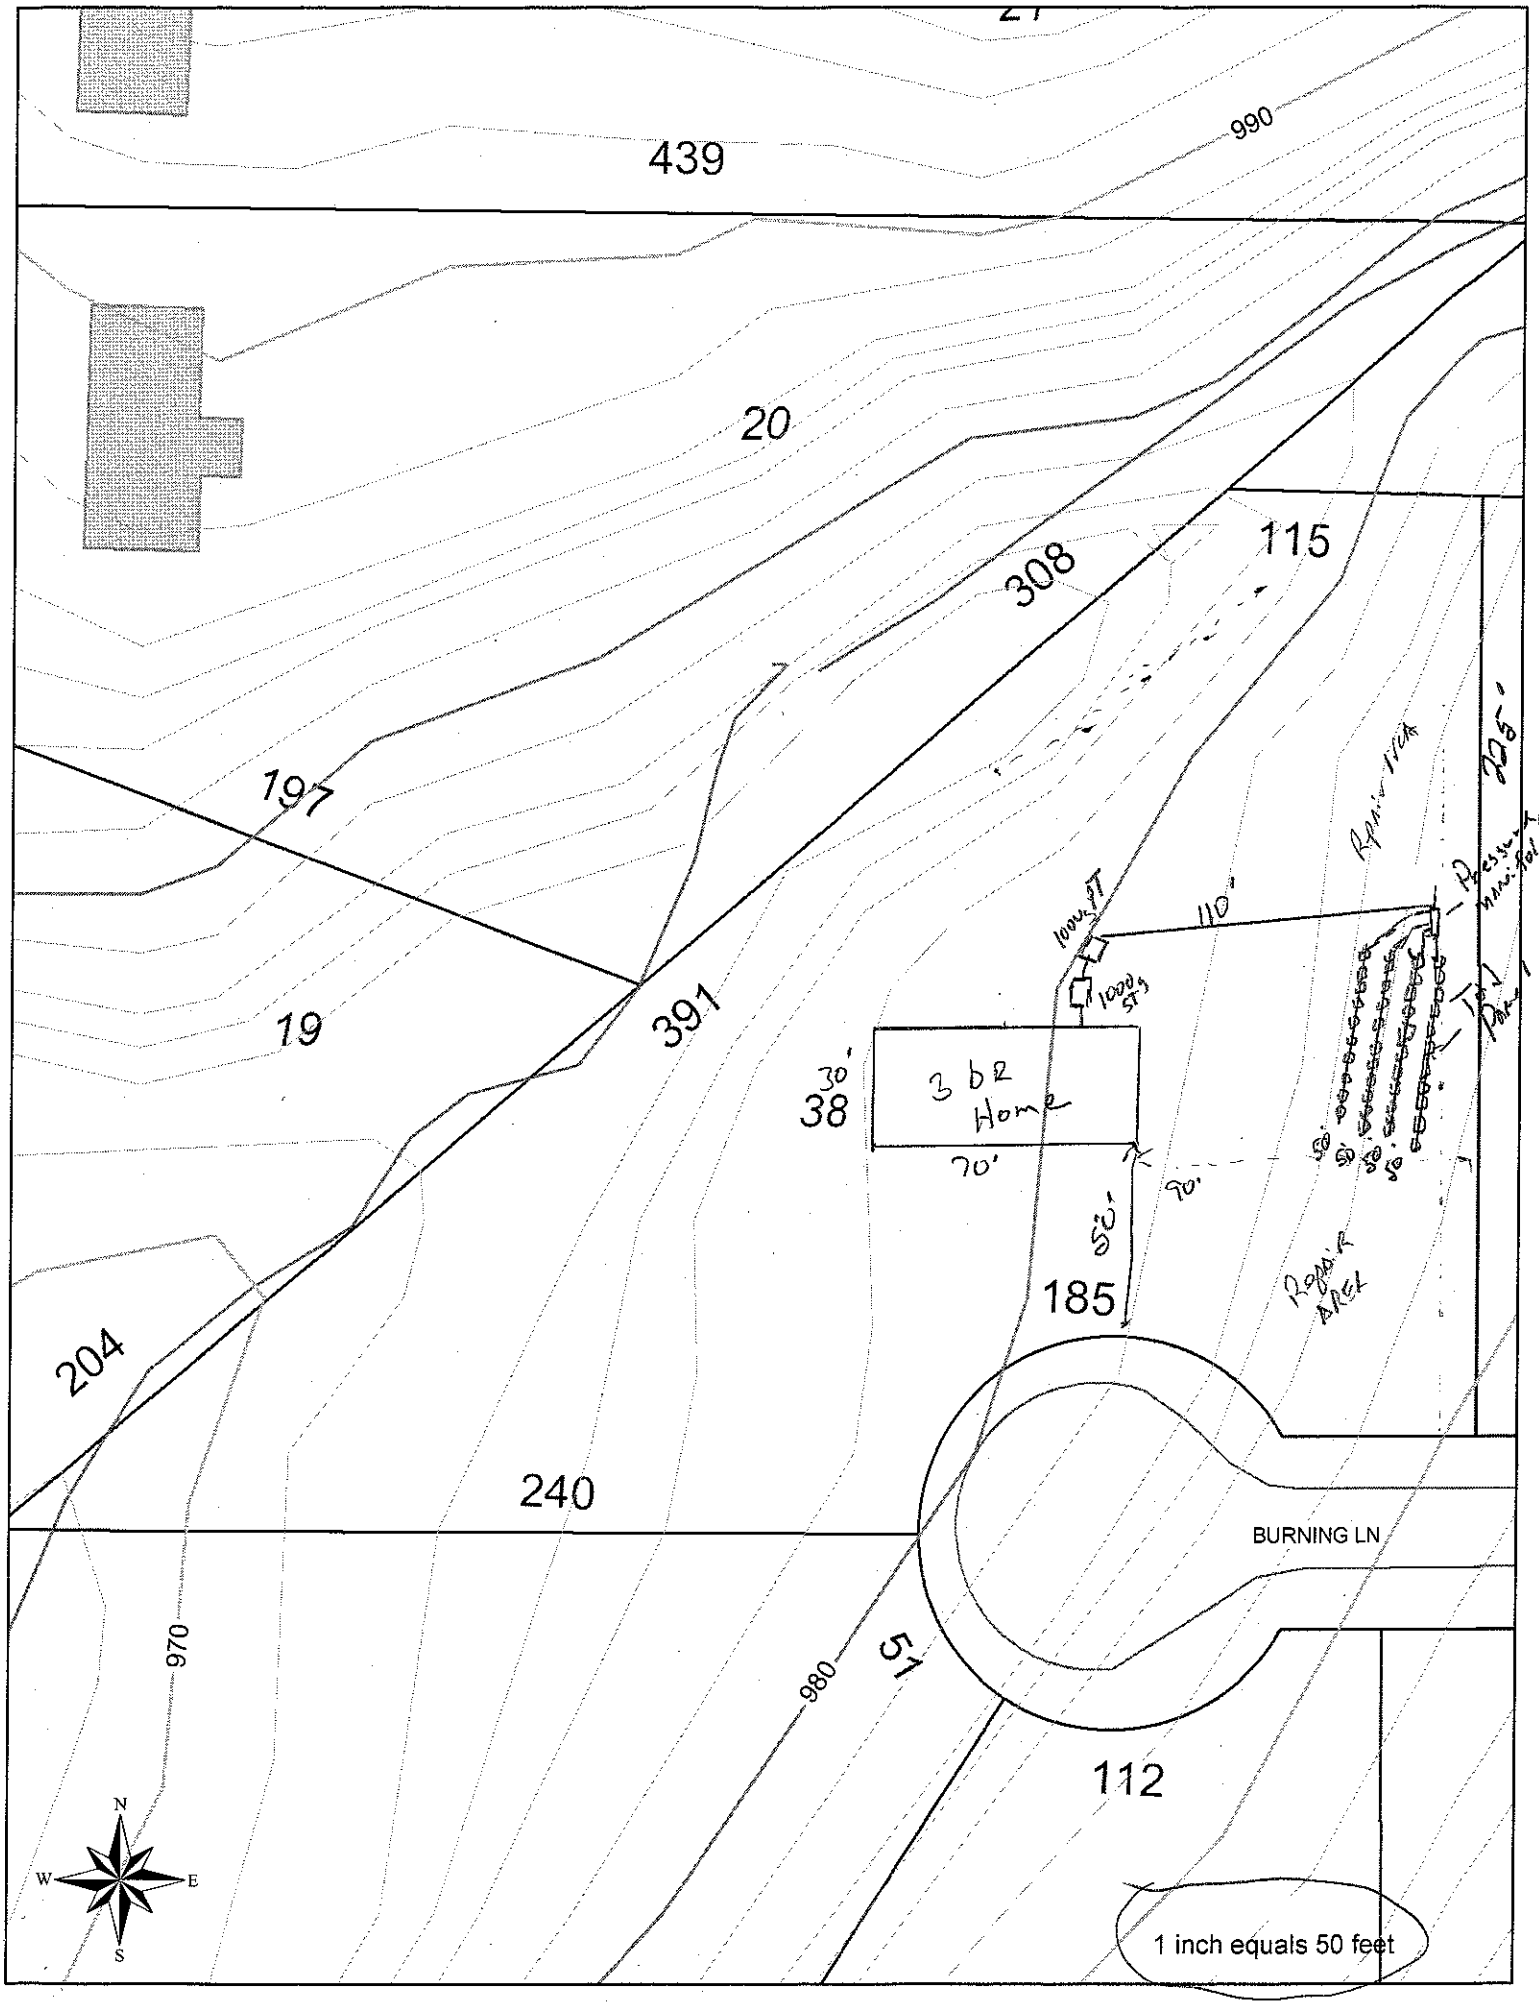
OWNER: Clyde Hall Enterprises / Crow Rd. Fuller Lot #38 APPLICATION DATE _____
ADDRESS: _____ DATE EVALUATED: _____
PROPOSED FACILITY: 3 BR Home PROPOSED DESIGN FLOW (.1949): 360 l/d PROPERTY SIZE: 1.39 Ac.
LOCATION OF SITE: From Ind OMR - TL Crow Rd - TL Crow Rd - 3rd Property on R PROPERTY RECORDED: _____
WATER SUPPLY: ☐ Private ☒ Public ☐ Well ☐ Spring ☐ Other _____
EVALUATION METHOD: ☒ Auger Boring ☐ Pit ☐ Cut TYPE OF WASTEWATER: ☒ Sewage ☐ Industrial Process ☐ Mixed

PROFILE #	.1940 LANDSCAPE POSITION/ SLOPE %	HORIZON DEPTH (IN.)	SOIL MORPHOLOGY (.1941) .1941 STRUCTURE/ TEXTURE	SOIL MORPHOLOGY (.1941) .1941 CONSISTENCE/ MINERALOGY	OTHER PROFILE FACTORS .1942 SOIL WETNESS/ COLOR	OTHER PROFILE FACTORS .1943 SOIL DEPTH	OTHER PROFILE FACTORS .1956 SAPRO CLASS	OTHER PROFILE FACTORS .1944 RESTR HORIZ	PROFILE CLASS & LTAR
1	L/FS 4-5%	0-9	wsbk SCl	fr ss/p	40" <42	7-48			PS 0.3
		9-48+	sbk SC	fr-fi ss/p					
2	FS (FP) 3-4%	0-8	wssk SCl	fr ss/p	10" <42				U
		8-35+	sbk SC	fr-fi ss/p					
3	FS (FP) 3-5%	0-10	wssk SCl	fr ss/p	10" <2				U
		10-25+	sbk SC	fr-fi					
4	L 6-7%	0-14	wssk SCl	fr ss/p	7-48	7-48	-	-	PS 0.3
		14-48+	sbk C	fr ss/p					
5	FS/L 3-4%	0-18+	sbk SCl	fr ss/p	12" <2				U
6	FS/L 5%	0-11	wsbk SCl	fr ss/p	39" <42	7-48			PS 0.3
		11-48+	sbk SC	fr-fi ss/p					

DESCRIPTION	INITIAL SYSTEM	REPAIR SYSTEM
Available Space (.1945)	PS	PS
System Type(s)	III	III
Site LTAR	0.3	0.3

OTHER FACTORS (.1946): _____
SITE CLASSIFICATION (.1948): PS
EVALUATED BY: TCH
OTHER(S) PRESENT: _____

COMMENTS: _____


439
990
20
115
308
197
391
19
3 bR Home
38
30'
70'
110'
1000 GAL
1000 GAL
185
50'
204
240
BURNING LN
970
980
51
112
N
W
E
S
1 inch equals 50 feet