DEPARTMENT OF ENVIRONMENT AND NATURAL RESOURCES
DIVISION OF ENVIRONMENTAL HEALTH
ON-SITE WASTEWATER SECTION

Sheet 1 of 1
PROPERTY ID #:
COUNTY: Iredell

SOIL/SITE EVALUATION
for ON-SITE WASTEWATER SYSTEM

OWNER: John Anderson APPLICATION DATE:
ADDRESS: 726 Gobble Rd Statesville NC DATE EVALUATED: 6/25
PROPOSED FACILITY: 3BRM Home PROPOSED DESIGN FLOW (.1949): 360 PROPERTY SIZE: 6.6
LOCATION OF SITE: crawl space PROPERTY RECORDED: Yes
WATER SUPPLY: ☒ Private ☐ Public ☐ Well ☐ Spring ☐ Other
EVALUATION METHOD: ☒ Auger Boring ☐ Pit ☐ Cut
TYPE OF WASTEWATER: ☒ Sewage ☐ Industrial Process ☐ Mixed

PROFILE #	.1940 LAND-SCAPE POSITION/ SLOPE %	HORI-ZON DEPTH (IN.)	SOIL MORPHOLOGY (.1941) .1941 STRUCTURE/ TEXTURE	SOIL MORPHOLOGY (.1941) .1941 CONSISTENCE/ MINERALOGY	OTHER PROFILE FACTORS .1942 SOIL WETNESS/ COLOR	.1943 SOIL DEPTH	.1956 SAPRO CLASS	.1944 RESTR HORIZ	PROFILE CLASS & LTAR
1	2% Linear	0-6	SL g	fr NS NP NE rp					PS .35
		6-28	cl SBk	fr SS SP SE rp					
		28-40	cl 4%sap SBk	fr SS SP SE rp					
		40-48	Sap						
2	8% Linear	0-5	SL g	fr NS NP NE rp	28" few yellow DM mottles				PS .35
		5-16	cl SBk	fr SS SP SE rp					
		16-42	cl 4%sap SBk	fr SS SP SE rp	40" some chroma 3				
		42-48	Sap		(max Trench Bottom depth 28")				
3	8% Linear	0-5	SL g	fr NS NP NE					PS .25
		5-18	C ASBk	fi SS SP SE					
		18-28	cl few sap ASBk	fi SS SP SE					
		28-30	cl 50% sap mod SBk	fr SS SP SE					
		38-48	cl mod sap	fr SS SP SE rp					
4									

DESCRIPTION	INITIAL SYSTEM	REPAIR SYSTEM
Available Space (.1945)	PS	PS
System Type(s)	Gravity, Con.	Gravity, Con
Site LTAR	.35	.25

OTHER FACTORS (.1946):
SITE CLASSIFICATION (.1948):
EVALUATED BY: Bill Johnson
OTHER(S) PRESENT:

COMMENTS:

LEGEND

use the following standard abbreviations

LANDSCAPE POSITION	GROUP	SOIL TEXTURE	CONVENTIONAL .1955 LTAR*	LPP .1957 LTAR*	MINERALOGY/ CONSISTENCE	STRUCTURE
CC (Concave Slope)	I	S (Sand)	1.2 - 0.8	0.6 - 0.4	NEXP (Non-expansive)	G (Single Grain)
CV (Convex Slope)		LS (Loamy Sand)			SEXP (Slightly Expansive)	M (Massive)
D (Drainage Way)					EXP (Expansive)	CR (Crumb)
DS (Debris Slump)	II	SL (Sandy Loam)	0.8 - 0.6	0.4 - 0.3		GR (Granular)
FP (Flood Plain)		L (Loam)				SBK (Subangular Blocky)
FS (Foot Slope)						ABK (Angular Blocky)
H (Head Slope)	III	SCL (Sandy Clay Loam)	0.6 - 0.3	0.3 - 0.15		PL (Platy)
L (Linear Slope)		SiL (Silt Loam)				PR (Prismatic)
N (Nose Slope)		CL (Clay Loam)				
R (Ridge)		SiCL (Silty Clay Loam)			**MOIST**	**WET**
S (Shoulder Slope)		Si (Silt)				
T (Terrace)					VFR (Very Friable)	NS (Non-sticky)
	IV	SC (Sandy Clay)	0.4 - 0.1	0.2 - 0.05	FR (Friable)	SS (Slightly Sticky)
		SiC (Silty Clay)			FI (Firm)	S (Sticky)
		C (Clay)			VFI (Very Firm v. Very Sticky)	VS (Very Sticky)
		O (Organic)	None		EFI (Extremely Firm)	NP (Non-plastic)
						SP (Slightly Plastic)
						P (Plastic)
						VP (Very Plastic)

***Adjust LTAR due to depth, consistence, structure, soil wetness, landscape, position, wastewater flow and quality.**


NOTES

HORIZON DEPTH	In inches below natural soil surface
DEPTH OF FILL	In inches from land surface
RESTRICTIVE HORIZON	Thickness and depth from land surface
SAPROLITE	S(suitable) or U(unsuitable)
SOIL WETNESS	Inches from land surface to free water or inches from land surface to soil colors with chroma 2 or less - record Munsell color chip designation
CLASSIFICATION	S (Suitable), PS (Provisionally Suitable), or U (Unsuitable)

Evaluation of saprolite shall be by pits.

Long-term Acceptance Rate (LTAR): gal/day/ft^2

Show profile locations and other site features (dimensions, reference or benchmark, and North).

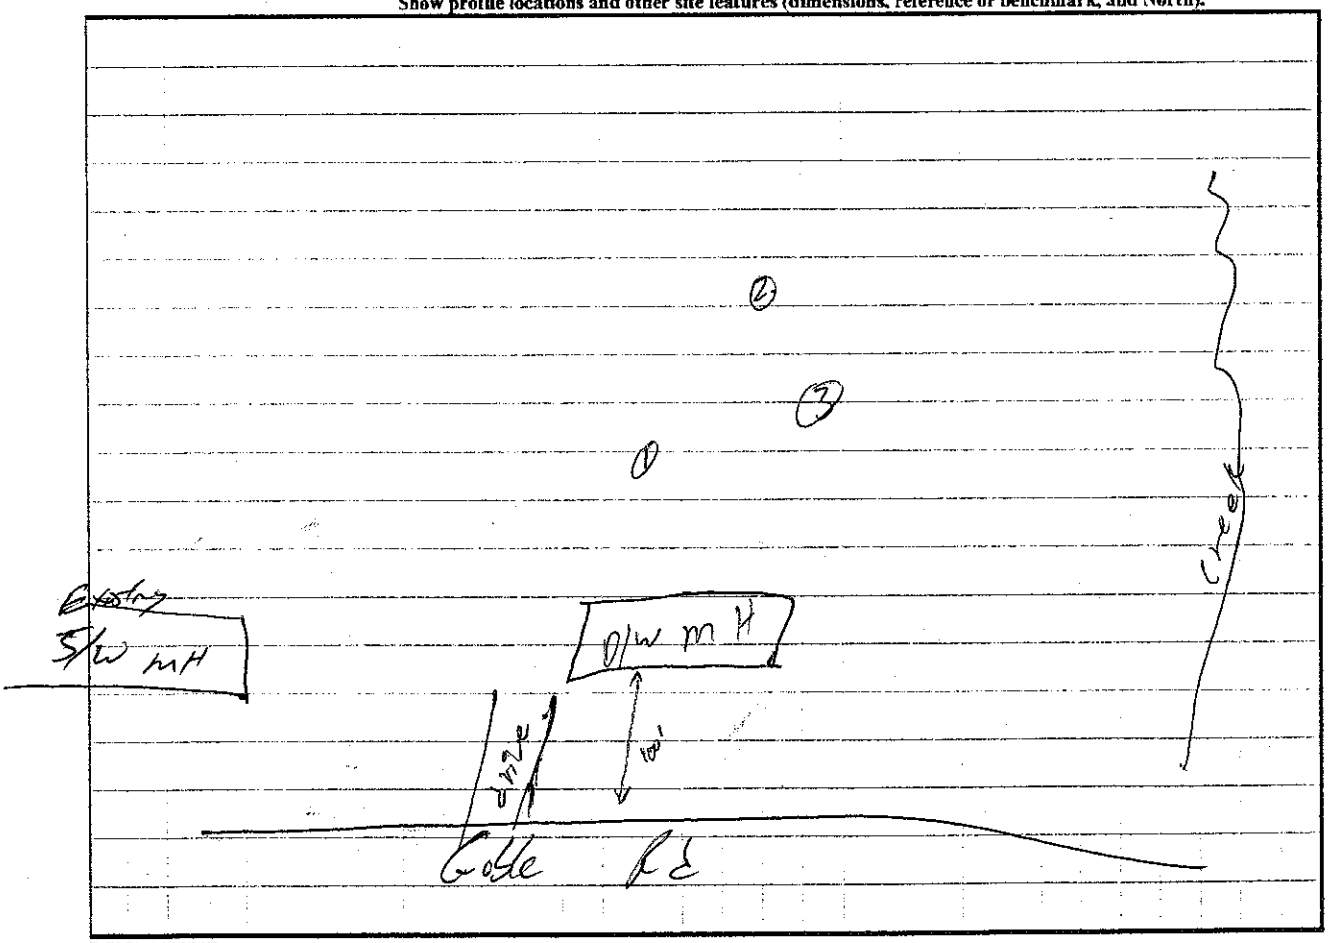

DENR (######)

Review (#####)