DEPARTMENT OF ENVIRONMENT AND NATURAL RESOURCES
DIVISION OF ENVIRONMENTAL HEALTH
ON-SITE WASTEWATER SECTION

Sheet 1 of 1
PROPERTY ID #:
COUNTY: Iredell
3796001124

SOIL/SITE EVALUATION
for ON-SITE WASTEWATER SYSTEM

OWNER: Clyde Hall Enterprises Inc.
ADDRESS: P.O. Box 33497 Mooresville, NC 28117
PROPOSED FACILITY: 3bd sfh PROPOSED DESIGN FLOW (.1949): 360
LOCATION OF SITE: 122 Burning Lane Stoney Point, NC Coin Rd. Estates
WATER SUPPLY: ☐ Private ☒ Public ☐ Well ☐ Spring ☐ Other
EVALUATION METHOD: ☒ Auger Boring ☐ Pit ☐ Cut

APPLICATION DATE 12/11/07
DATE EVALUATED: 1/18/8
PROPERTY SIZE: 0.594 acres
PROPERTY RECORDED: yes
TYPE OF WASTEWATER: ☒ Sewage ☐ Industrial Process ☐ Mixed

PROFILE #	.1940 LANDSCAPE POSITION/ SLOPE %	HORIZON DEPTH (IN.)	SOIL MORPHOLOGY (.1941) .1941 STRUCTURE/ TEXTURE	.1941 CONSISTENCE/ MINERALOGY	OTHER PROFILE FACTORS .1942 SOIL WETNESS/ COLOR	.1943 SOIL DEPTH	.1956 SAPRO CLASS	.1944 RESTR HORIZ	PROFILE CLASS & LTAR
1	L <3%	0-12	sbk sl CL	Fr	NA	48"	NA	none	P.S. 0.3
		12-48	m sbk C	Fr					
2	L <3%	0-12	sl sbk CL	Fr	NA	48"	NA	none	P.S. 0.3
		12-48	m sbk C	Fr					
3	L 4%	0-11	sl sbk CL	Fr	NA	48"	S	non	P.S. 0.3
		11-43	m sbk C	Fr					
		43-48	w sbk C (sap)	Fr					
4									

DESCRIPTION	INITIAL SYSTEM	REPAIR SYSTEM
Available Space (.1945)	(68)	(68)
System Type(s)	25% Reduction	25% Pump Reduction
Site LTAR	0.3	0.3

OTHER FACTORS (.1946): NA
SITE CLASSIFICATION (.1948): P.S.
EVALUATED BY: Randall Moore
OTHER(S) PRESENT:

COMMENTS:

LEGEND

use the following standard abbreviations

LANDSCAPE POSITION	GROUP	SOIL TEXTURE	CONVENTIONAL .1955 LTAR*	LPP .1957 LTAR*	MINERALOGY/ CONSISTENCE	STRUCTURE
CC (Concave Slope)	I	S (Sand)	1.2 - 0.8	0.6 - 0.4	NEXP (Non-expansive)	G (Single Grain)
CV (Convex Slope)		LS (Loamy Sand)			SEXP (Slightly Expansive)	M (Massive)
D (Drainage Way)					EXP (Expansive)	CR (Crumb)
DS (Debris Slump)	II	SL (Sandy Loam)	0.8 - 0.6	0.4 - 0.3		GR (Granular)
FP (Flood Plain)		L (Loam)				SBK (Subangular Blocky)
FS (Foot Slope)						ABK (Angular Blocky)
H (Head Slope)	III	Si (Silt)	0.6 - 0.3	0.3 - 0.15		PL (Platy)
L (Linear Slope)		SiCL (Silty Clay Loam)				PR (Prismatic)
N (Nose Slope)		CL (Clay Loam)				
R (Ridge)		SCL (Sandy Clay Loam)			**MOIST**	**WET**
S (Shoulder Slope)		SiL (Silt Loam)				
T (Terrace)					VFR (Very Friable)	NS (Non-sticky)
	IV	SC (Sandy Clay)	0.4 - 0.1	0.2 - 0.05	FR (Friable)	SS (Slightly Sticky)
		SiC (Silty Clay)			FI (Firm)	S (Sticky)
		C (Clay)			VFI (Very Firm v. Very Sticky)	VS (Very Sticky)
		O (Organic)	None	None	EFI (Extremely Firm)	NP (Non-plastic)
						SP (Slightly Plastic)
						P (Plastic)
						VP (Very Plastic)

*Adjust LTAR due to depth, consistence, structure, soil wetness, landscape, position, wastewater flow and quality.


NOTES

HORIZON DEPTH	In inches below natural soil surface
DEPTH OF FILL	In inches from land surface
RESTRICTIVE HORIZON	Thickness and depth from land surface
SAPROLITE	S(suitable) or U(unsuitable)
SOIL WETNESS	Inches from land surface to free water or inches from land surface to soil colors with chroma 2 or less - record Munsell color chip designation
CLASSIFICATION	S (Suitable), PS (Provisionally Suitable), or U (Unsuitable)

Evaluation of saprolite shall be by pits.

Long-term Acceptance Rate (LTAR): gal/day/ft^2

Show profile locations and other site features (dimensions, reference or benchmark, and North).

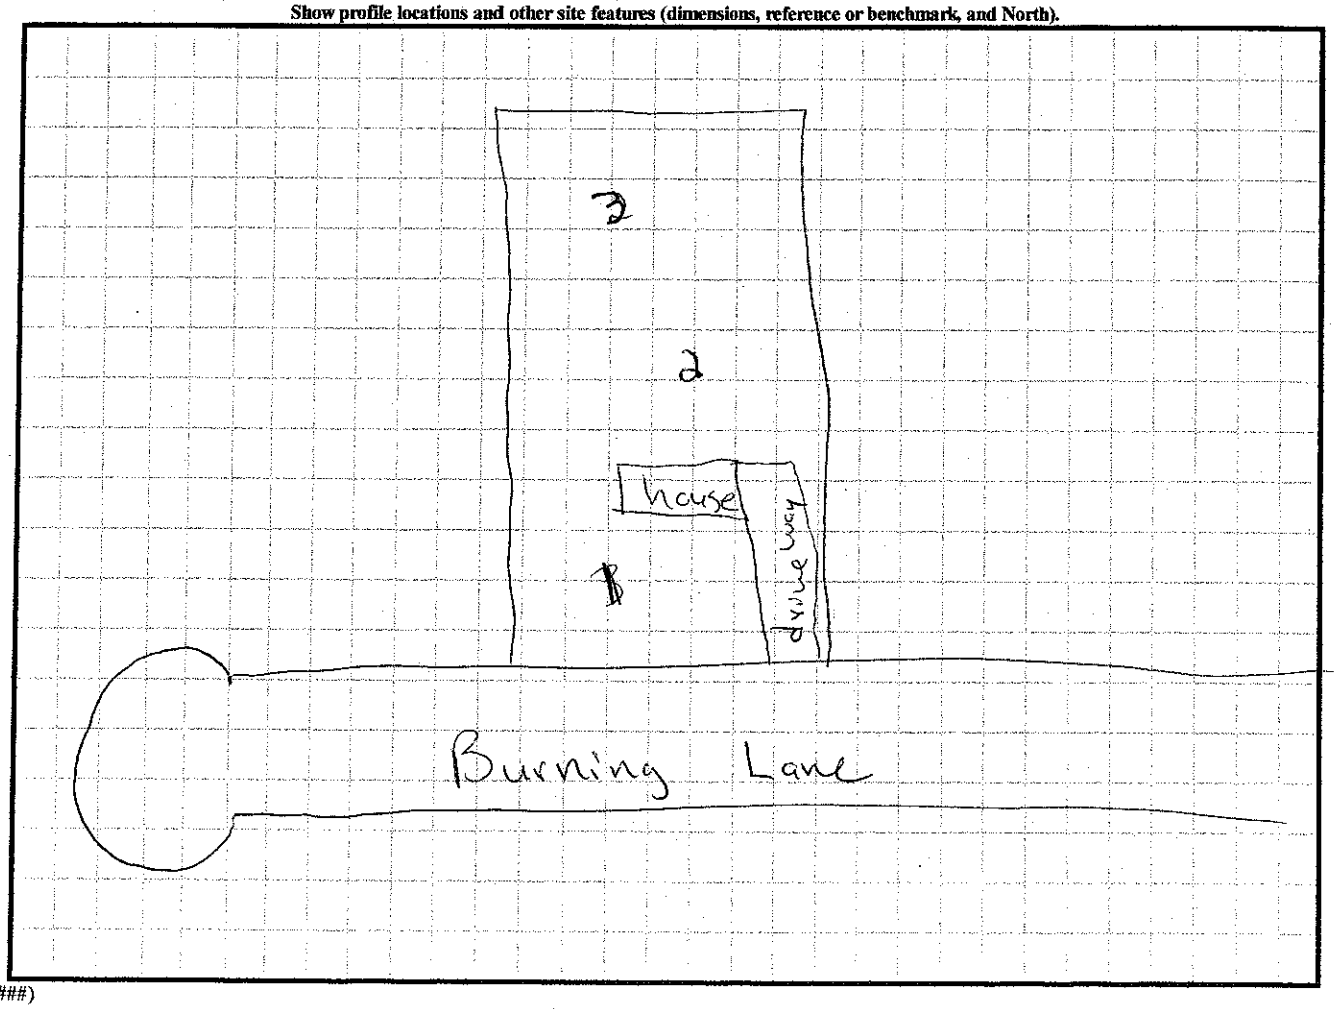

DENR (######)
Review (#####)