09211

IREDELL COUNTY HEALTH DEPARTMENT

(SEPTIC TANK) IMPROVEMENTS PERMIT AND CERTIFICATE OF COMPLETION
(Ground Absorption Sewage Disposal System -- G. S. Chapter 130-Article 13C)

OWNER OR CONTRACTOR DAVID HANNON DATE 11-10-88. PERMIT NO. 9D.

PHONE: Business _____ Home _____

LOCATION Off Mt. View Rd. north of Bradford's Xrds. - T.R. on Lindsay Farm Rd. - 3/4 mi. on left - Enter dirt rd. 2nd lot on left. S. R. No. _____

SUBDIVISION NAME WEST IREDELL ACRES. LOT NO. _____ SECTION OR BLOCK NO. _____

House ( ) Mobile Home (✓) Business ( ) Other _____

No. Bedrooms 2 No. Bathrooms 1.5

Garbage Disposal Unit Yes ( ) No (✓)

Auto. Dishwasher Yes ( ) No (✓)

Auto. Wash. Machine Yes (✓) No ( )

Site Suitable Yes (✓) No ( )

Lot Area 125' x 200'

Character & Porosity of Soil Gray Suitable.


Percolation Rate 4 min/in. ft.

Topography 2-6% Lot

Depth to Water Table _____

Rock or other impervious formations None observed.

_____ Basement with Plumbing _____ Basement without Plumbing ✓ No Basement

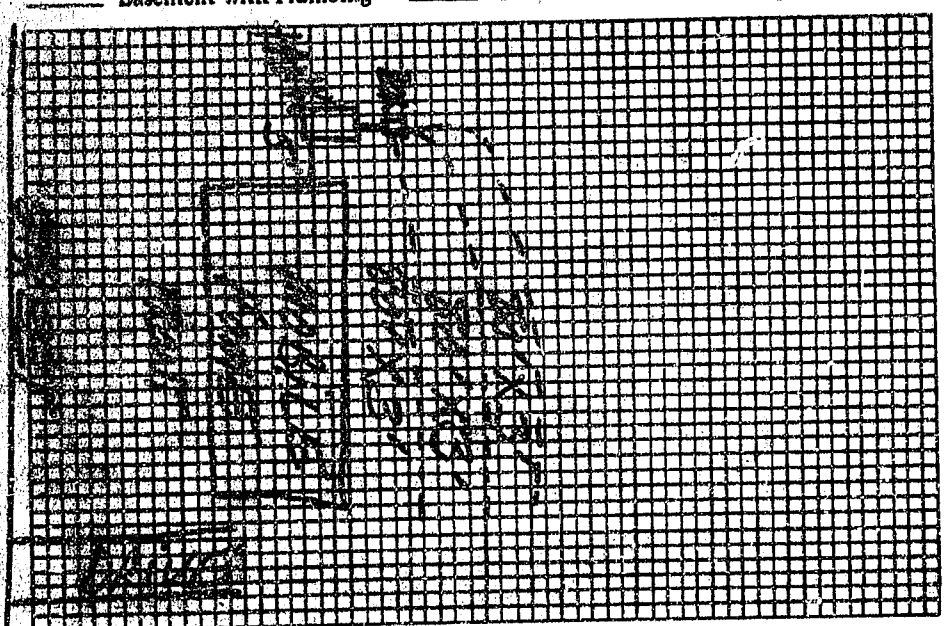

Plot of System

Size of Tank 1000 Gals.

Nitrification Field:

No. of Lines 3

Sq. Ft. 225 Lines Ft. 240

Depth of Stone in Lines 12"

Water Supply: Individual (✓)
Public ( )

Installed by Chaffin Farms

I understand and agree to install septic tank system as specified on this Improvements Permit.

Signed: _____

IMPROVEMENTS PERMIT BY Steve Brown

COMMENTS: _____

CERTIFICATE OF COMPLETION BY Steve Brown DATE 11-16-88

EXISTING SYSTEM CHECKED BY: _____ DATE _____

CONSTRUCTION MUST COMPLY WITH ALL OTHER APPLICABLE STATE AND LOCAL REGULATIONS.

Permit is VOID if any unauthorized changes are made in installation of system and/or if any false information is supplied in making Improvements Permit.

Health Dept. Copy: White Inspection Dept. Copy: Yellow Sanitarian's Copy: Pink Owner's Copy: Gold