DEPARTMENT OF ENVIRONMENT AND NATURAL RESOURCES
DIVISION OF ENVIRONMENTAL HEALTH
ON-SITE WASTEWATER SECTION

Sheet ___ of ___
PROPERTY ID #: _____
COUNTY: _____

SOIL/SITE EVALUATION for ON-SITE WASTEWATER SYSTEM

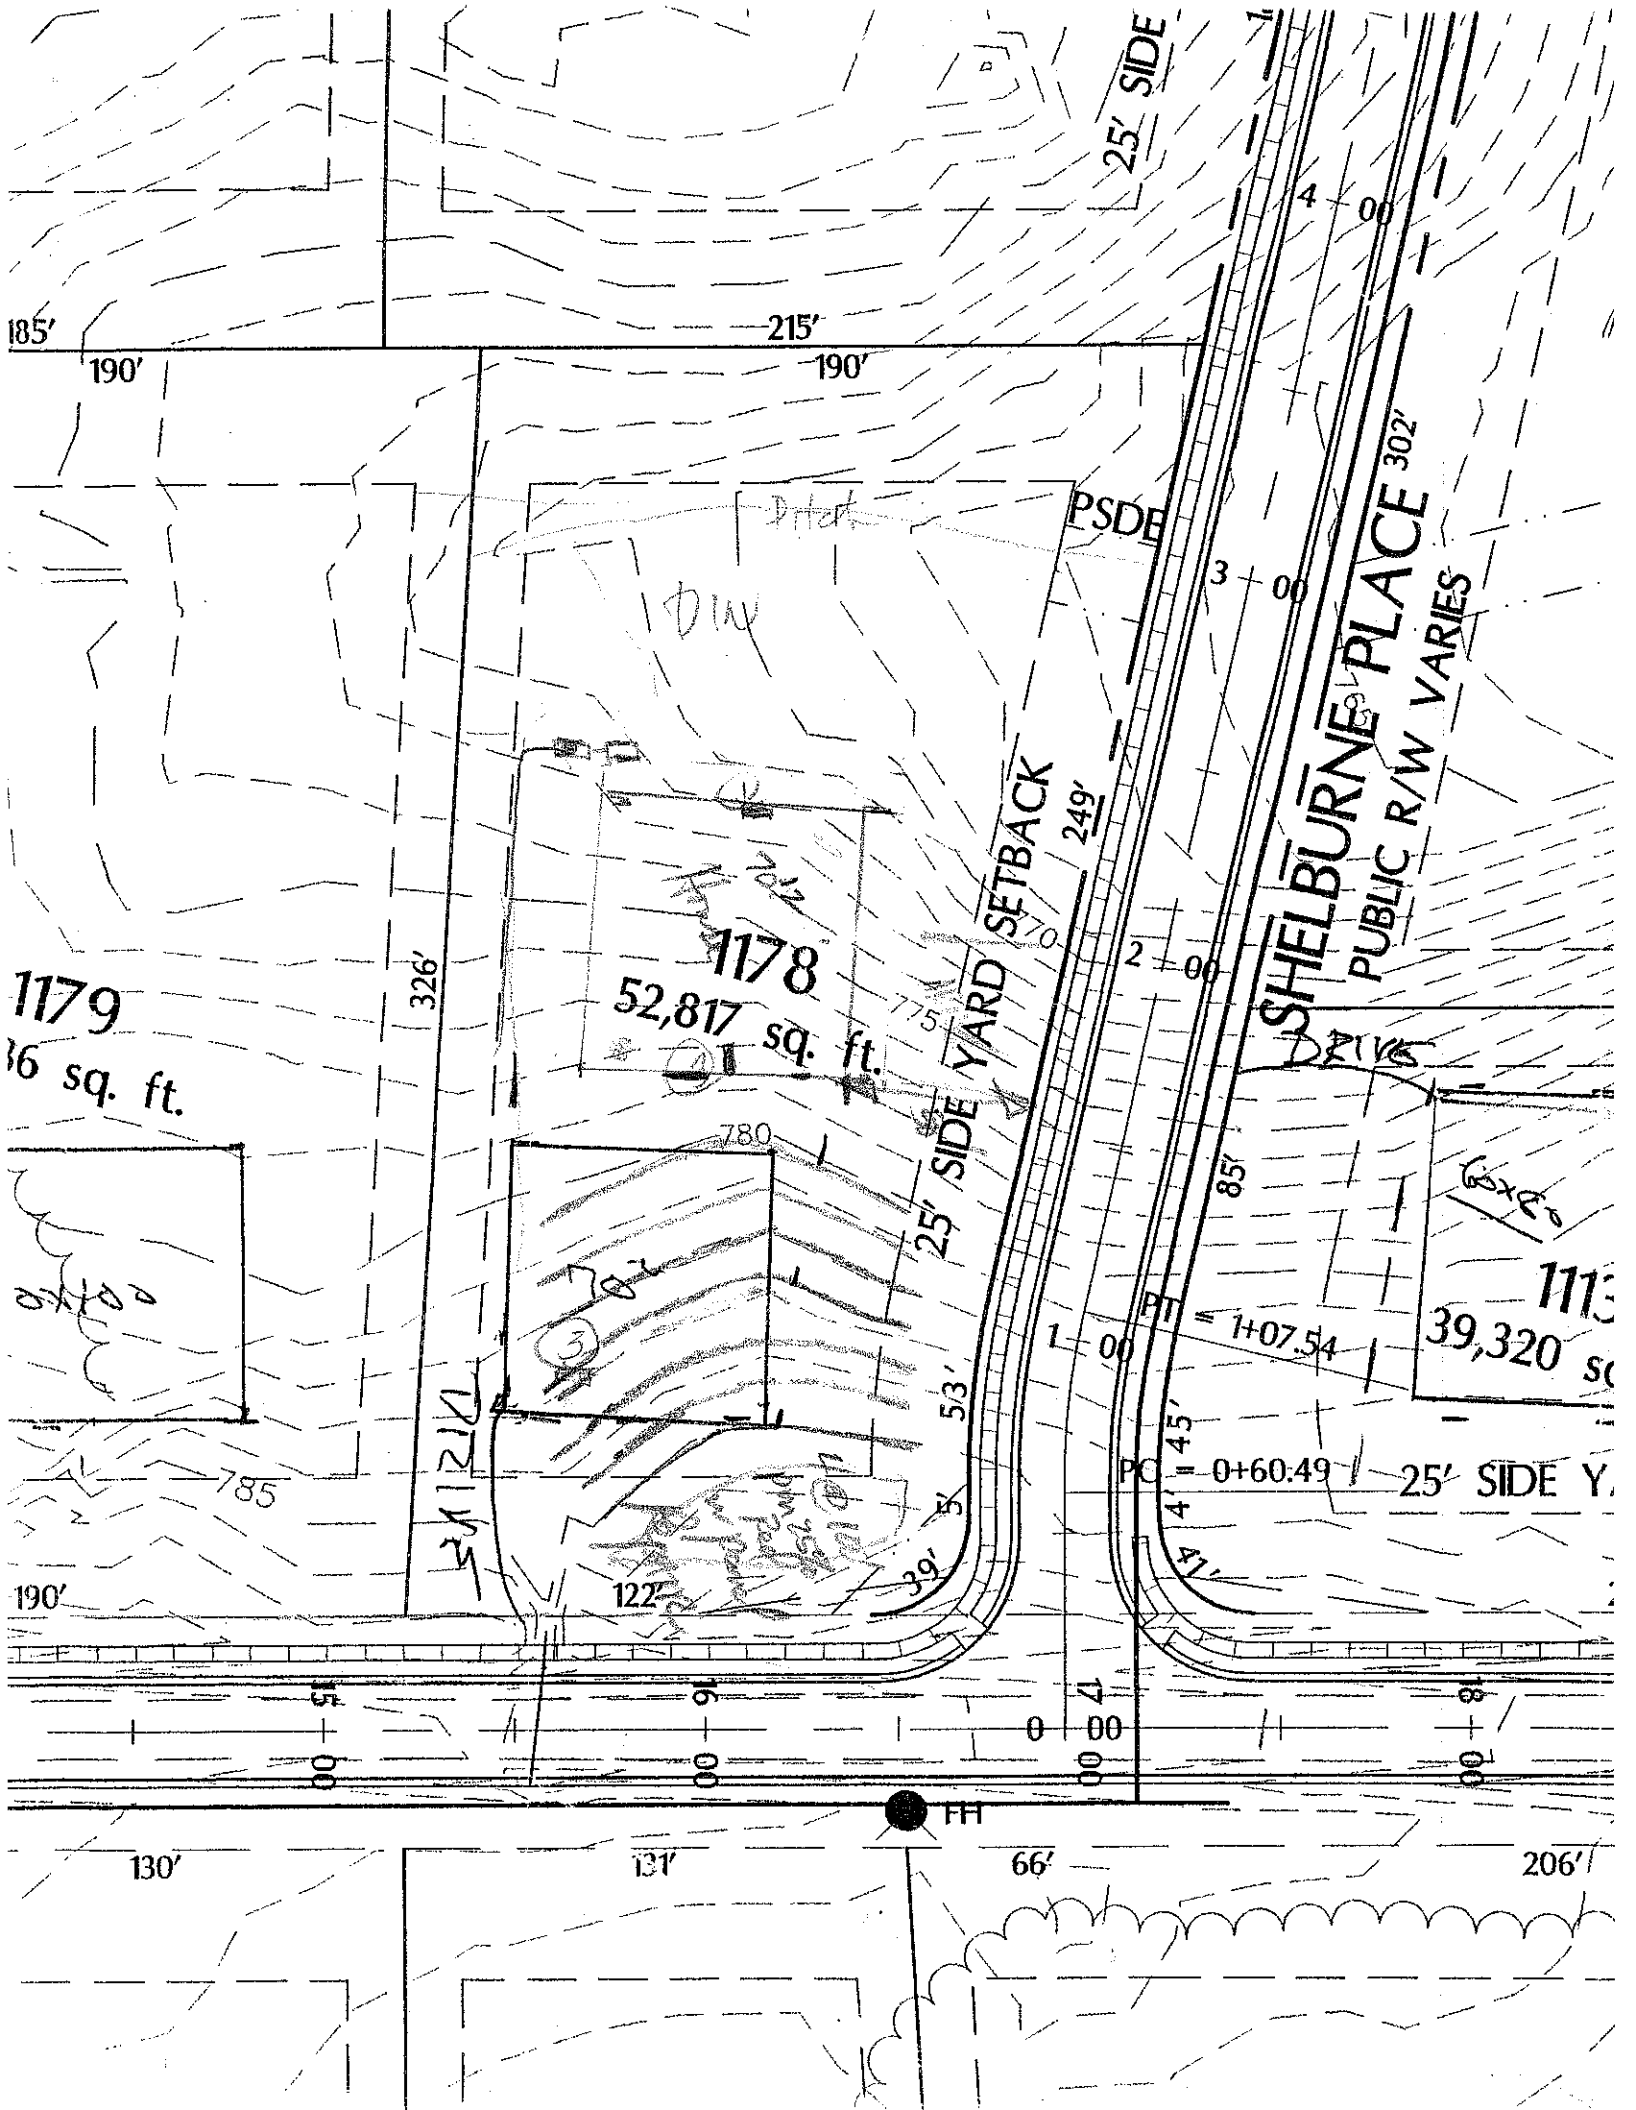
OWNER: CLF APPLICATION DATE _____
ADDRESS: _____
PROPOSED FACILITY: _____ PROPOSED DESIGN FLOW (.1949): 4 bdrm DATE EVALUATED: 12-12-02
LOCATION OF SITE: Lot 117B Chalk Theft PROPERTY SIZE: _____
WATER SUPPLY: ☐ Private ☑ Public ☑ Well ☐ Spring ☐ Other _____ PROPERTY RECORDED: _____
EVALUATION METHOD: ☐ Auger Boring ☑ Pit ☐ Cut
TYPE OF WASTEWATER: ☑ Sewage ☐ Industrial Process ☐ Mixed

PROFILE #	.1940 LAND-SCAPE POSITION/ SLOPE %	HORI-ZON DEPTH (IN.)	SOIL MORPHOLOGY (.1941) .1941 STRUCTURE/ TEXTURE	.1941 CONSISTENCE/ MINERALOGY	OTHER PROFILE FACTORS .1942 SOIL WETNESS/ COLOR	.1943 SOIL DEPTH	.1956 SAPRO CLASS	.1944 RESTR HORIZ	PROFILE CLASS & LTAR
1		0-8	wk sbk brnch	fr vssp					.3
		8-24	mod sbk rpcl	fr vssp					
		24-45	wk sbk rpl	fr vssp vwl stky					
		45-54	massive rpl sl	stky fr vssp					
2	6-8%	0-4	gr brn sil	fr vssp					.3
		4-20	mod sbk rpc	fr sp					
		20-33	wk sbk rpcl	fr vssp common vwl stky					
		33-54	massive - wk sbk rpl	vwl stky fr vssp					
3	~6%	0-12	wk sbk sil	fr vssp					.3
		12-33	mod sbk rpcl	fr vssp					
		33-39	wk sbk rpcl	fr vssp common vwl stky					
		39-55	massive rpl sl	vwl stky fr vssp					
4									

DESCRIPTION	INITIAL SYSTEM	REPAIR SYSTEM
Available Space (.1945)		
System Type(s)	Pm-25%cd	LPP RGAS
Site LTAR	.3	.3

OTHER FACTORS (.1946): _____
SITE CLASSIFICATION (.1948): B
EVALUATED BY: DHT
OTHER(S) PRESENT: Paul Dunnagan

COMMENTS: _____


25' SIDE
4+00
185'
215'
190'
190'
PSDE
3+00
SHELBURNE PLACE
PUBLIC R/W VARIES
302'
249'
25' SIDE YARD SETBACK
2+00
1178
52,817 sq. ft.
1179
6 sq. ft.
326'
775
780
85'
1+07.54
1+00
53'
PC = 0+60.49
25' SIDE Y
45'
41'
39'
122'
190'
0+00
130'
131'
66'
206'