2-2:30

12568

IREDELL COUNTY HEALTH DEPARTMENT

(SEPTIC TANK) IMPROVEMENTS PERMIT AND CERTIFICATE OF COMPLETION

(Ground Absorption Sewage Disposal System -- G. S. Chapter 130-Article 13C)

OWNER OR CONTRACTOR ABJ Construction DATE March 19, '91 PERMIT NO. 20-1-A-95

PHONE: Business ______ Home ______

LOCATION 1100 TR 1236 (Stonemaker) w/ 1-1/2 miles TR [illegible] at end ______ S. R. No. ______

SUBDIVISION NAME Crescent [illegible] LOT NO. 95 SECTION OR BLOCK NO. ______

4

House (✓) Mobile Home ( ) Business ( ) Other ______ evaluated by backhoe pit

No. Bedrooms 3 No. Bathrooms 3 + Extra Kitchen

Garbage Disposal Unit Yes (✓) No ( )

Auto. Dishwasher Yes (✓) No ( )

Auto. Wash. Machine Yes (✓) No ( )

Site Suitable Yes (✓) No ( )

Character & Porosity of Soil PS clay

Percolation Rate ≈ .35

Topography 6-10%

Depth to Water Table 4'+

Rock or other impervious formations numerous scattered rock

Lot Area Existing

✓ Basement with Plumbing ______ Basement without Plumbing ______ No Basement

Size of Tank 1500 Gals. 1500 p.t.


Nitrification Field: 230 DRH

No. of Lines ______

Sq. Ft. ______ Linear Ft. 180' of

Depth of Stone in Lines 16" [illegible]

Water Supply: Individual (✓) Public ( ) panels pressure dosed

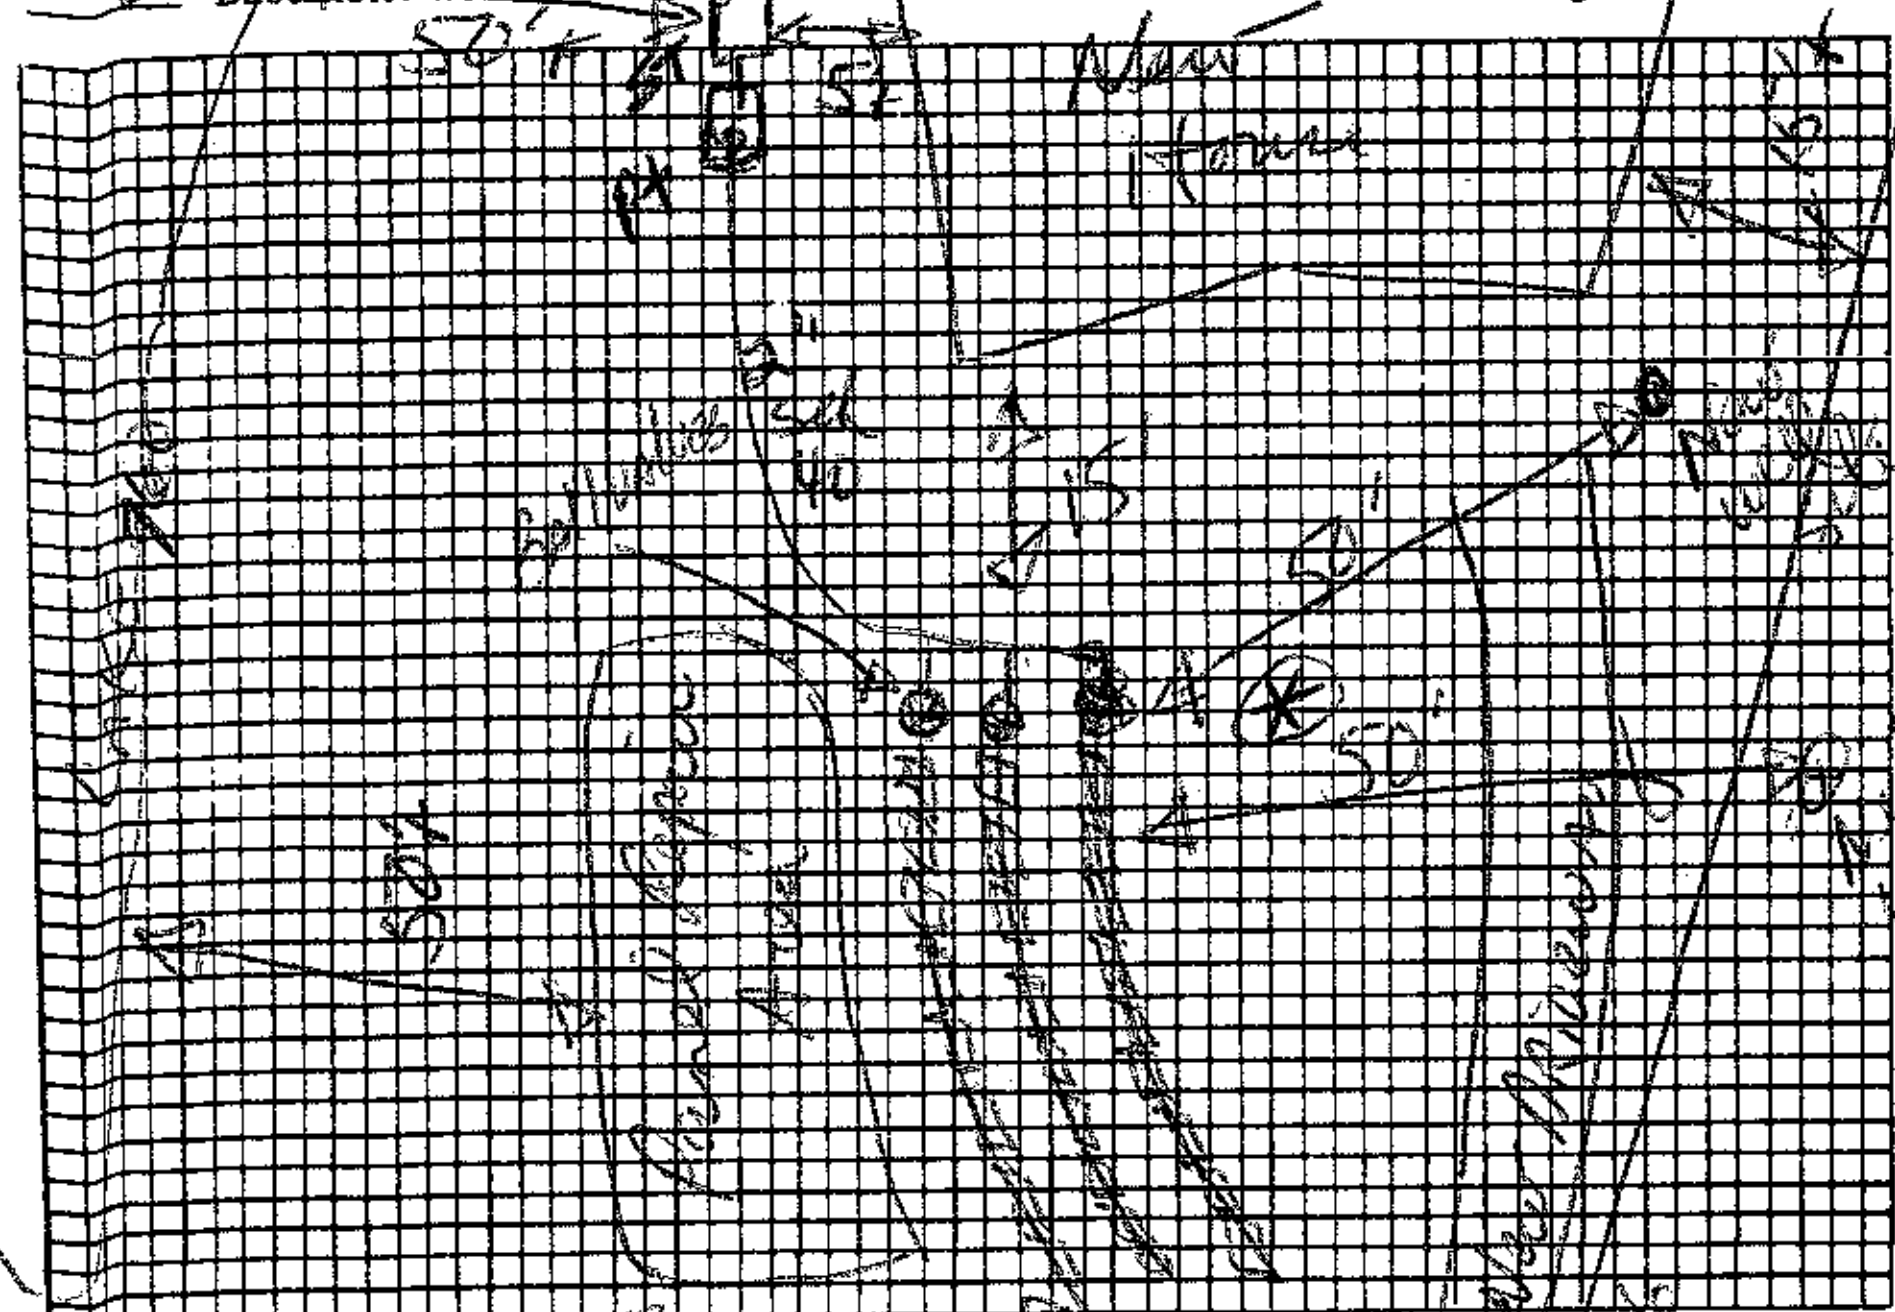

Plot of System

Installed by ______

I understand and agree to install septic tank system as specified on this Improvements Permit.

Signed: ABJ By [signature]

IMPROVEMENTS PERMIT BY [signature] EHS

(*) Existing well to be properly abandoned with H.D. representative present.

COMMENTS: All parts of old septic system within 15' of basement to be dug out.

Existing driveway to be abandoned.

1/2" [illegible] panels with ONE 5/32" hole per panel; 2' pressure head; 42 panels total

CERTIFICATE OF COMPLETION BY ______ DATE ______

EXISTING SYSTEM CHECKED BY: ______ DATE ______

CONSTRUCTION MUST COMPLY WITH ALL OTHER APPLICABLE STATE AND LOCAL REGULATIONS.

Permit is VOID if any unauthorized changes are made in installation of system and/or if any false information is supplied in making Improvements Permit.

Pump Specs: 18 gal/min at approx. 26' Total head

Health Dept. Copy: White Inspection Dept. Copy: Yellow Sanitarian's Copy: Pink Owner's Copy: Gold

Aug 2, '91 - Site visit revealed house is 4 bedroom. System increased accordingly. DRH