DEPARTMENT OF ENVIRONMENT, HEALTH, AND NATURAL RESOURCES
DIVISION OF ENVIRONMENTAL HEALTH
ON-SITE WASTEWATER SECTION

Sheet 1 of 2
PROPERTY ID #:
COUNTY:

SOIL/SITE EVALUATION
for ON-SITE WASTEWATER SYSTEM

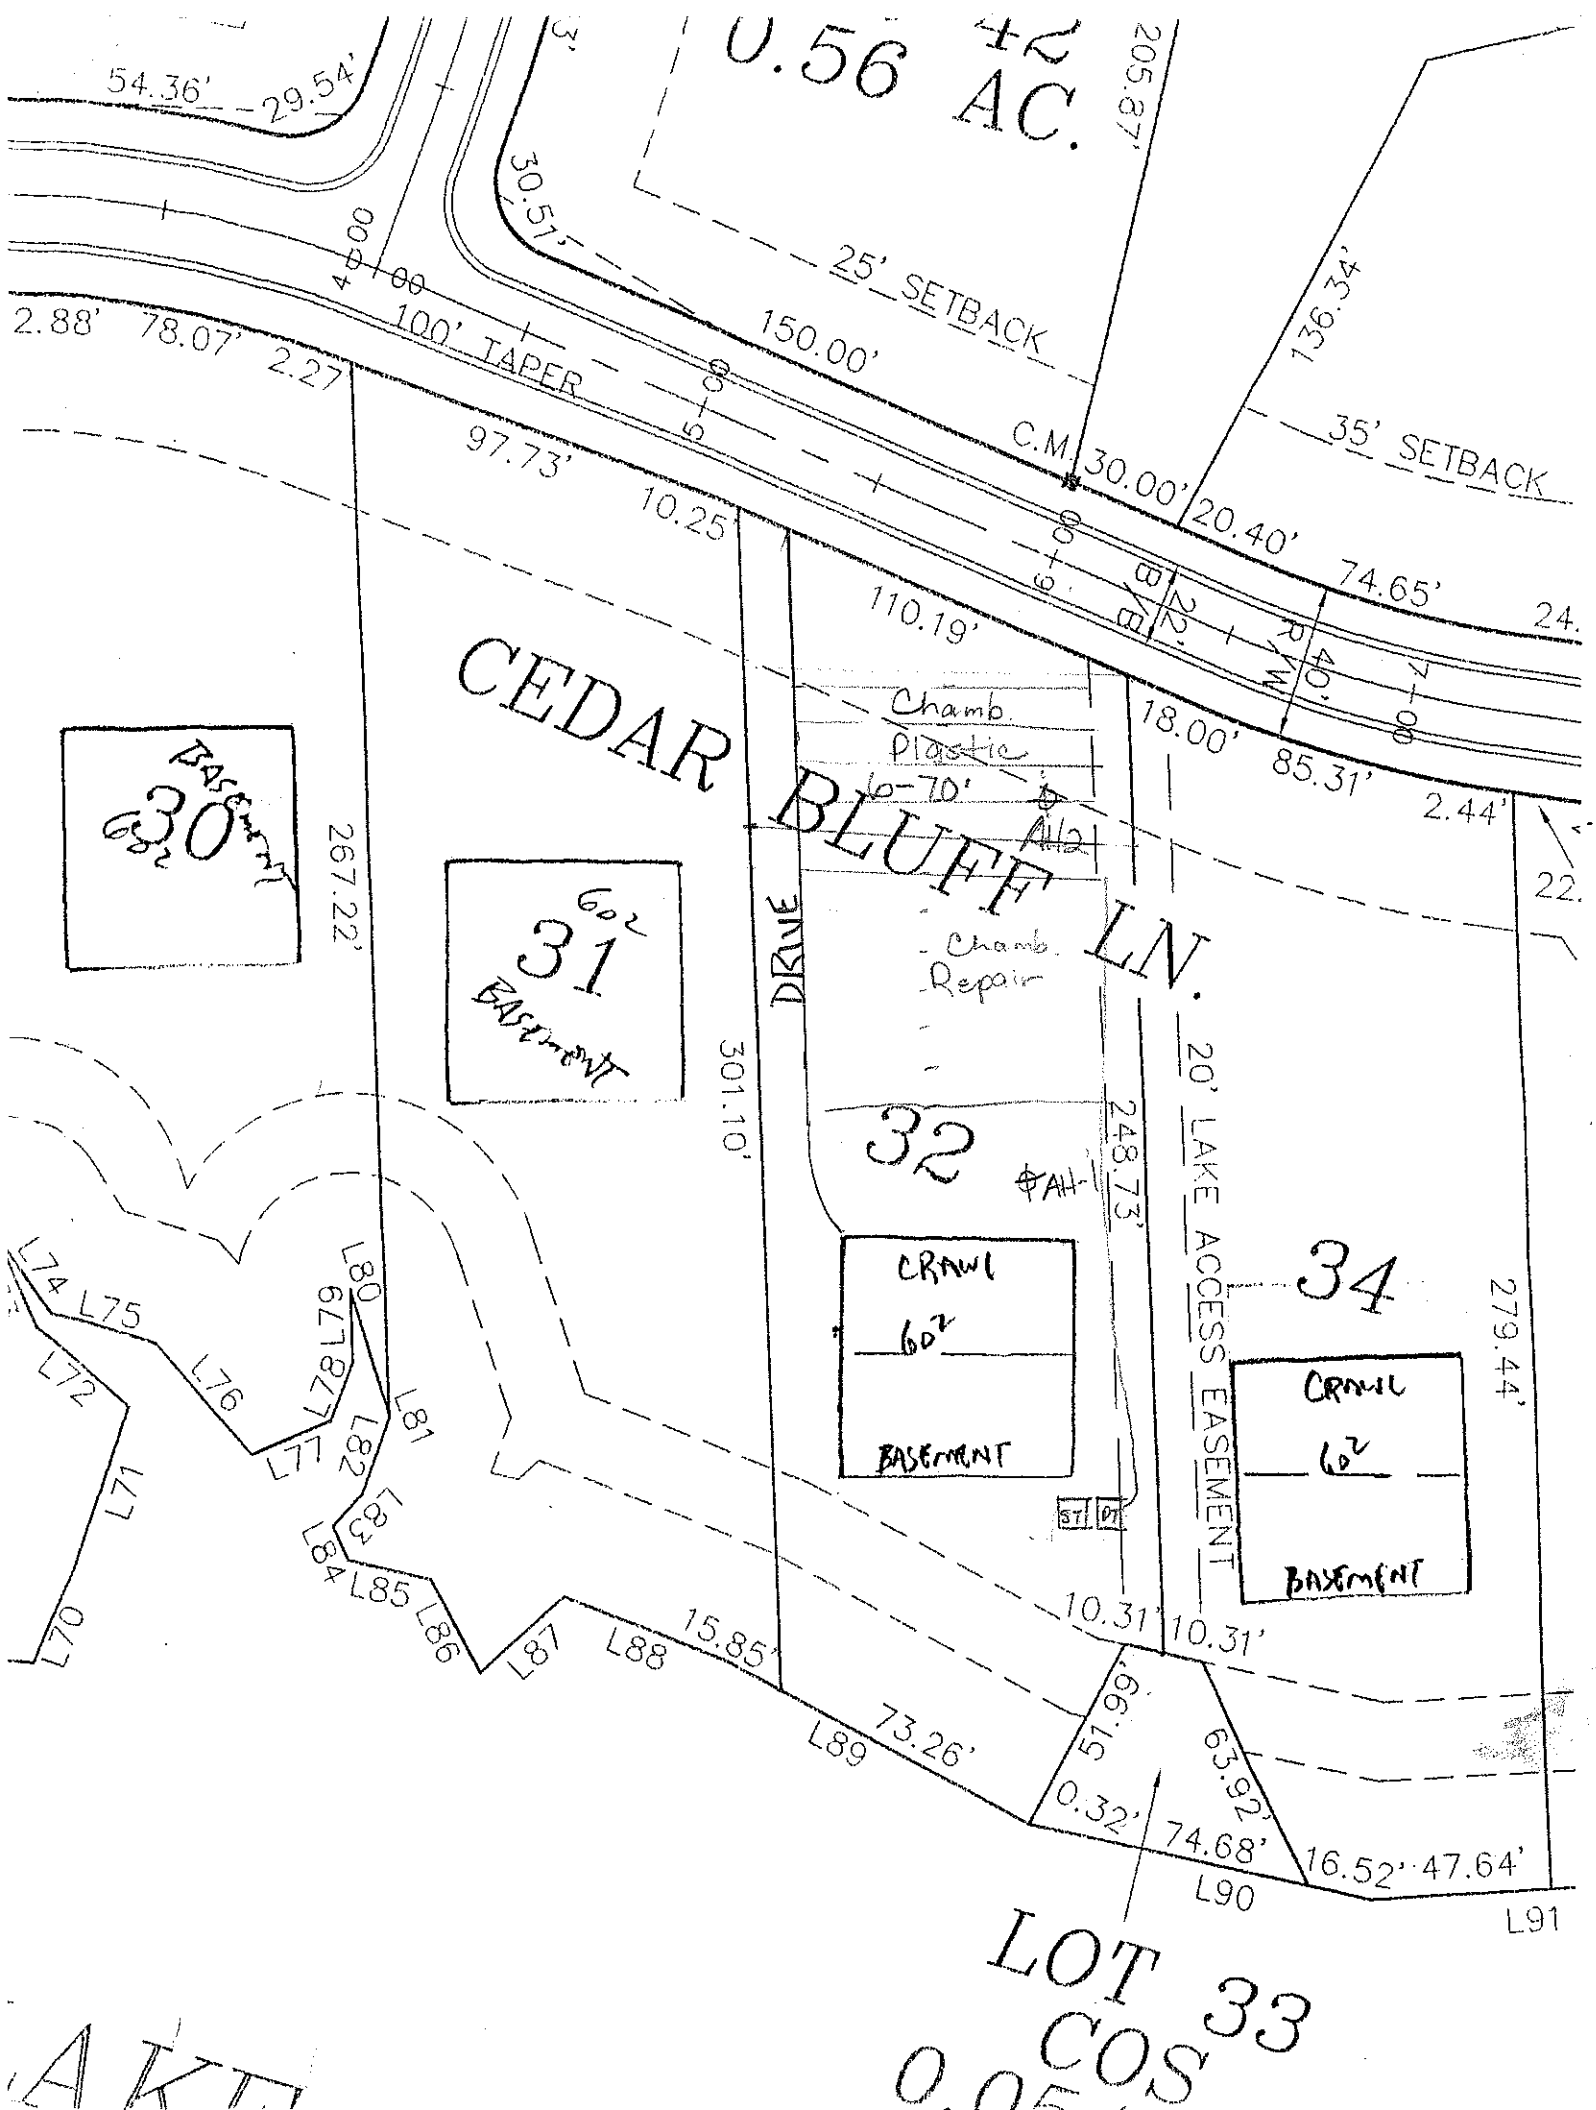
OWNER: CRE
ADDRESS:
PROPOSED FACILITY:
LOCATION OF SITE: Harbour Pt Lot #32
APPLICANT:
APPLICATION DATE:
PROPOSED DESIGN FLOW (.1949):
DATE EVALUATED: 4/97
PROPERTY SIZE:
PROPERTY RECORDED:

WATER SUPPLY: ☐ Private ☒ Public ☐ Well ☐ Spring ☐ Other
EVALUATION METHOD: ☒ Auger Boring ☐ Pit ☐ Cut
TYPE OF WASTEWATER: ☒ Sewage ☐ Industrial Process ☐ Mixed

PROFILE #	.1940 LANDSCAPE POSITION/ SLOPE %	HORIZON DEPTH (IN.)	SOIL MORPHOLOGY (.1941) .1941 STRUCTURE/ TEXTURE	SOIL MORPHOLOGY (.1941) .1941 CONSISTENCE/ MINERALOGY	OTHER PROFILE FACTORS .1942 SOIL WETNESS/ COLOR	.1943 SOIL DEPTH	.1956 SAPRO CLASS	.1944 RESTR. HORIZ.	PROFILE CLASS & LTAR
1	L ~7%	0-12"	Brn CL SBK	SS, SPSE FFr					.3+
		12"-48"	Rd-Brn/G mSBK	SS, SPSE Fr					
		~46"	Wetness in hole probably from root channel						
2		0-8"	Brn SCL GR						.3+
		8"-16"	Rd C L w/ f SBK	SS, SPSE Fr					
		16"-48"	C Heavy Clay f SBK	SS, FFr, SPSE Fr					
3									
4									

DESCRIPTION	INITIAL SYSTEM	REPAIR SYSTEM
Available Space (.1945)		
System Type(s)		
Site LTAR		

OTHER FACTORS (.1946):
SITE CLASSIFICATION (.1948):
EVALUATED BY:
OTHER(S) PRESENT:


0.56 AC.
54.36'
29.54'
205.87'
30.51'
25' SETBACK
150.00'
136.34'
35' SETBACK
2.88'
78.07'
2.27'
100' TAPER
97.73'
10.25'
C.M. 30.00'
20.40'
74.65'
110.19'
Chamb. Plastic 6-70'
18.00'
85.31'
2.44'
CEDAR BLUFF LN.
DRIVE
Chamb. Repair
267.22'
301.10'
248.73'
20' LAKE ACCESS EASEMENT
279.44'
30
BASEMENT
31
60²
BASEMENT
32
A/H
CRAWL
60²
BASEMENT
34
CRAWL
60²
BASEMENT
L70
L71
L72
L74
L75
L76
L77
L78
L80
L81
L82
L83
L84
L85
L86
L87
L88
L89
L90
L91
15.85'
73.26'
10.31'
10.31'
51.99'
63.92'
0.32'
74.68'
16.52'
47.64'
LOT 33
COS