DEPARTMENT OF ENVIRONMENT, HEALTH, AND NATURAL RESOURCES
DIVISION OF ENVIRONMENTAL HEALTH
ON-SITE WASTEWATER SECTION

PROPERTY ID #: _____
COUNTY: _____

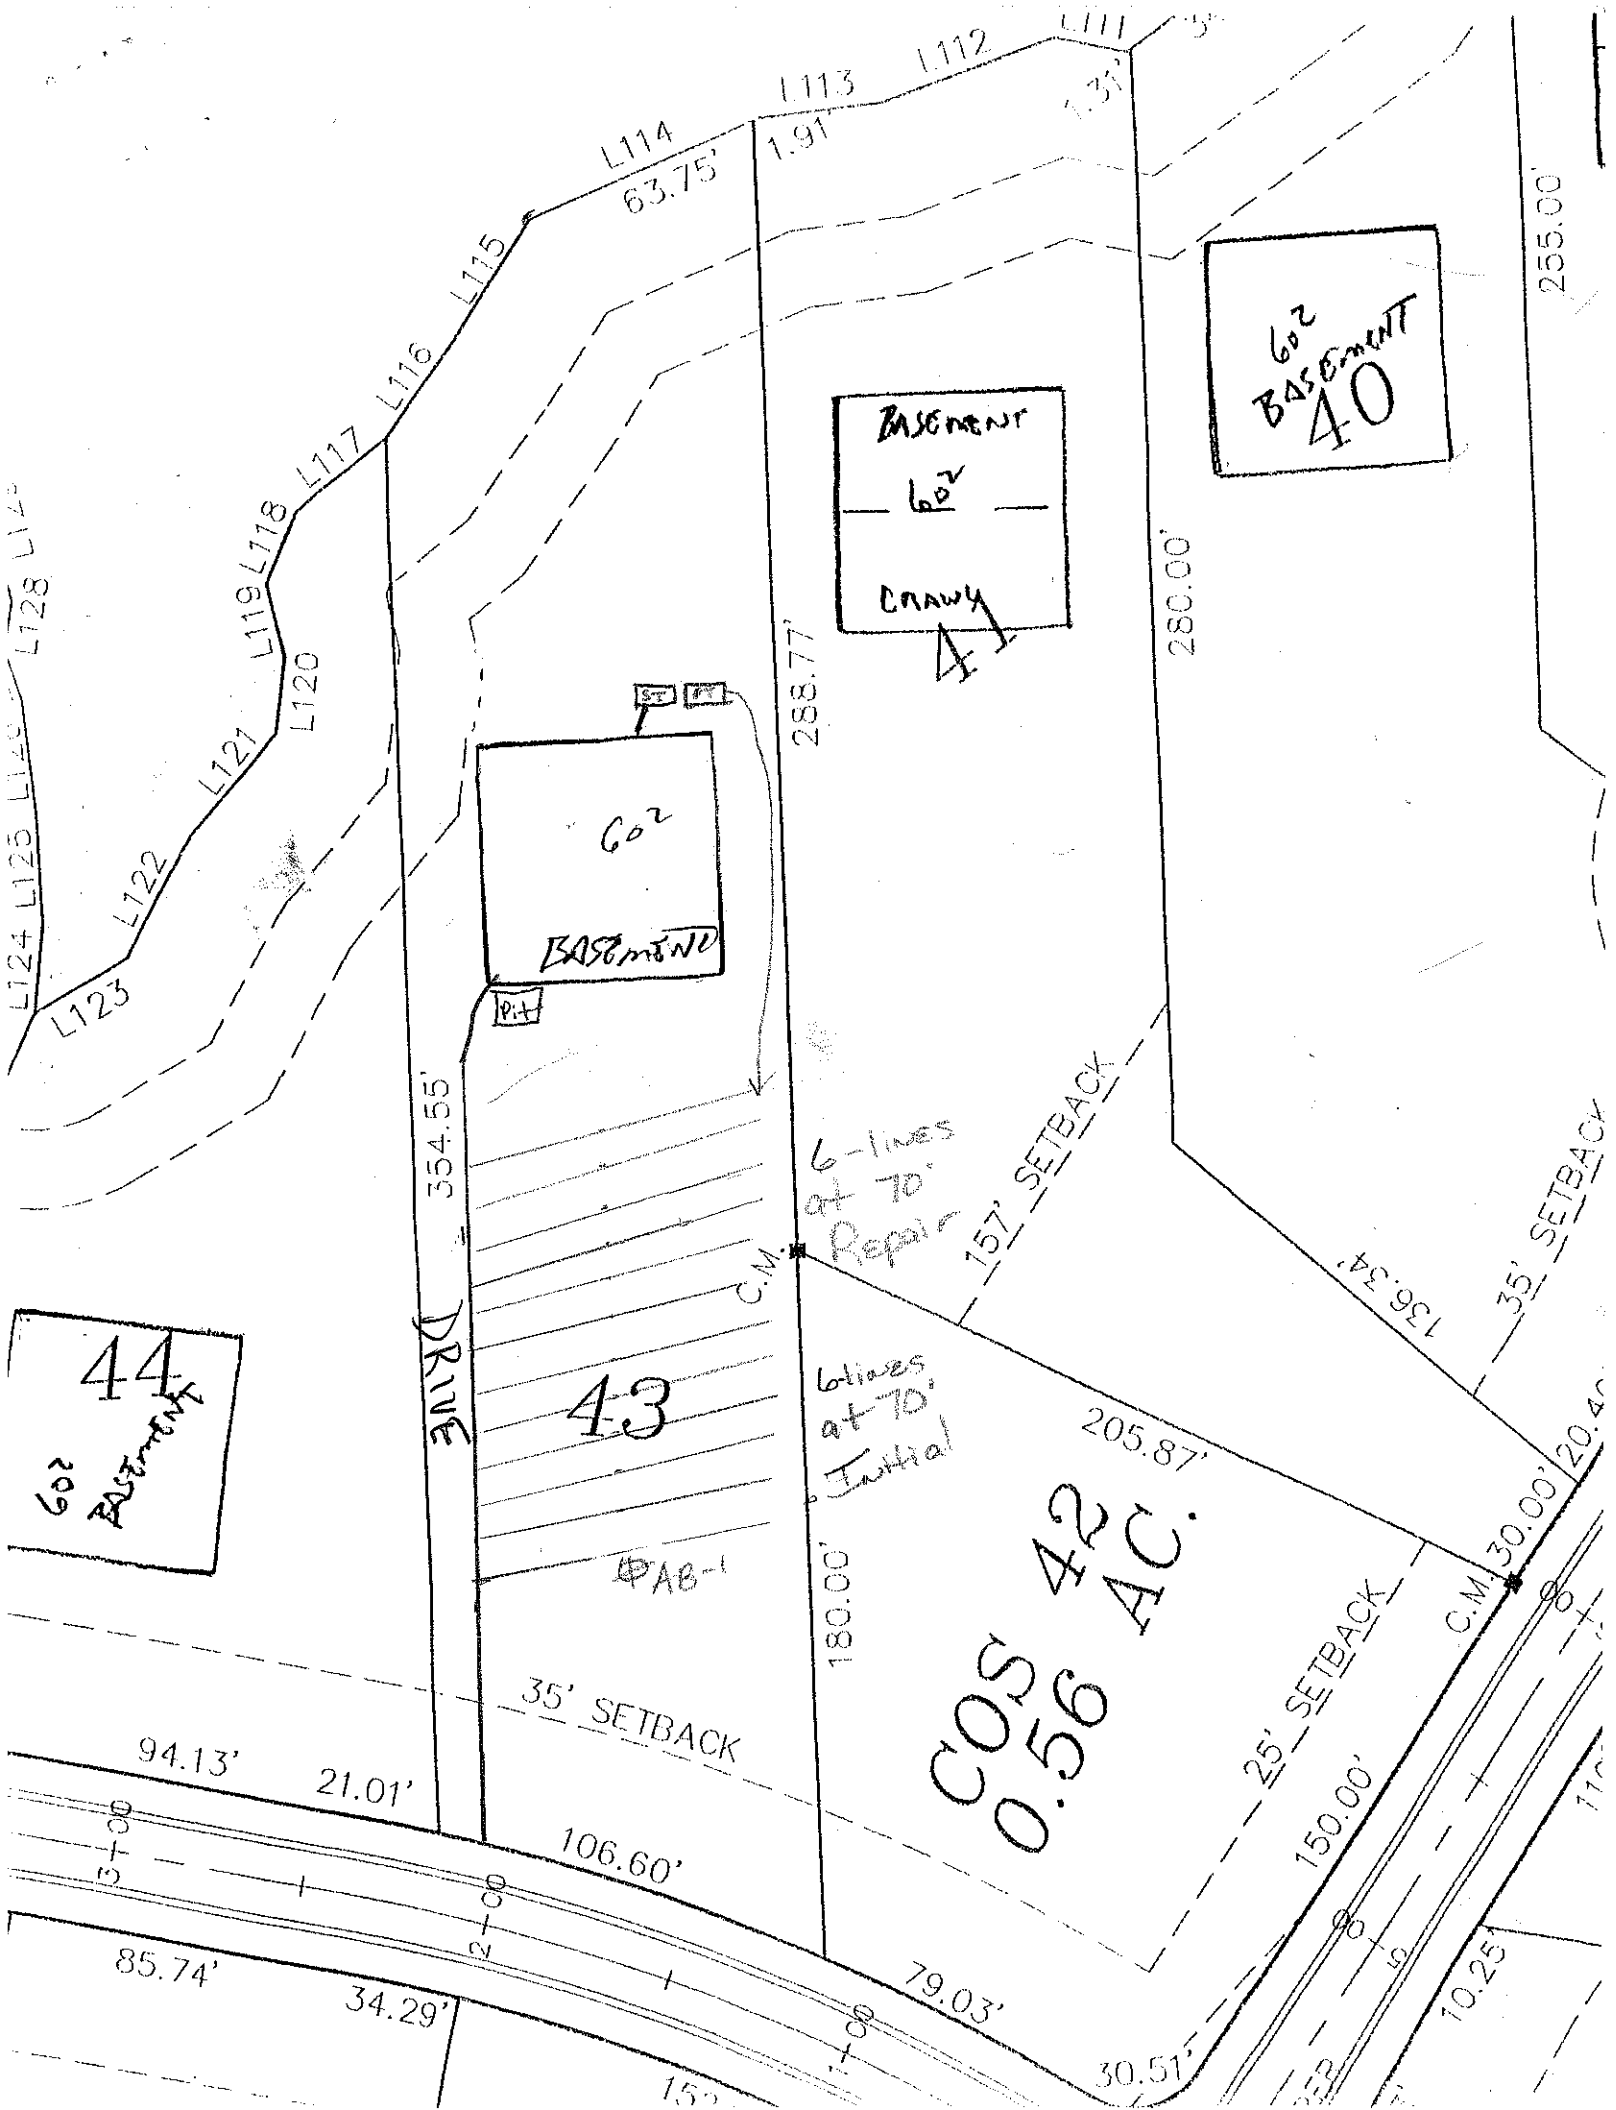
SOIL/SITE EVALUATION
for ON-SITE WASTEWATER SYSTEM

OWNER: CRI APPLICANT: _____
ADDRESS: _____ APPLICATION DATE: _____ DATE EVALUATED: 4/17/97
PROPOSED FACILITY: _____ PROPOSED DESIGN FLOW (.1949): 480 PROPERTY SIZE: _____
LOCATION OF SITE: DH VI Lot # 43 Now lot 42 PROPERTY RECORDED: _____
WATER SUPPLY: ☐ Private ☒ Public ☐ Well ☐ Spring ☐ Other _____
EVALUATION METHOD: ☒ Auger Boring ☒ Pit ☐ Cut
TYPE OF WASTEWATER: ☐ Sewage ☐ Industrial Process ☐ Mixed

PROFILE #	.1940 LANDSCAPE POSITION/ SLOPE %	HORIZON DEPTH (IN.)	SOIL MORPHOLOGY (.1941) .1941 STRUCTURE/ TEXTURE	SOIL MORPHOLOGY (.1941) .1941 CONSISTENCE/ MINERALOGY	OTHER PROFILE FACTORS .1942 SOIL WETNESS/ COLOR	OTHER PROFILE FACTORS .1943 SOIL DEPTH	OTHER PROFILE FACTORS .1956 SAPRO CLASS	OTHER PROFILE FACTORS .1944 RESTR HORIZ	PROFILE CLASS & LTAR
1	LL NWPO	0-10"	SCL GR	SS,SP					.3
		10"-30"	Rd-Brn C mSBK	S,P,SE,FI					
		30"-48"	Rd-Brn Cl mSBK	SS,SP,SE,FF					
2	Pit 1	0-6"	SCL GR	Brn SS,SP					.3
		6"-48"	Lt C - Heavy (2)	mSBK SS,SP,SE,FI-Fr					
3									
4									

DESCRIPTION	INITIAL SYSTEM	REPAIR SYSTEM
Available Space (.1945)		
System Type(s)		
Site LTAR	.3	.3

OTHER FACTORS (.1946): _____
SITE CLASSIFICATION (.1948): PS
EVALUATED BY: Maria Dotson
OTHER(S) PRESENT: _____


L111
L112
L113
L114
L115
L116
L117
L118
L119
L120
L121
L122
L123
L124
L125
L128
1.91'
63.75'
1.31'
255.00'
280.00'
288.77'
354.55'
60²
BASEMENT
40
BASEMENT
60²
CRAWL
60²
BASEMENT
Pit
ST
LAV
DRIVE
43
44
60²
BASEMENT
C.M.
6-lines
at 70'
Repair
157' SETBACK
136.34'
35' SETBACK
6 lines
at 70'
Initial
205.87'
20.4
30.00'
C.M.
COS 42
0.56 AC.
180.00'
PAB-1
35' SETBACK
25' SETBACK
150.00'
94.13'
21.01'
106.60'
85.74'
34.29'
79.03'
30.51'
10.25'