DEPARTMENT OF ENVIRONMENT, HEALTH, AND NATURAL RESOURCES
DIVISION OF ENVIRONMENTAL HEALTH
ON-SITE WASTEWATER SECTION

Sheet ___ of ___
PROPERTY ID #: _____
COUNTY: _____

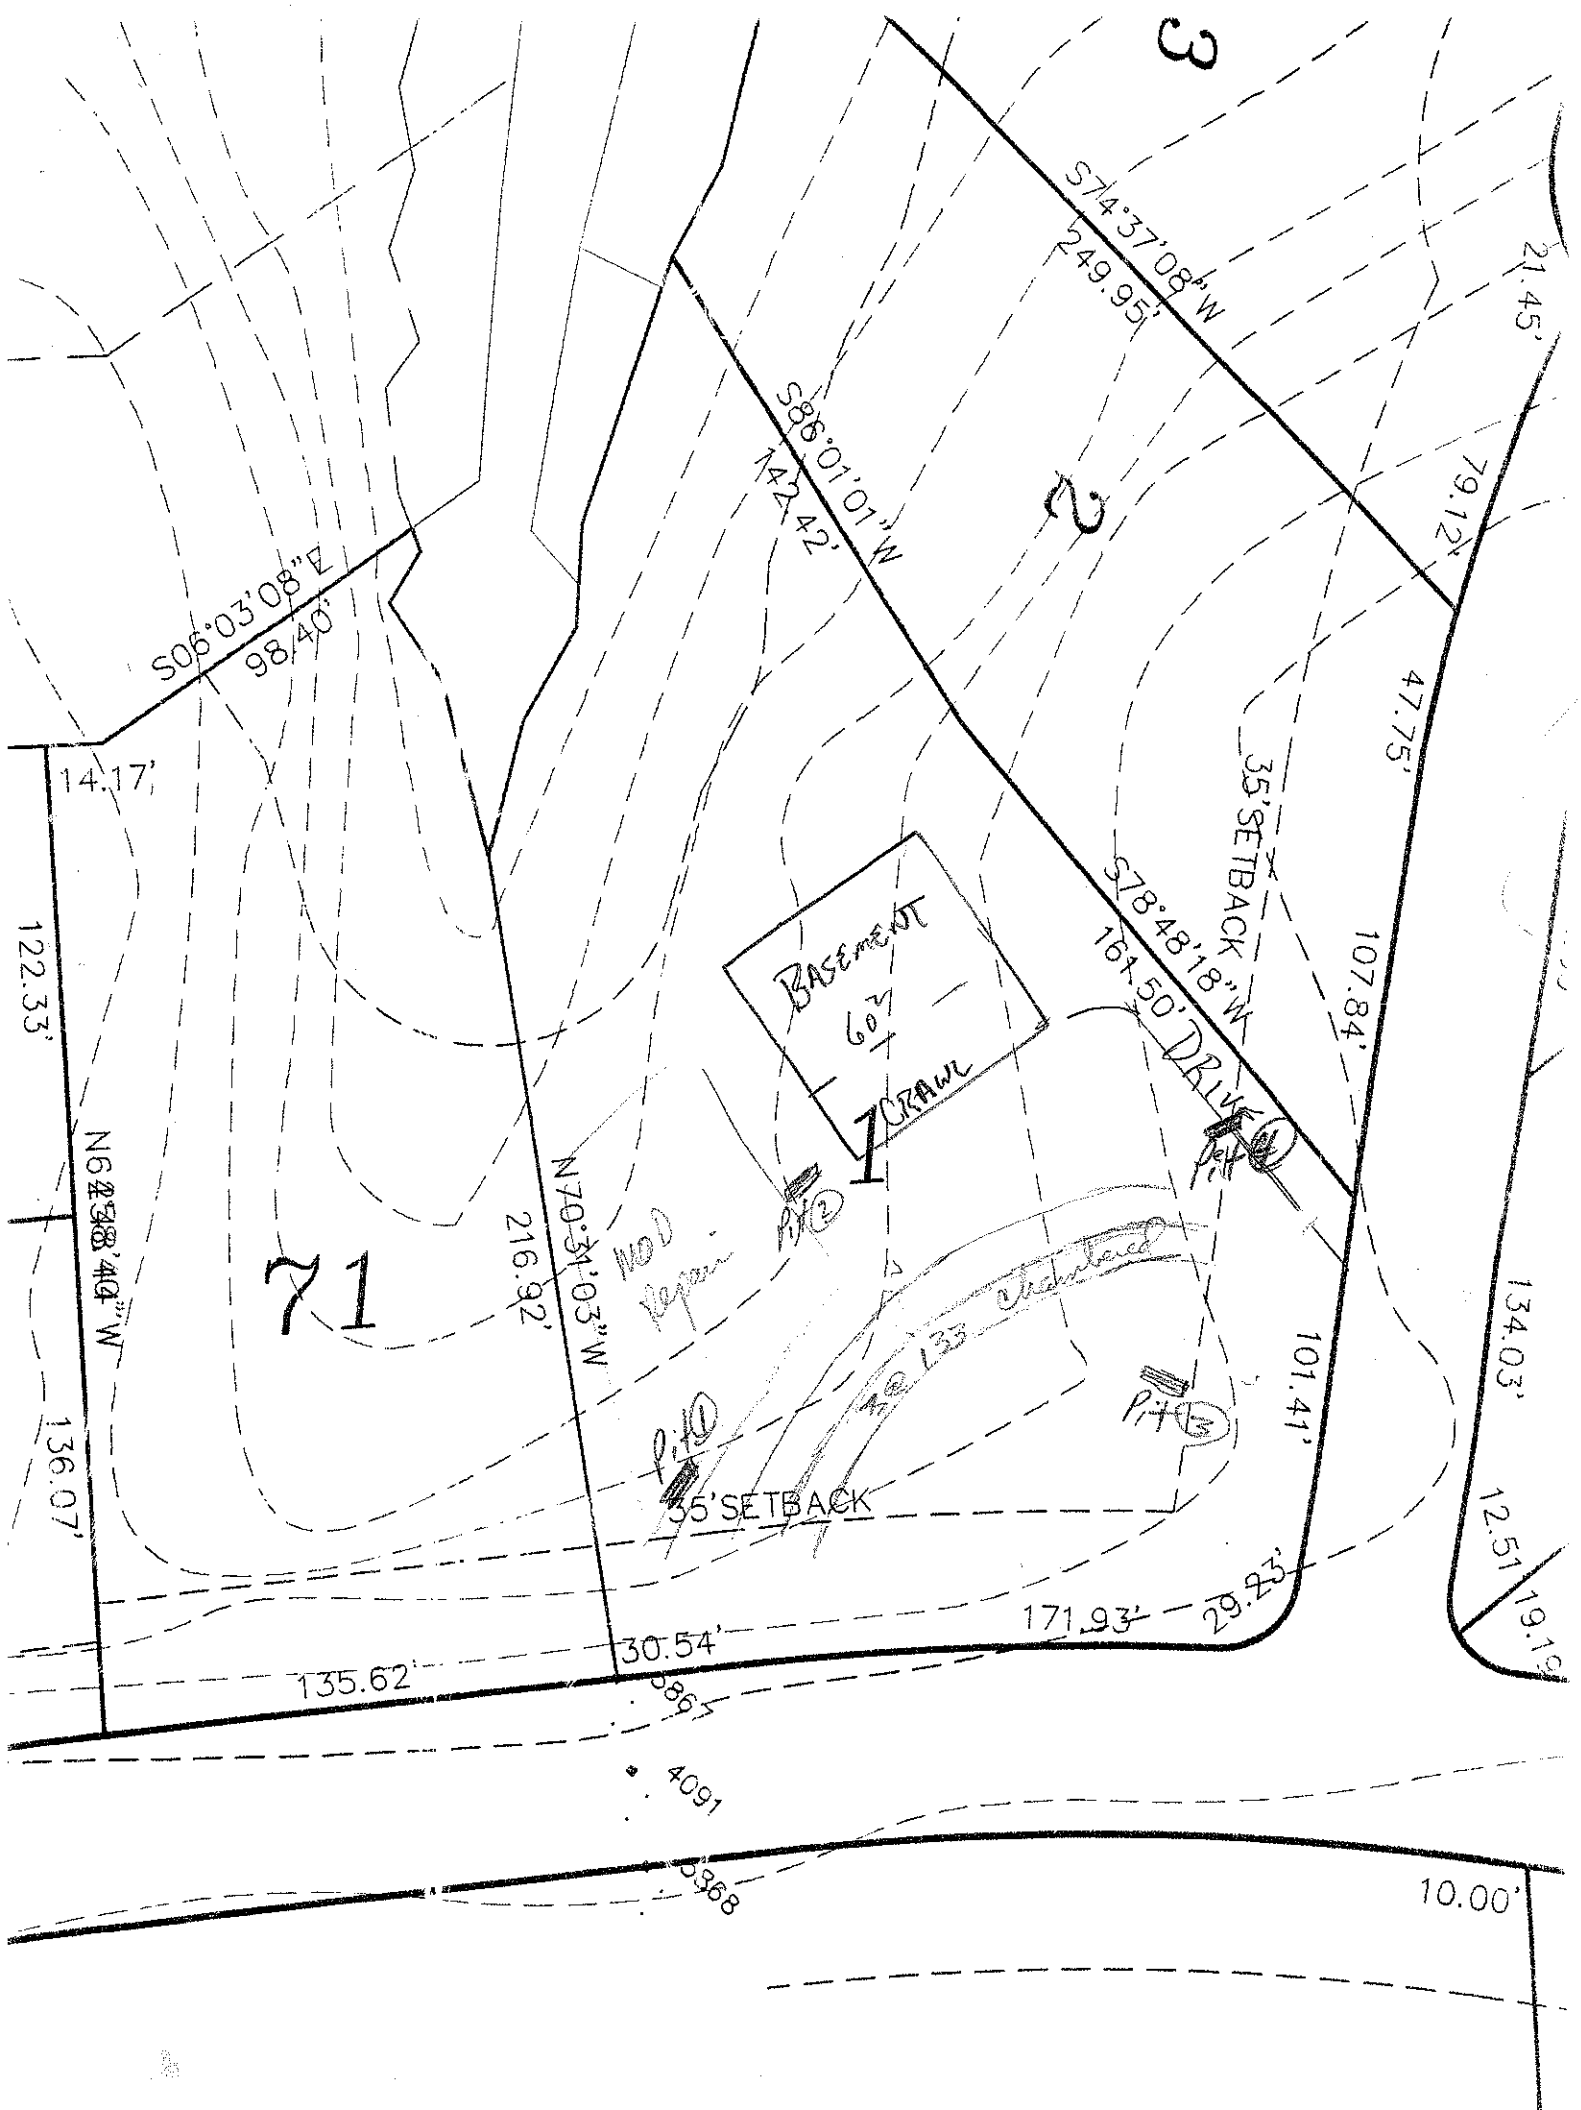
SOIL/SITE EVALUATION
for ON-SITE WASTEWATER SYSTEM

OWNER: CRT — APPLICANT: _____
ADDRESS: _____ — APPLICATION DATE: _____ — DATE EVALUATED: 7-17-96
PROPOSED FACILITY: SFR — PROPOSED DESIGN FLOW (.1949): 480 gpd — PROPERTY SIZE: _____
LOCATION OF SITE: Lot 1 Sect 5 - Harbour II — PROPERTY RECORDED: _____
WATER SUPPLY: ☐ Private ☑ Public ☐ Well ☐ Spring ☐ Other _____
EVALUATION METHOD: ☐ Auger Boring ☑ Pit ☐ Cut
TYPE OF WASTEWATER: ☑ Sewage ☐ Industrial Process ☐ Mixed

PROFILE #	1940 LANDSCAPE POSITION/ SLOPE %	HORIZON DEPTH (IN.)	SOIL MORPHOLOGY (.1941) 1941 STRUCTURE/ TEXTURE	1941 CONSISTENCE/ MINERALOGY	OTHER PROFILE FACTORS 1942 SOIL WETNESS/ COLOR	1943 SOIL DEPTH	1956 SAPRO CLASS	1944 RESTR HORIZ	PROFILE CLASS & LTAR
1	L 15-25%	0-6	SL/scL	fr					.3
		6-39	R c/cL	fr-fi					
		39-48	SL sap	fr					
2	L 15-25%	0-11	gr SL/scL	fr					.3
		11-31	wk sbk R c/cL	fi ss sp 1:1					
		31-48	wk sbk yR scL	ss sp 1:1					
			Common fine mot	ss sp					
3	R 2-4%	0-4	gr SL	fr					.3
		4-36	sbk R c/cL	fi-sp 1:1					
		36-60	wk sbk y SL sap	fr ss sp					
4	L 15-20%	0-50	wk sbk scL/cL	fr ss sp 1:1					.37

DESCRIPTION	INITIAL SYSTEM	REPAIR SYSTEM
Available Space (.1945)		
System Type(s)		
Site LTAR		

OTHER FACTORS (.1946): _____
SITE CLASSIFICATION (.1948): _____
EVALUATED BY: _____
OTHER(S) PRESENT: _____


3
2
1
71
S74°37'08"W
249.95'
21.45'
S86°01'01"W
142.42'
79.12'
S06°03'08"E
98.40'
14.17'
47.75'
35'SETBACK
S78°48'18"W
164.50'
DRIVE
107.84'
122.33'
BASEMENT
60'
CRAWL
N70°34'03"W
216.92'
Pit 2
Pit 1
Pit 3
Calculated
39.133
101.41'
134.03'
136.07'
35'SETBACK
12.51'
19.19'
171.93'
29.23'
30.54'
135.62'
4091
10.00'