DEPARTMENT OF ENVIRONMENT,
HEALTH, & NATURAL RESOURCES
DIVISION OF ENVIRONMENTAL HEALTH

SHEET ____ OF ____
PROPERTY I.D.#: ____
PROPERTY RECORDED: ____
COUNTY: ____

SOIL/SITE EVALUATION
FOR
ON-SITE WASTEWATER SYSTEM

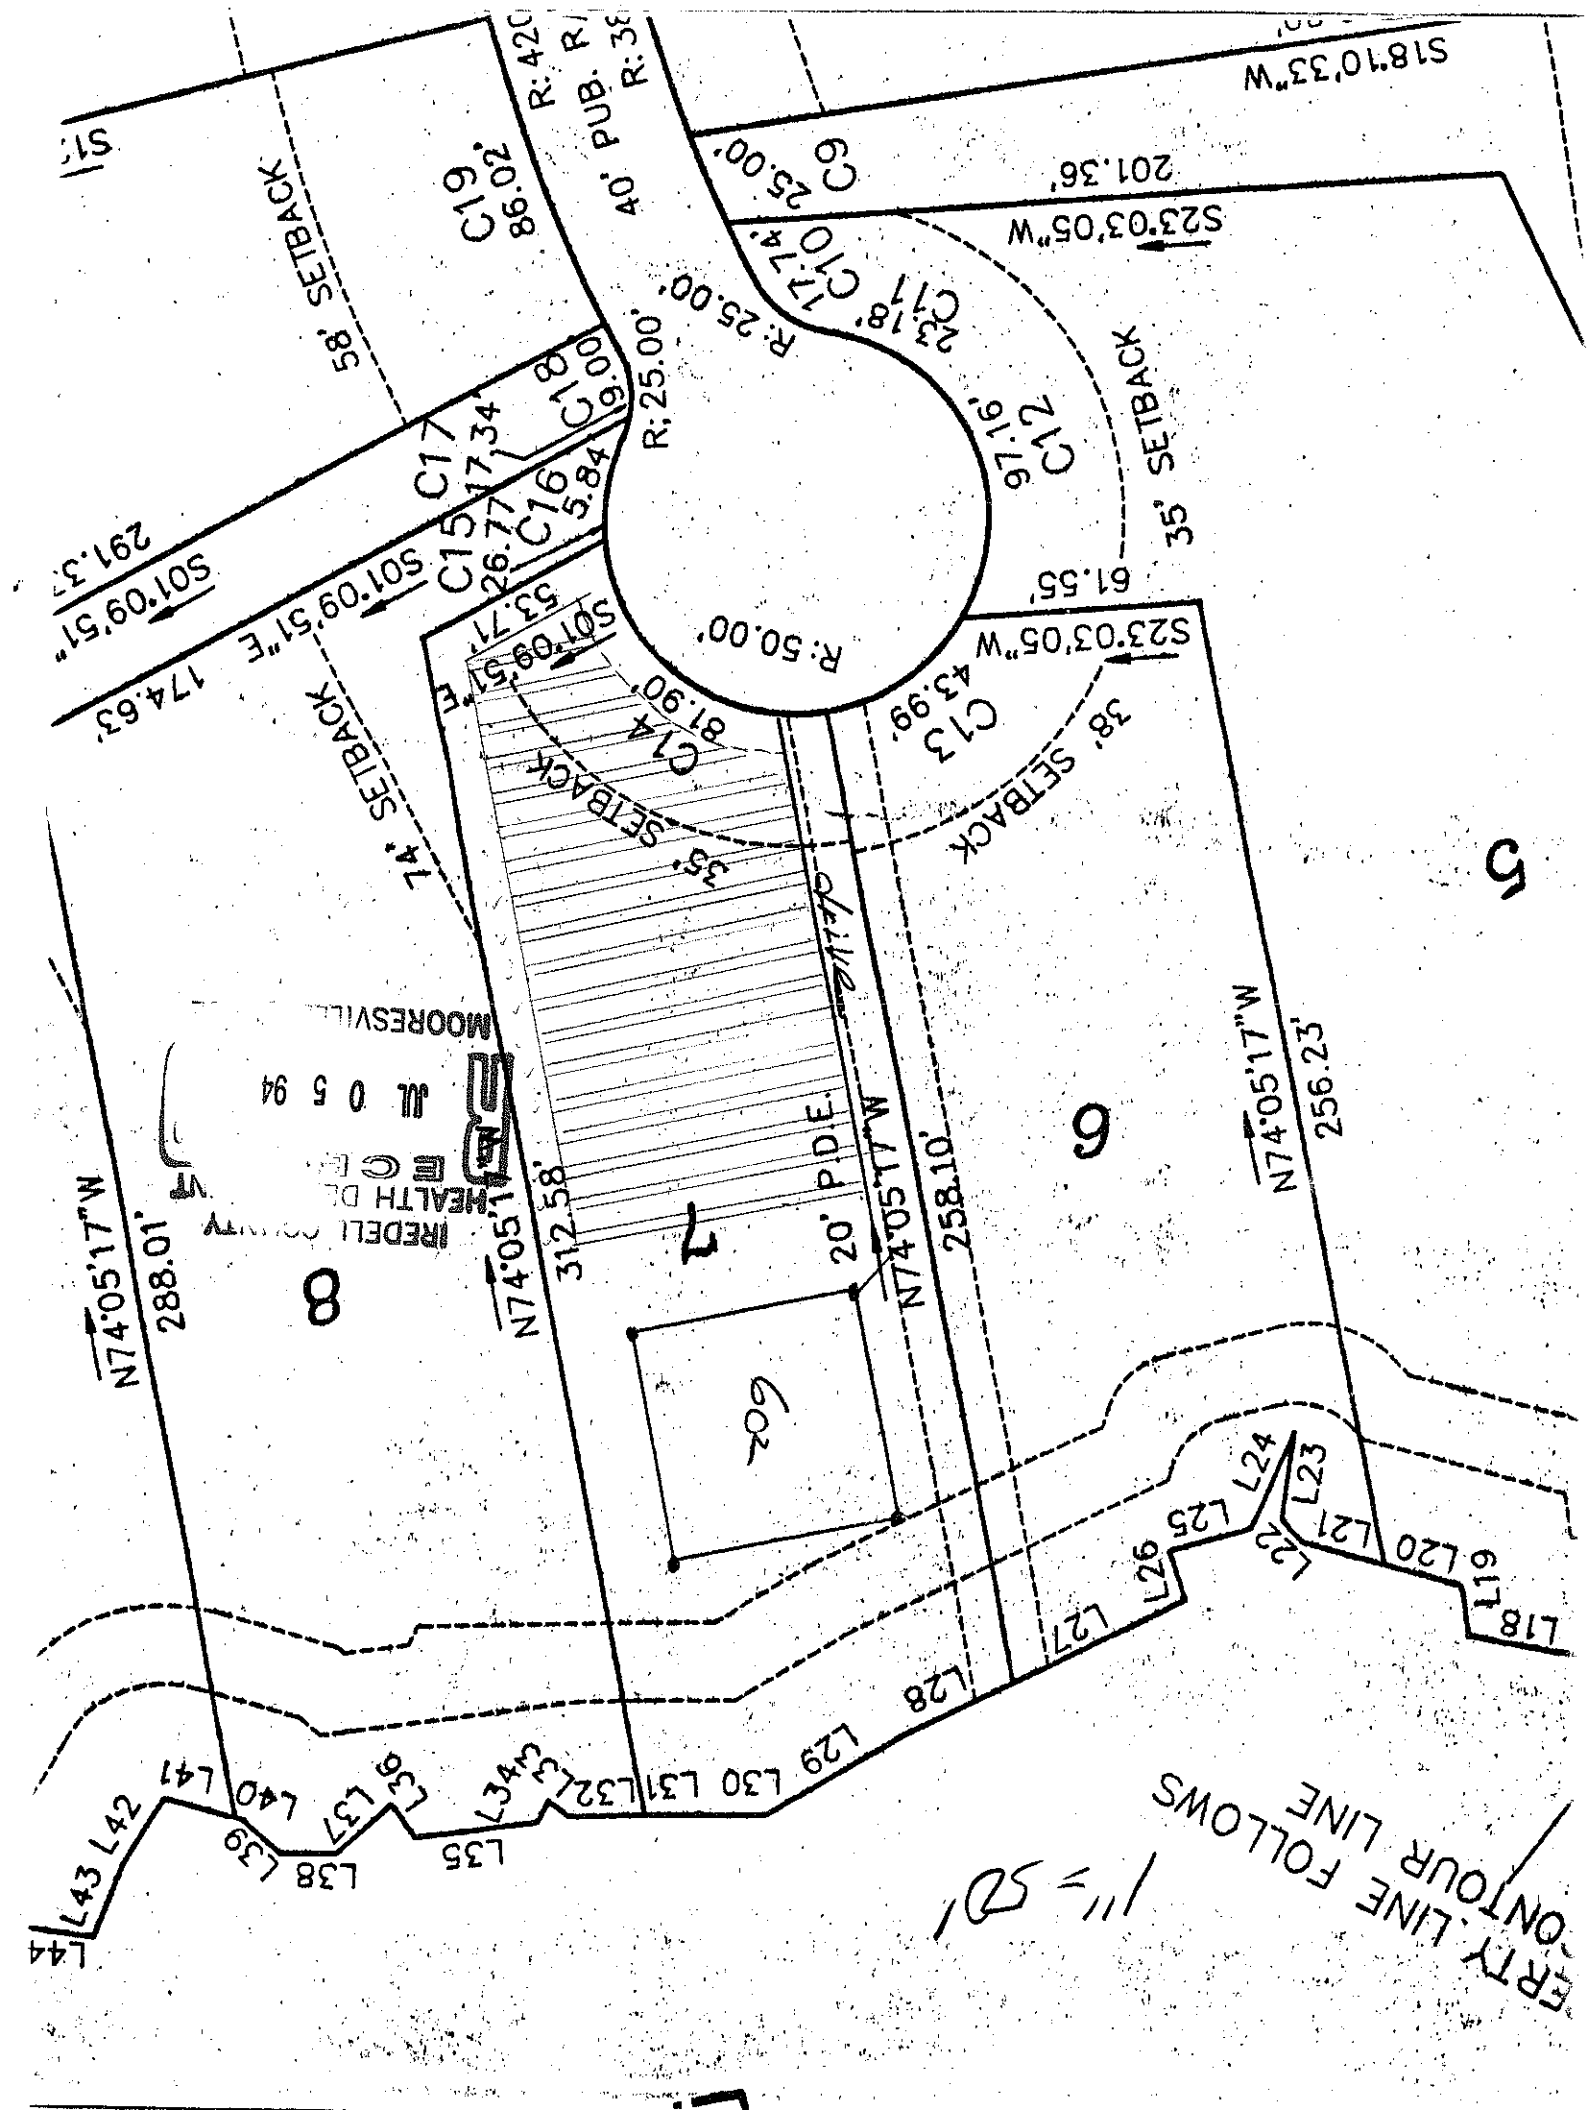
APPLICANT: Toney Jacobs OWNER: __ AGENT: __ PHONE: ____
ADDRESS: Crescent Resources Inc. & APPLICATION DATE: ____ DATE EVALUATED: 6-27-94
owner
PROPOSED FACILITY: SFR
PROPERTY SIZE: ____
LOCATION OF SITE: Lot 7.
WATER SUPPLY: On-Site Well ____ Comm. Well ____ Public ____ Other ____ EVAL. METHOD: Auger Boring ✓ Pit ____ Cut ____

PROFILE	.1940 LANDSCP POS. (%)	HORIZON DEPTH (IN.)	.1941 STRUCTURE/TEXTURE	.1941 MINERALOGY/ CONSISTENCE	.1942 WETNESS COND.	.1944 RESTRICT HORIZONS	.1948 CLASS OF HORIZ	1943/ 1956 SAPRLT CLASS	HORIZON LTAR
Boring 1		0-7	fsc mod-wk sbk	msfi	—	—	P	—	0.35-.3
		7-20	c wk sbk	mfi	—	—	P	—	0.3-.25
		20-43	sic wk sbk	mfi	—	—	P	—	0.3-.25
		43-50	sil Saprolite	mfr ws wsp	>50	>50	—	U	—
pit 2		0-6	fsc		—	—	—	—	0.35-.3
		6-14	c		—	—	—	—	0.3-.25
		14-34	sic		—	—	P	—	0.3
		34-48	sic ct Saprolite		>48	>48	P	—	0.3
3									
4									
5									

AVAILABLE SPACE (.1945) ____ SITE CLASSIFICATION (.1948): ____ SITE LONG-TERM ACCEPTANCE RATE: ____

EVALUATED BY: ____ OTHER(S) PRESENT: ____

COMMENTS: ____


S18°10'33"W
201.36'
S23°03'05"W
C9
25.00'
R: 25.00'
C18
C17
C10
17.74'
23.18'
C12
97.16'
35' SETBACK
61.55'
R: 50.00'
C13
43.99'
38' SETBACK
S23°03'05"W
C19
86.02'
58' SETBACK
40' PUB.
C8
19.00'
C7
17.34'
C15
26.77'
C16
5.84'
S01°09'51"E
174.63'
291.3'
S01°09'51"E
53.71'
74' SETBACK
C14
81.90'
35' SETBACK
N74°05'17"W
312.58'
20' P.U.D.E.
N74°05'17"W
258.10'
N74°05'17"W
256.23'
N74°05'17"W
288.01'
6
7
8
9
L18
L19
L20
L21
L22
L23
L24
L25
L26
L27
L28
L29
L30
L31
L32
L33
L34
L35
L36
L37
L38
L39
L40
L41
L42
L43
L44
MOORESVILLE
IREDELL COUNTY
HEALTH DEPT.
JUL 05 94
RECEIVED
PROPERTY LINE FOLLOWS CONTOUR LINE
1" = 50'