DIVISION OF ENVIRONMENTAL HEALTH
ON-SITE WASTEWATER SECTION

PROPERTY ID #: _____
COUNTY: _____

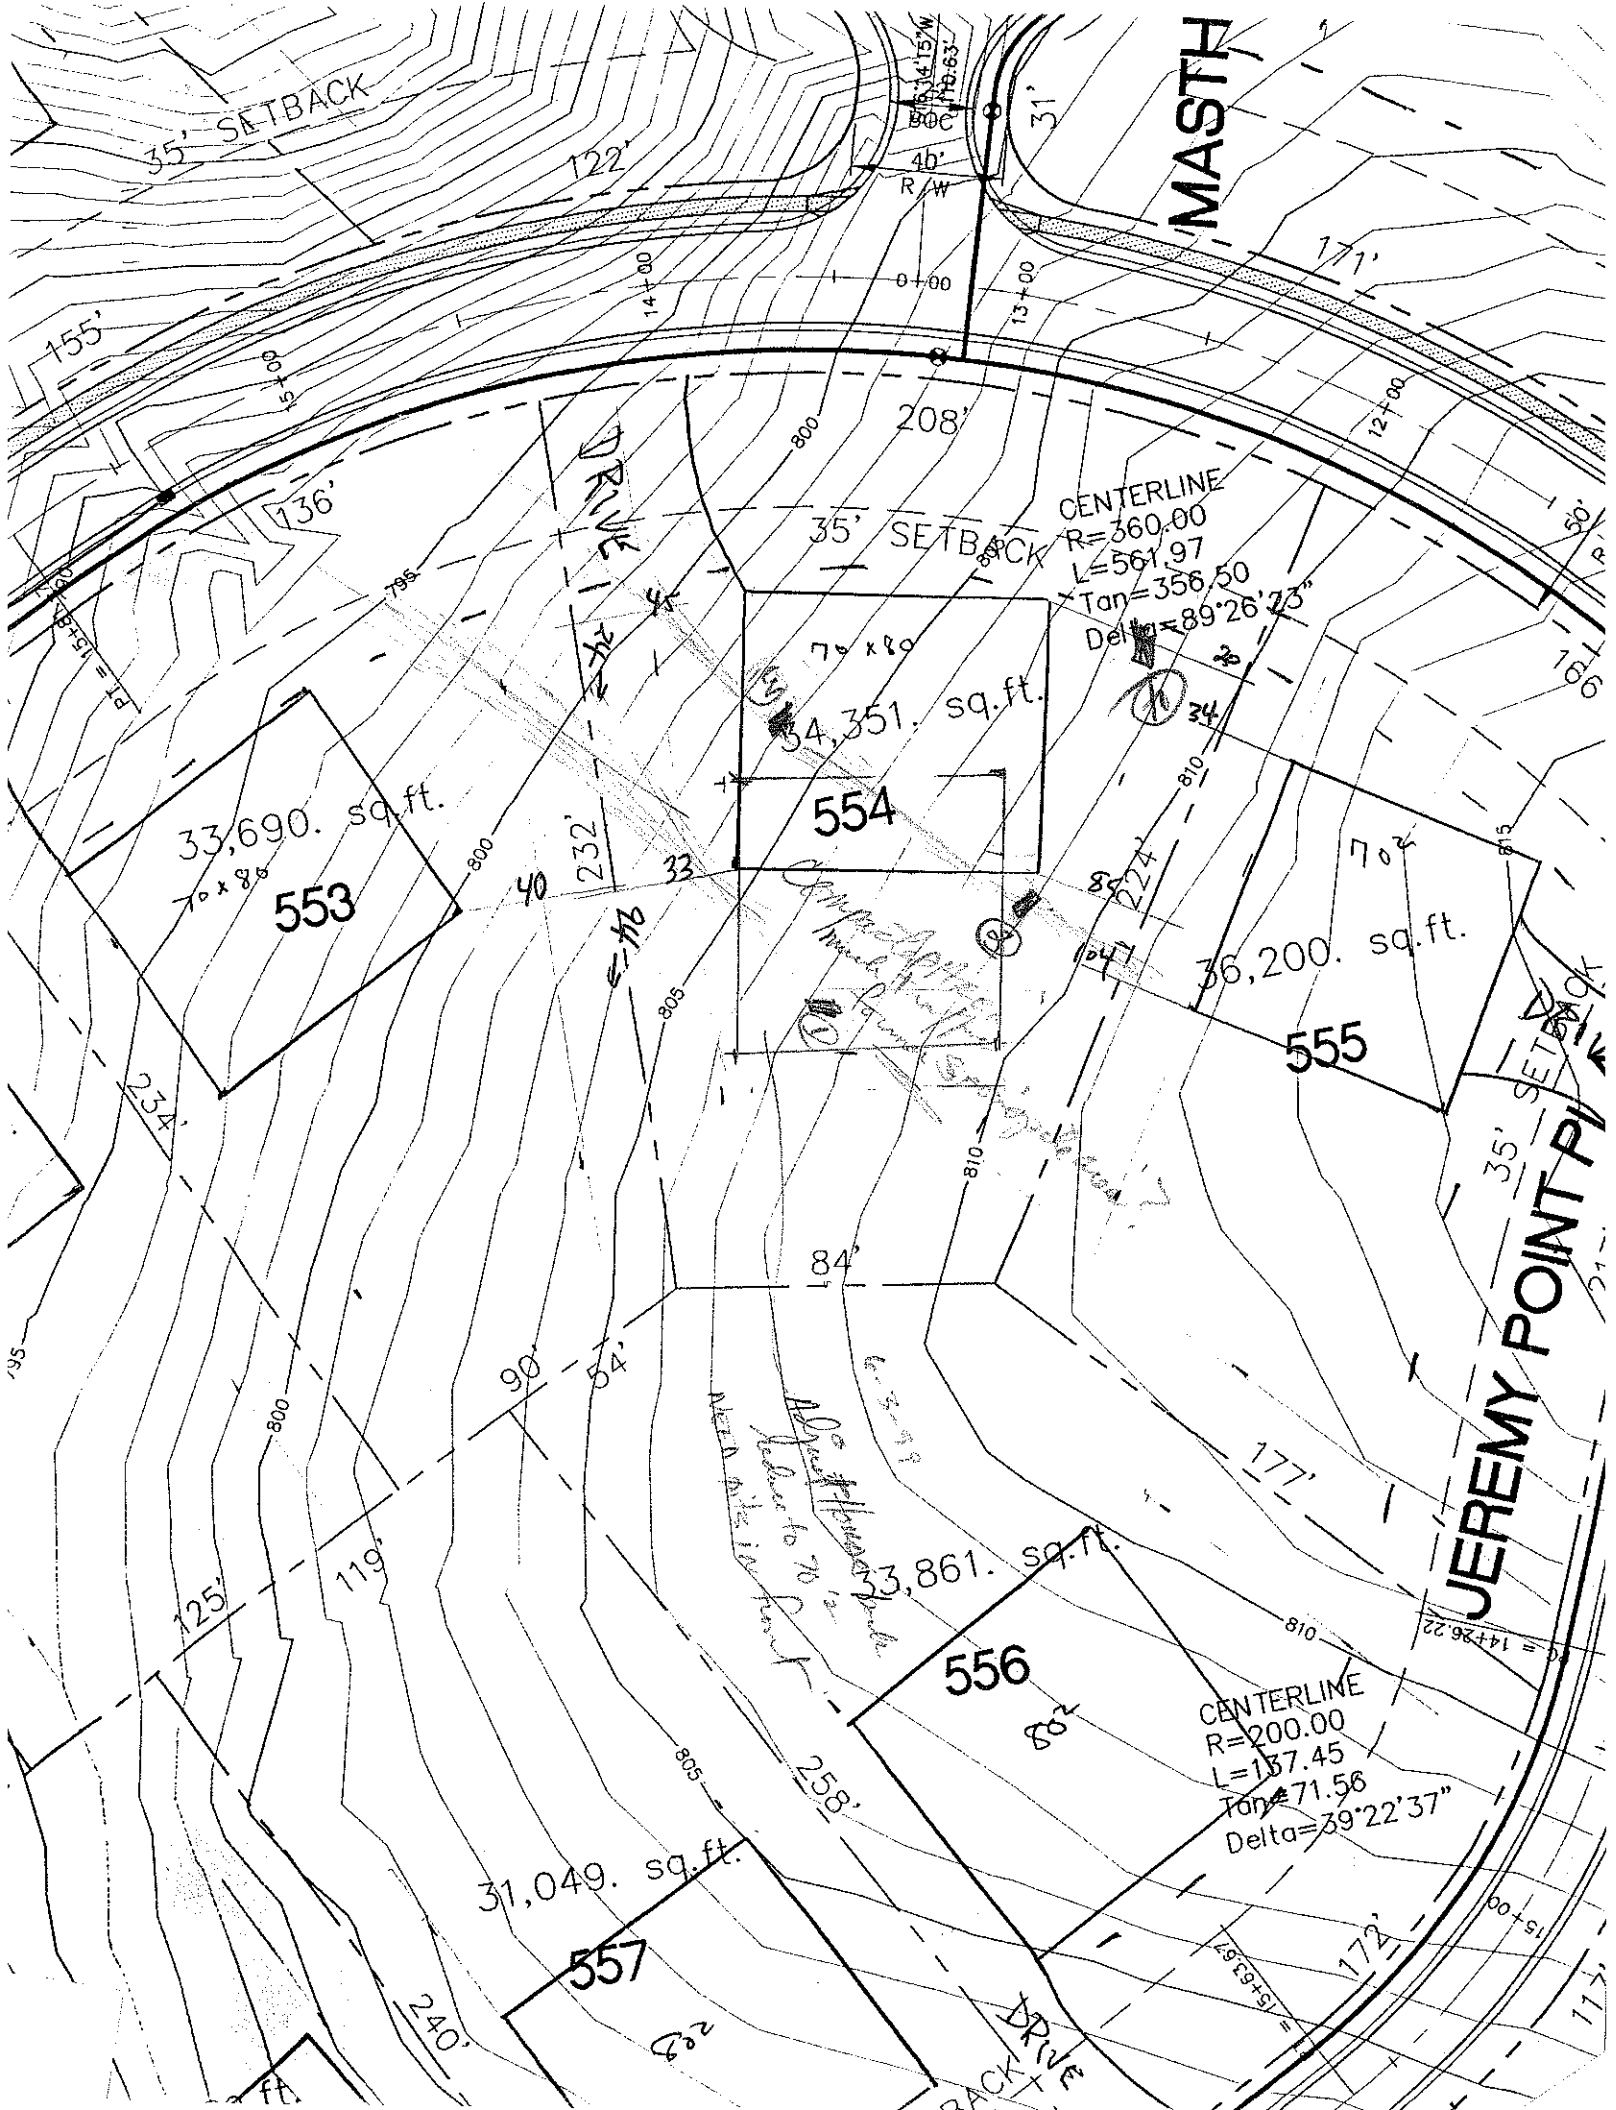
SOIL/SITE EVALUATION
for ON-SITE WASTEWATER SYSTEM

OWNER: CRI APPLICANT: _____
ADDRESS: _____ APPLICATION DATE: _____ DATE EVALUATED: 5-28-99
PROPOSED FACILITY: _____ PROPOSED DESIGN FLOW (.1949): _____ PROPERTY SIZE: _____
LOCATION OF SITE: Lot 554 phase 5 Theft. PROPERTY RECORDED: _____
WATER SUPPLY: ☐ Private ☐ Public ☐ Well ☐ Spring ☐ Other _____
EVALUATION METHOD: ☐ Auger Boring ☐ Pit ☐ Cut Another lot screwed up by unnecessary traffic
TYPE OF WASTEWATER: ☐ Sewage ☐ Industrial Process ☐ Mixed

PROFILE #	.1940 LANDSCAPE POSITION/ SLOPE %	HORIZON DEPTH (IN.)	SOIL MORPHOLOGY (.1941) .1941 STRUCTURE/ TEXTURE	SOIL MORPHOLOGY (.1941) .1941 CONSISTENCE/ MINERALOGY	OTHER PROFILE FACTORS .1942 SOIL WETNESS/ COLOR	OTHER PROFILE FACTORS .1943 SOIL DEPTH	OTHER PROFILE FACTORS .1956 SAPRO CLASS	OTHER PROFILE FACTORS .1944 RESTR HORIZ	PROFILE CLASS & LTAR
1	#22 TCA	0-20	compacted zone						PS .3 .22
		20-43	mstb rycl	fr sssp common mid sap					
		43-57	massive ysl/lsap	limited fr sap			36%B		
2		0-27	compacted zone						PS .3 .22
		27-57	mstb ybrn l/sap	limited fr sap					
3	6-4-99	0-18	compacted zone						PS .25
		18-29	cl laminar	fr sap					
		29-60	massive sl/ls sap	fr sap					
4	6-4-99	0-10	compacted zone						PS .25
		10-25	BC l/sl sap						
		25-59	mstb rbrn l/sl sap	fr sap					

DESCRIPTION	INITIAL SYSTEM	REPAIR SYSTEM
Available Space (.1945)		
System Type(s)		
Site LTAR		

OTHER FACTORS (.1946): _____
SITE CLASSIFICATION (.1948): _____
EVALUATED BY: _____
OTHER(S) PRESENT: _____


MASTH
JEREMY POINT PL
35' SETBACK
122'
155'
136'
208'
171'
CENTERLINE
R=360.00
L=561.97
Tan=356.50
Delta=89°26'23"
70 x 80
34,351. sq.ft.
554
33,690. sq.ft.
70 x 80
553
232'
224'
36,200. sq.ft.
555
84'
90'
54'
177'
33,861. sq.ft.
556
80'
CENTERLINE
R=200.00
L=137.45
Tan=71.56
Delta=39°22'37"
258'
31,049. sq.ft.
557
240'
125'
119'
172'
DRIVE