DEPARTMENT OF ENVIRONMENT AND NATURAL RESOURCES
DIVISION OF ENVIRONMENTAL HEALTH
ON-SITE WASTEWATER SECTION

Sheet ___ of ___
PROPERTY ID #: _____
COUNTY: _____

SOIL/SITE EVALUATION
for ON-SITE WASTEWATER SYSTEM

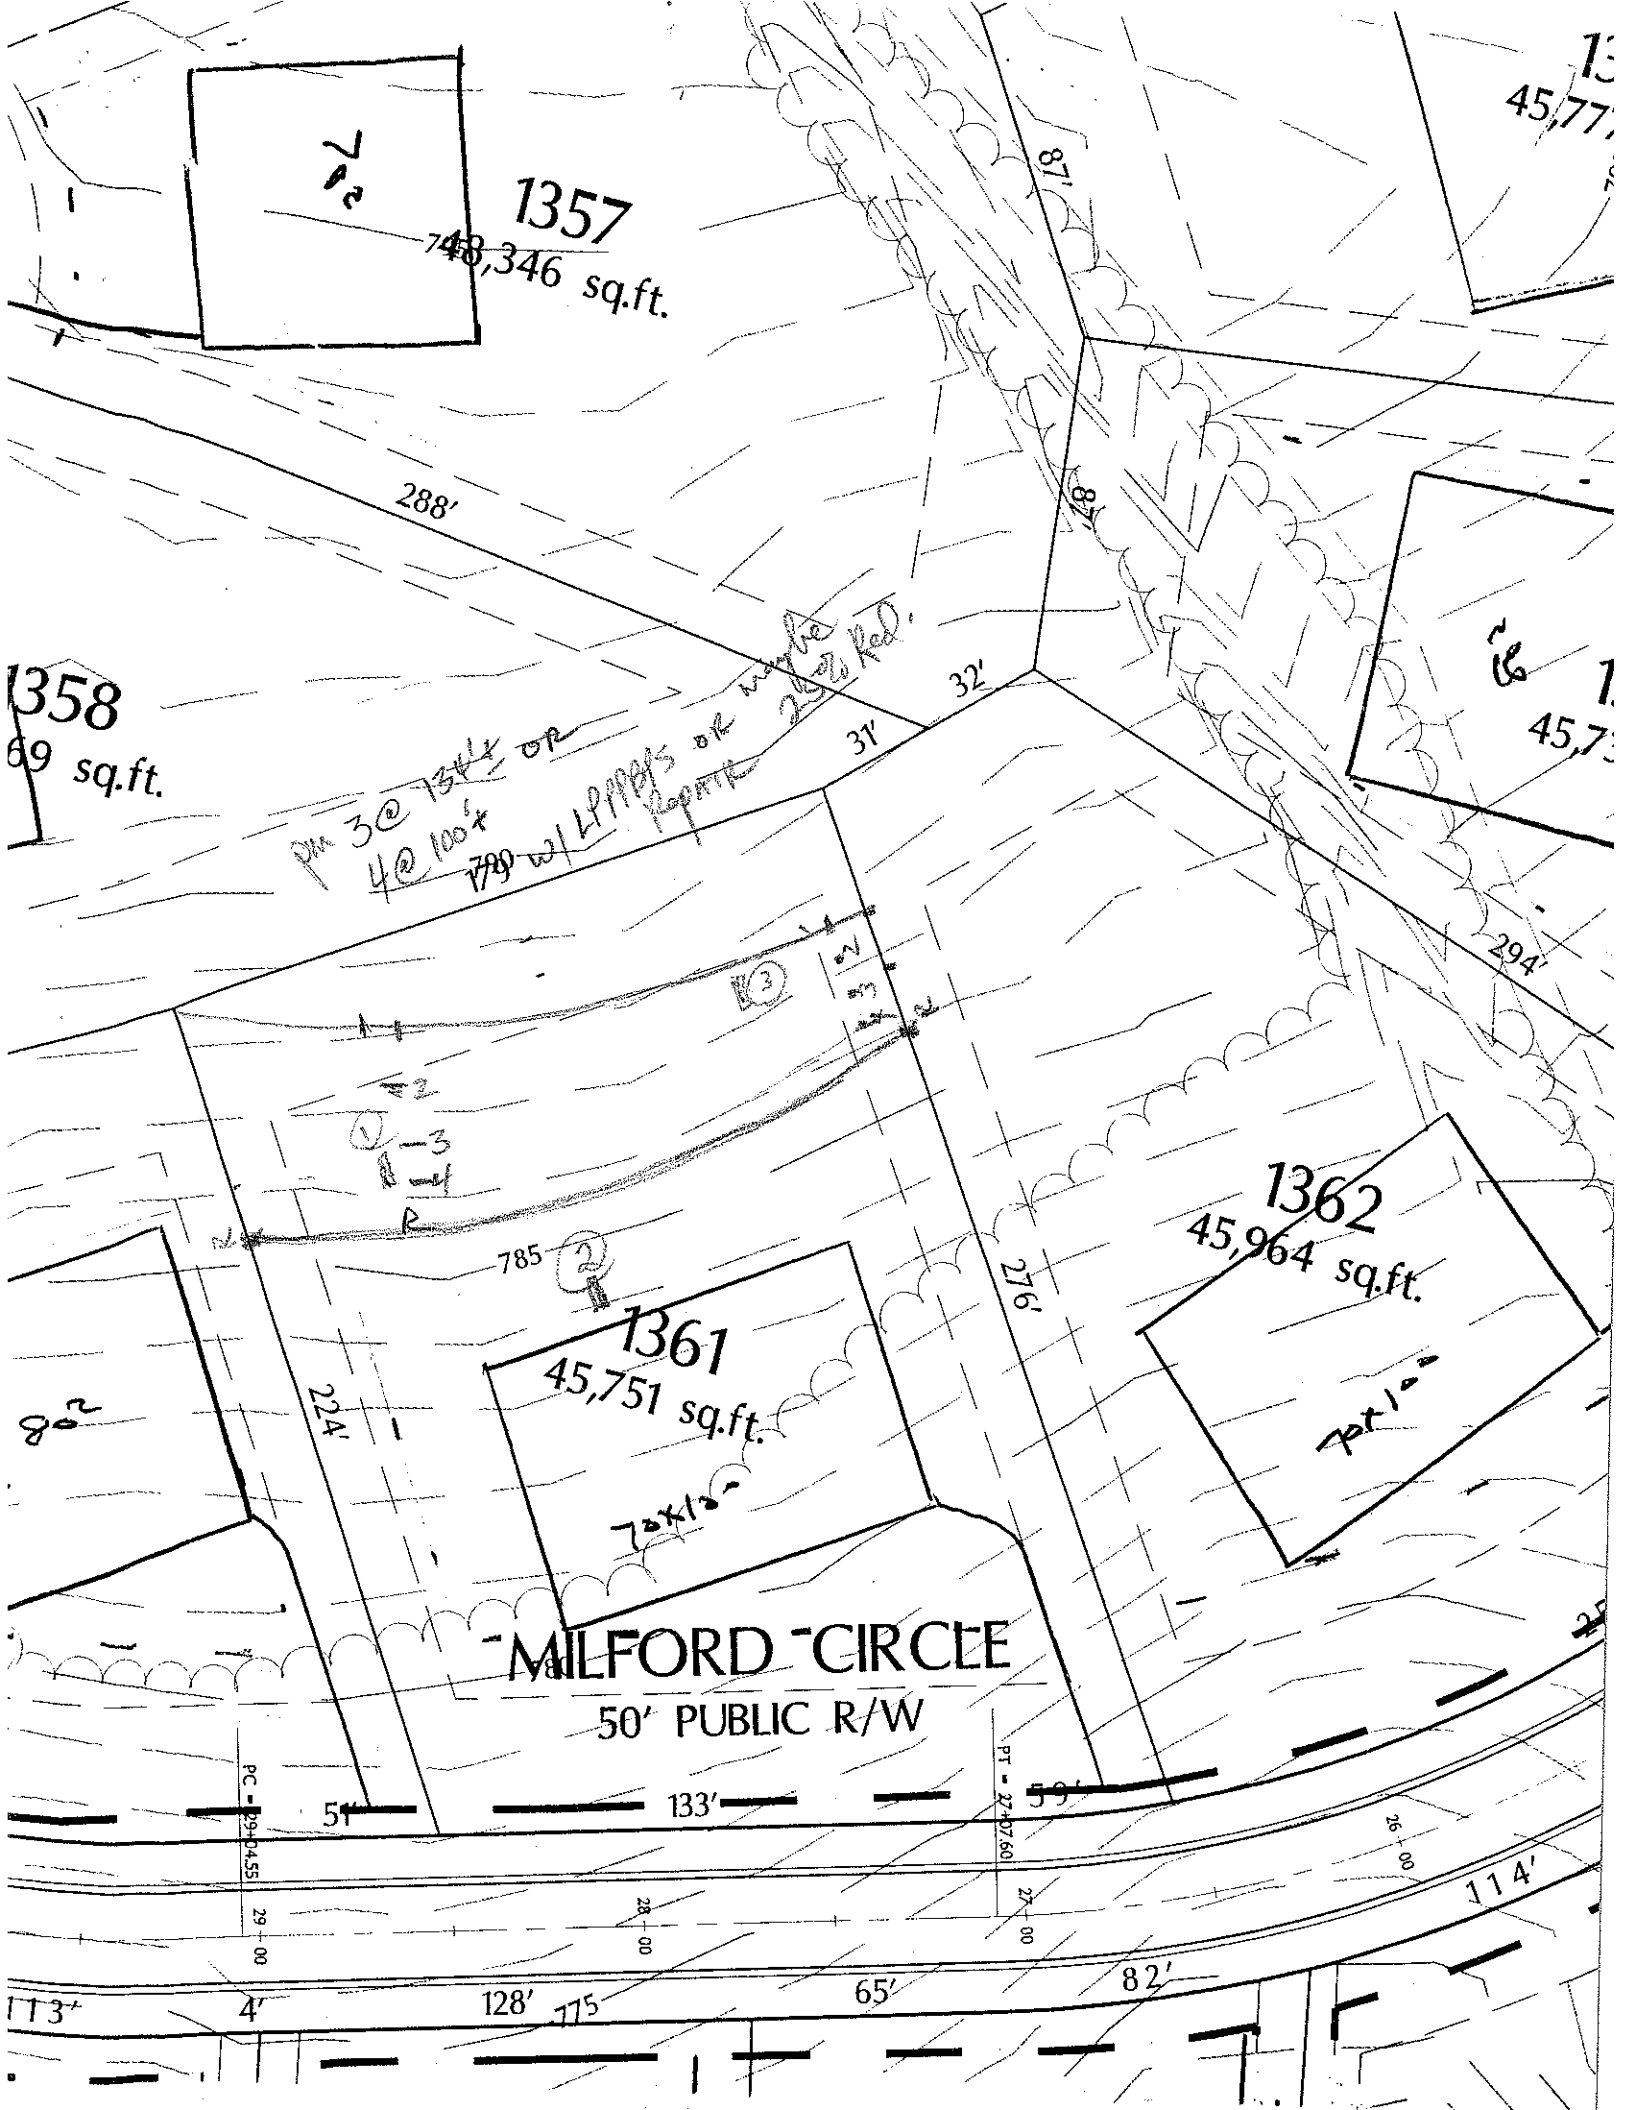
OWNER: CRL APPLICATION DATE _____
ADDRESS: _____
PROPOSED FACILITY: _____ PROPOSED DESIGN FLOW (.1949): 480gpd DATE EVALUATED: 3-18-04
LOCATION OF SITE: Lot 136 ph 13 THRU 17 PROPERTY SIZE: _____
WATER SUPPLY: ☐ Private ☐ Public ☒ Well ☐ Spring ☐ Other _____ PROPERTY RECORDED: _____
EVALUATION METHOD: ☐ Auger Boring ☒ Pit ☐ Cut
TYPE OF WASTEWATER: ☒ Sewage ☐ Industrial Process ☐ Mixed

PROFILE #	.1940 LAND-SCAPE POSITION/ SLOPE %	HORI-ZON DEPTH (IN.)	SOIL MORPHOLOGY (.1941) .1941 STRUCTURE/ TEXTURE	.1941 CONSISTENCE/ MINERALOGY	OTHER PROFILE FACTORS .1942 SOIL WETNESS/ COLOR	.1943 SOIL DEPTH	.1956 SAPRO CLASS	.1944 RESTR HORIZ	PROFILE CLASS & LTAR
1	5% ± L	0-4	wk sbk rbrn sl	fr sss p					.3
		4-17	m-wk fsbk RC	fr ss p sl sty p					
		17-48	wk fsbk yred	fr sss p	few w. rock fs mp few quartz, feldspar work pred soil				
2	5% ± L	0-9	wk fsbk rbrn sl	fr sss p					.3
		9-27	m fsbk RC	fr ss p sl sty p					
		27-52	m-wk fsbk yred	fr sss p	common in fs mp few in w. rock				
3	5% ± L	0-9	gr-wk sbk rbrn sl	fr sss p					.3
		9-24	m fsbk RC	fr ss p sl sty p					
		24-52	wk fsbk yred	fr sss p	common in fs mp				
4									

DESCRIPTION	INITIAL SYSTEM	REPAIR SYSTEM
Available Space (.1945)	PS	PS
System Type(s)	Conv 25% Rd	Conv 25% Rd
Site LTAR	.3	.3

OTHER FACTORS (.1946): _____
SITE CLASSIFICATION (.1948): PS
EVALUATED BY: _____
OTHER(S) PRESENT: David Pennington

COMMENTS: _____


1357
48,346 sq.ft.
288'
1358
sq.ft.
32'
31'
87'
294'
1362
45,964 sq.ft.
1361
45,751 sq.ft.
785
276'
224'
MILFORD CIRCLE
50' PUBLIC R/W
133'
114'
113'
4'
128'
65'
82'
PC - 29+04.55
PT - 27+07.60
29+00
28+00
27+00
26+00