N-SITE WASTEWATER SECTION

PROPERTY ID #: _____
COUNTY: _____

SOIL/SITE EVALUATION
for ON-SITE WASTEWATER SYSTEM

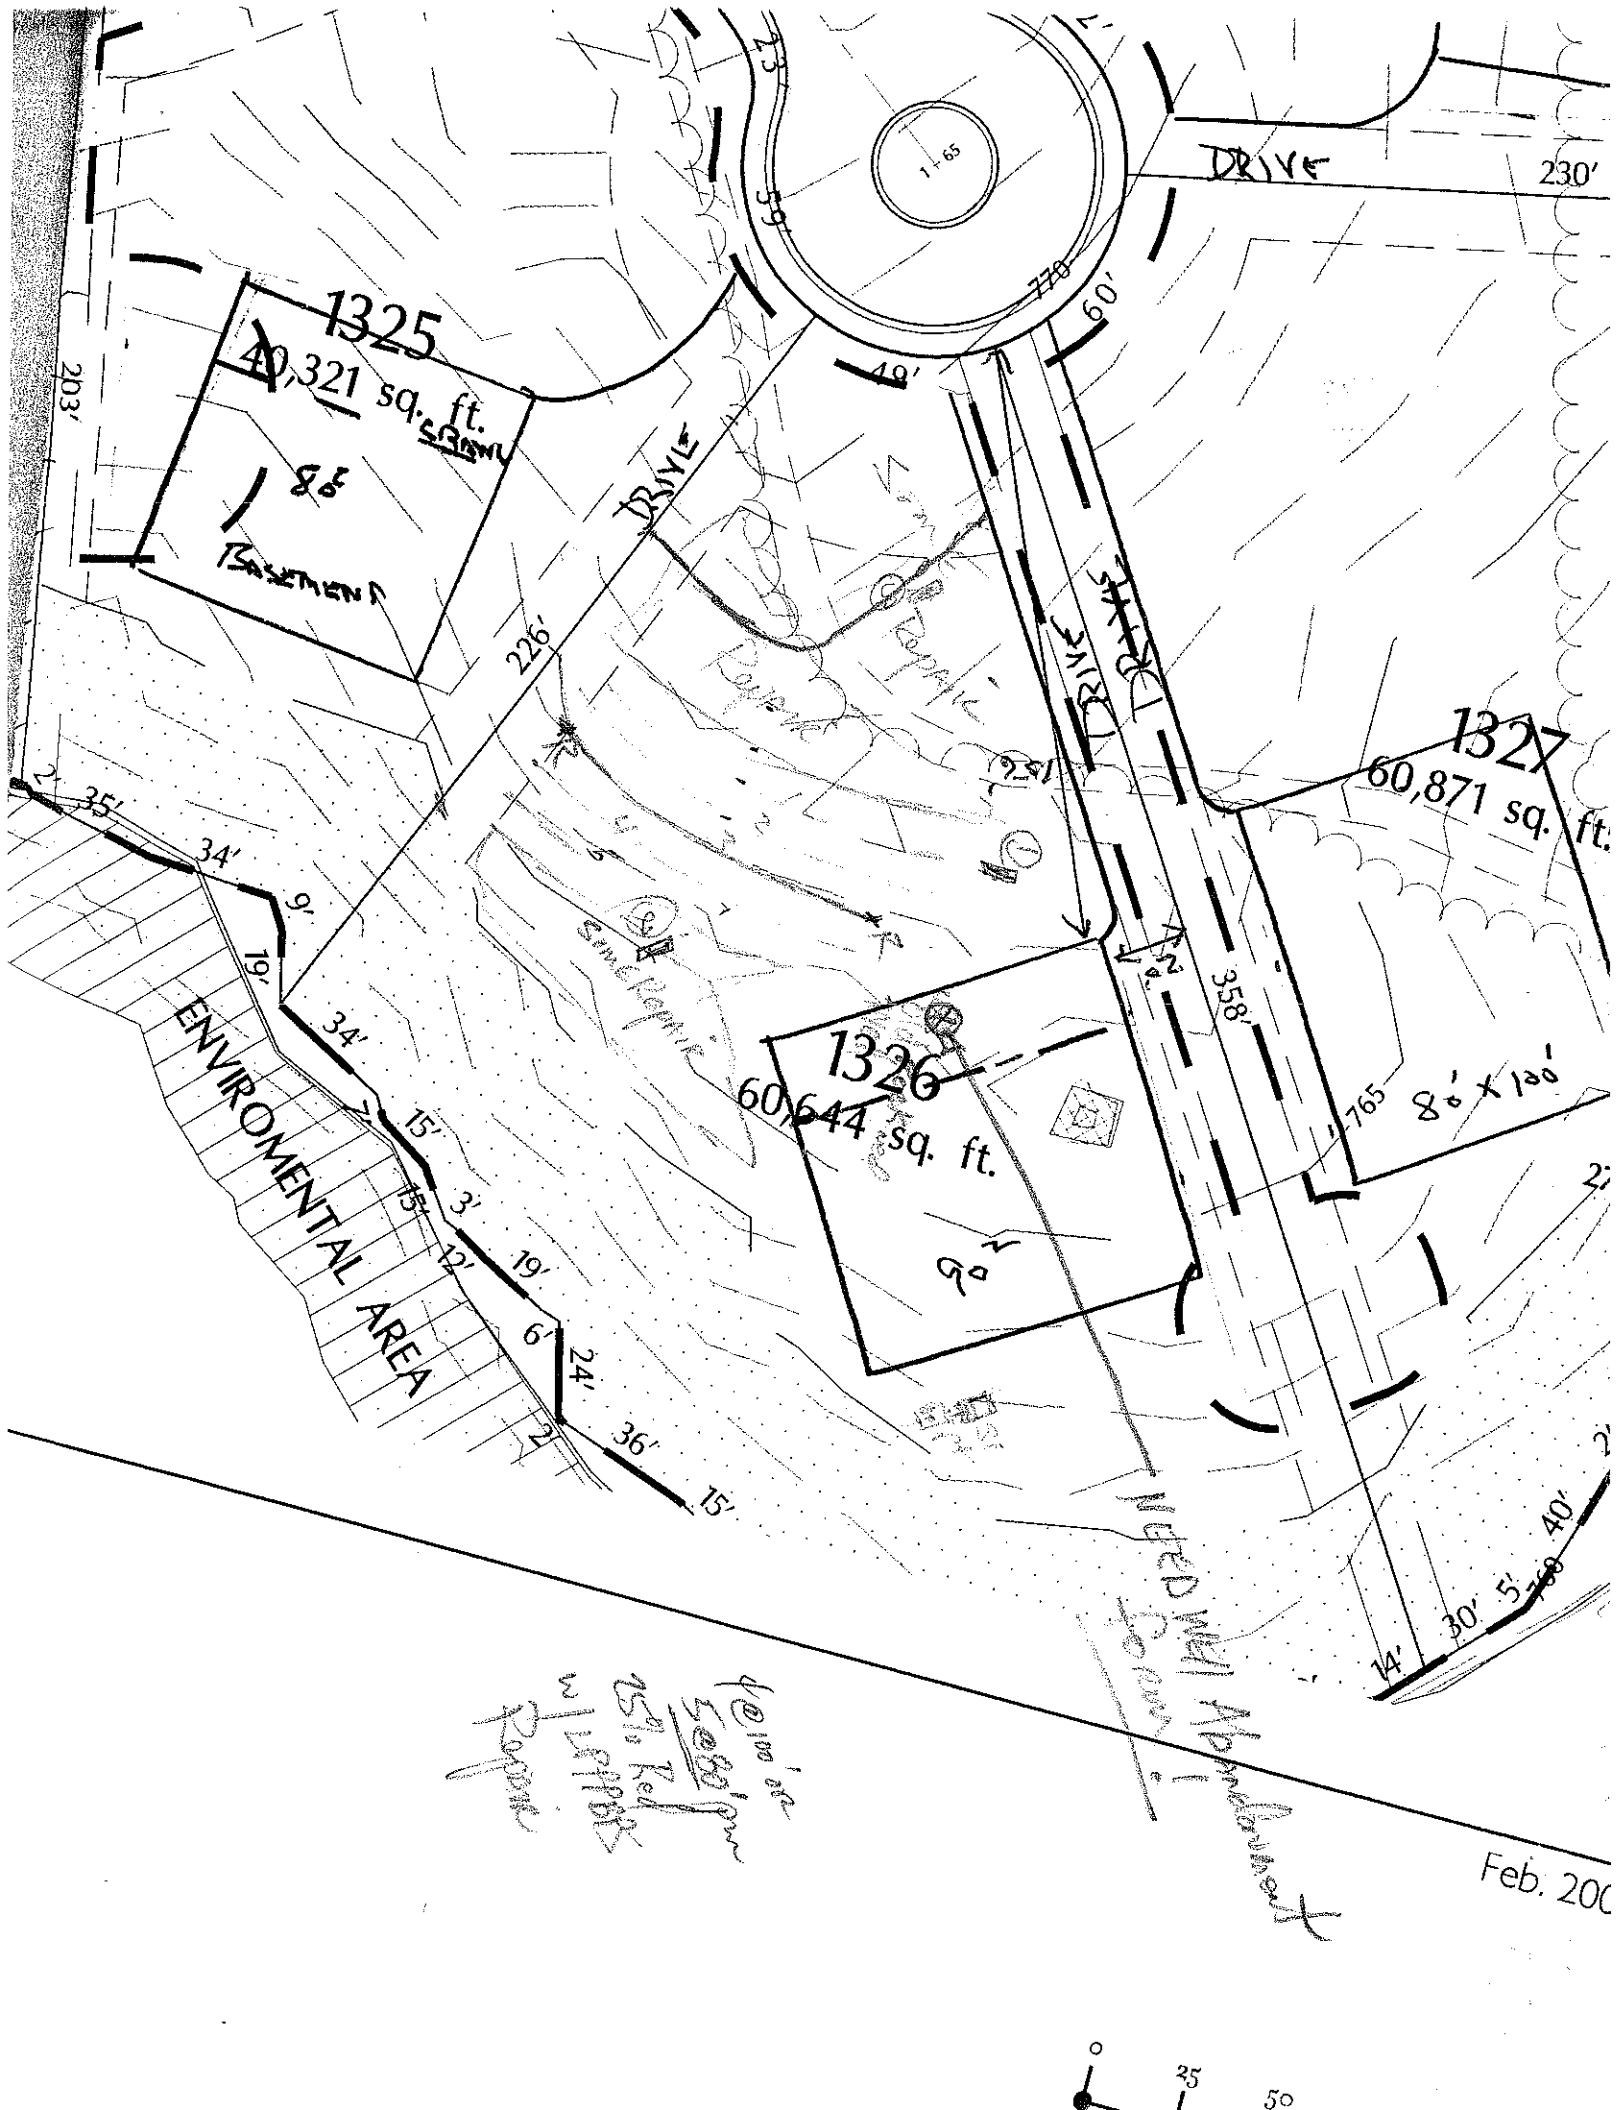
WNER: _____ APPLICATION DATE _____
DDRESS: _____ DATE EVALUATED: 3-4-04
ROPOSED FACILITY: _____ PROPOSED DESIGN FLOW (.1949): _____ PROPERTY SIZE: _____
OCATION OF SITE: Lot 1326 Ph 13 Tr 14 PROPERTY RECORDED: _____
ATER SUPPLY: ☐ Private ☐ Public ☑ Well ☐ Spring ☐ Other _____
VALUATION METHOD: ☐ Auger Boring ☐ Pit ☐ Cut
YPE OF WASTEWATER: ☐ Sewage ☐ Industrial Process ☐ Mixed

PROFILE #	.1940 LAND-SCAPE POSITION/ SLOPE %	HORI-ZON DEPTH (IN.)	SOIL MORPHOLOGY (.1941) .1941 STRUCTURE/ TEXTURE	SOIL MORPHOLOGY (.1941) .1941 CONSISTENCE/ MINERALOGY	OTHER PROFILE FACTORS .1942 SOIL WETNESS/ COLOR	.1943 SOIL DEPTH	.1956 SAPRO CLASS	.1944 RESTR HORIZ	PROFILE CLASS & LTAR
1		0-12	gr brk sl	fr sss p					.3
		12-50	m fgr blk RC	fr sss p sop					
2	4% ± V	0-10	wk sgr brk sl	slightly compacted fi LAY sss p					-3
		10-27	m fmsbk RC	fr sso p					
		27-41	wk fsbk scl	fr sss p					
		41-56	wk fsbk sy L	fr sss p common mi fgp					
3		0-10	wk fsbk brk sl	fr sss p					-3
		10-33	m fsbk RC	fr so p sop					
		33-53	m fsbk R c/l	fr sss p					
4									

DESCRIPTION	INITIAL SYSTEM	REPAIR SYSTEM
Available Space (.1945)	PS	PS
System Type(s)	Trad 25% Red	LPP 25%
Site LTAR	.3	.3

OTHER FACTORS (.1946): _____
SITE CLASSIFICATION (.1948): PS
EVALUATED BY: _____
OTHER(S) PRESENT: Paul Pennington

COMMENTS: _____


1325
40,321 sq. ft.
DRIVE
203'
226'
1327
60,871 sq. ft.
1326
60,644 sq. ft.
358'
765
8' x 130'
ENVIRONMENTAL AREA
35'
34'
9'
19'
15'
3'
12'
6'
24'
36'
15'
40'
30'
5'
14'
Feb. 200