N-SITE WASTEWATER SECTION

PROPERTY ID #: _____
COUNTY: _____

SOIL/SITE EVALUATION
for ON-SITE WASTEWATER SYSTEM

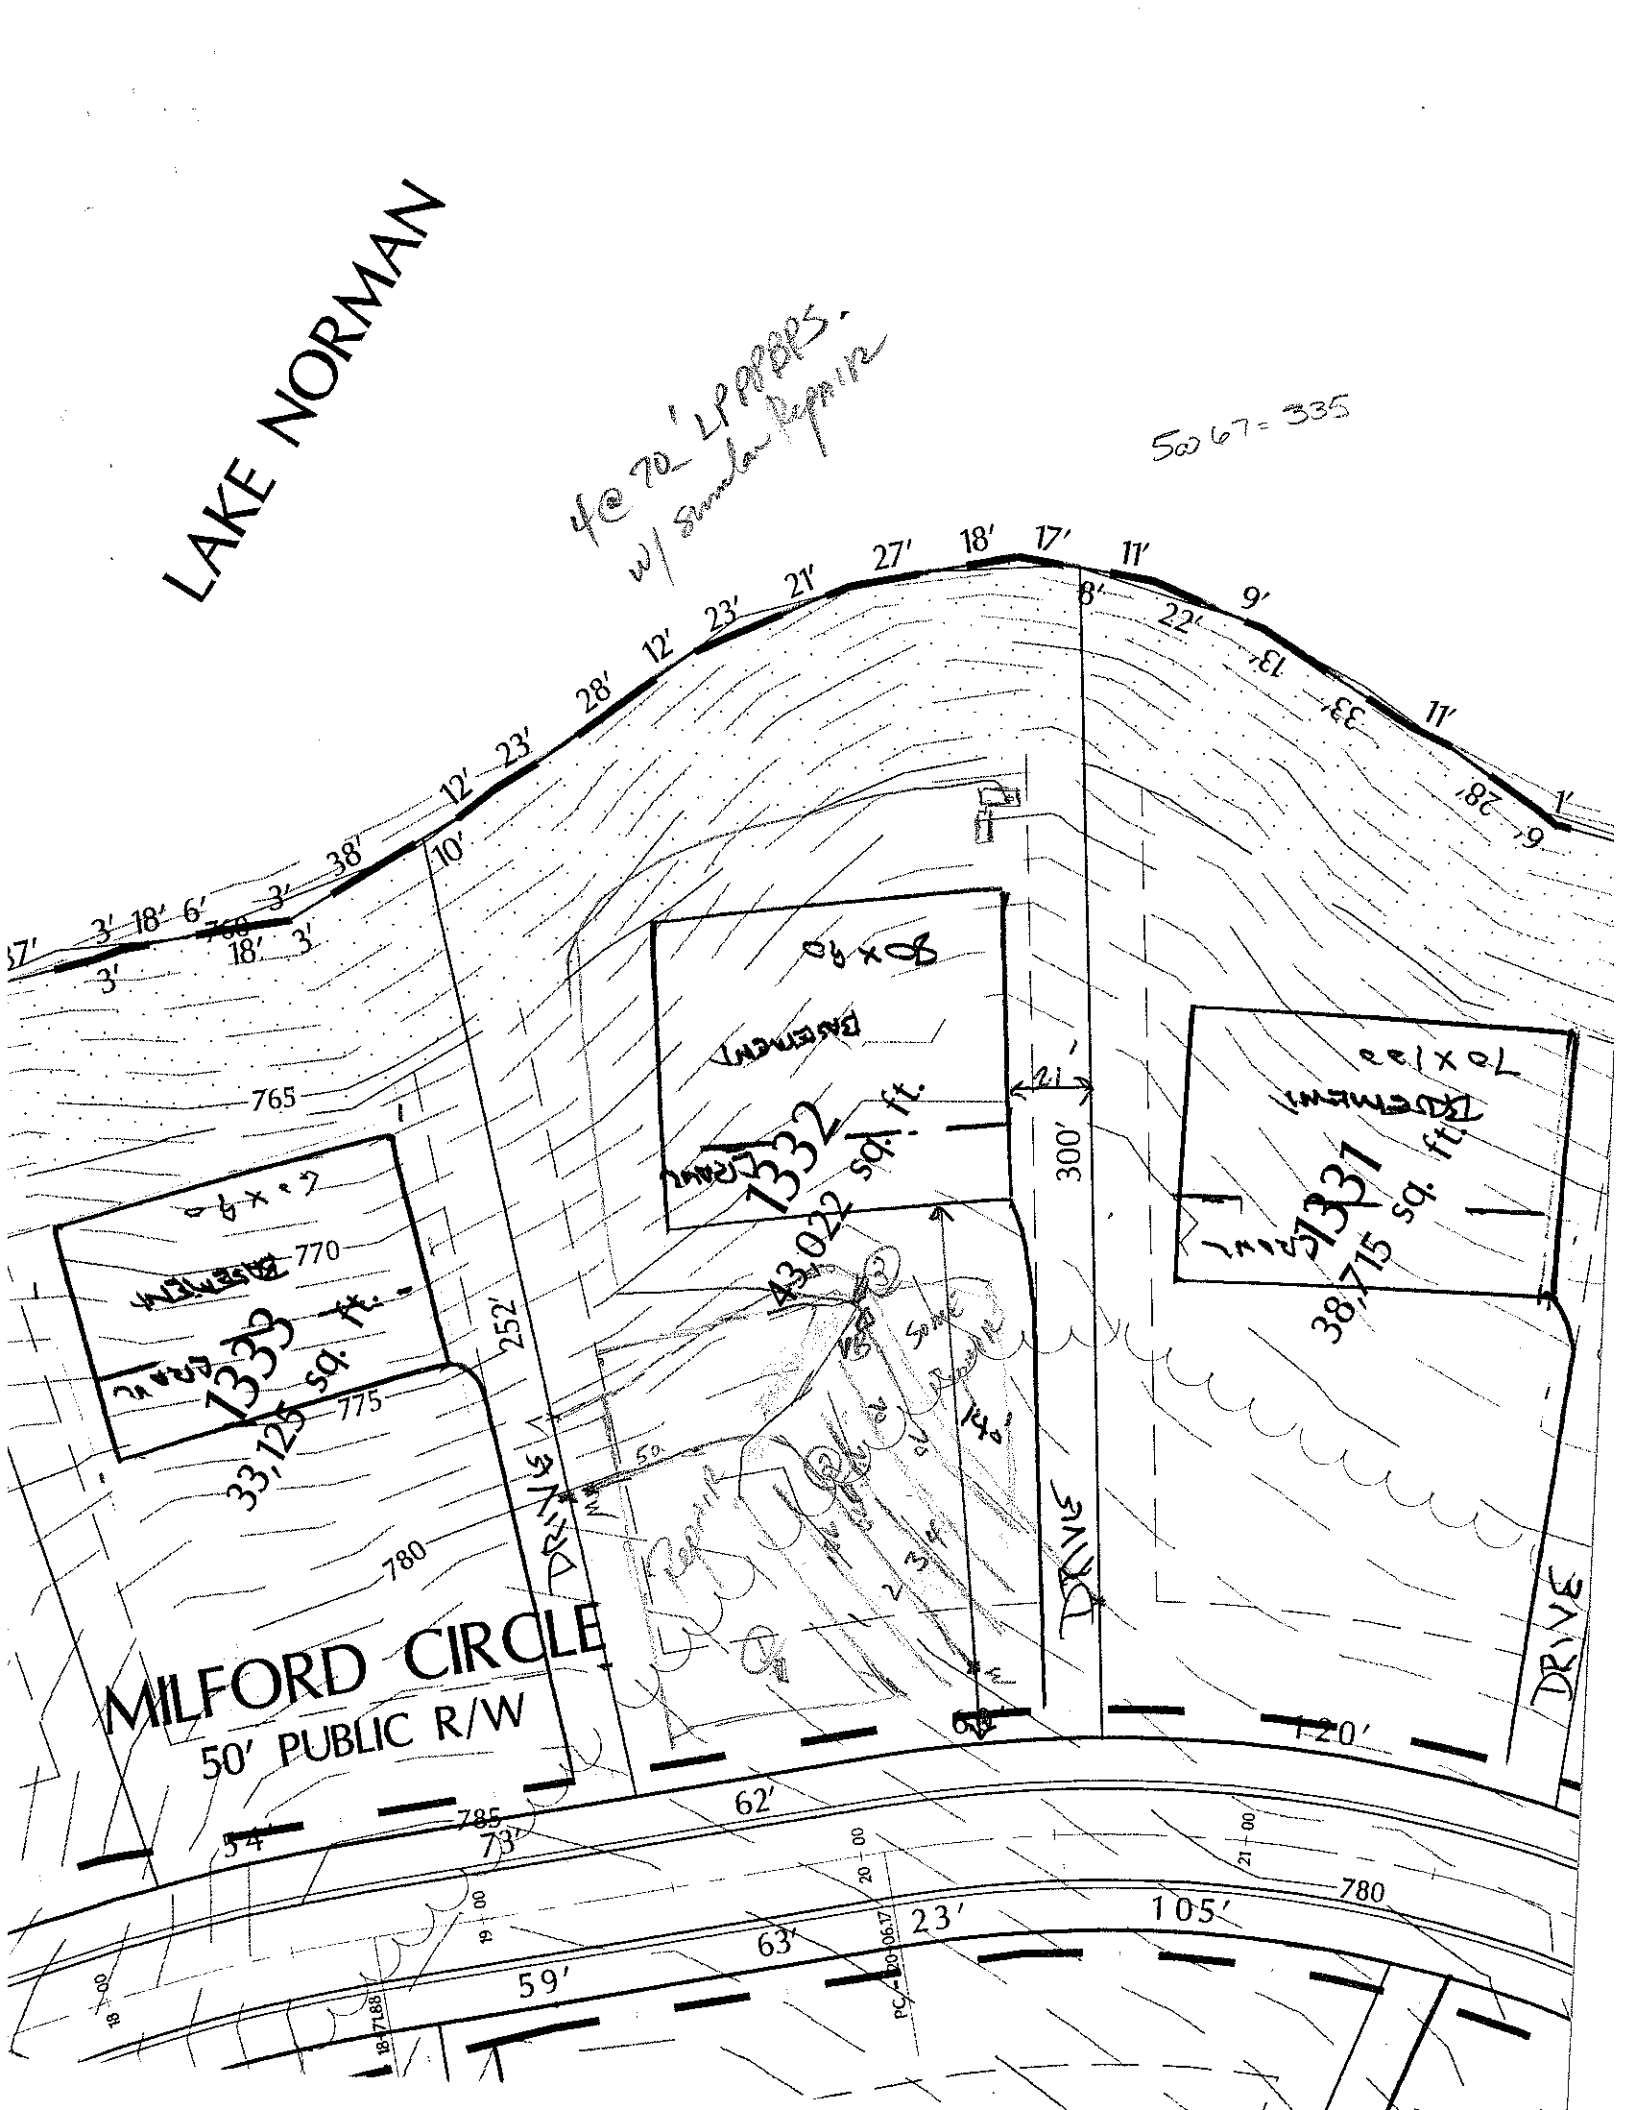
WNER: _____ APPLICATION DATE _____
DDRESS: _____
ROPOSED FACILITY: _____ PROPOSED DESIGN FLOW (.1949): 480 gpd DATE EVALUATED: 3-11-04
OCATION OF SITE: lot 133 adr 13 Tee Ct PROPERTY SIZE: _____
ATER SUPPLY: ☐ Private ☐ Public ☐ Well ☐ Spring ☐ Other _____ PROPERTY RECORDED: _____
VALUATION METHOD: ☐ Auger Boring ☐ Pit ☐ Cut
YPE OF WASTEWATER: ☐ Sewage ☐ Industrial Process ☐ Mixed

PROFILE #	.1940 LAND-SCAPE POSITION/ SLOPE %	HORI-ZON DEPTH (IN.)	SOIL MORPHOLOGY (.1941) .1941 STRUCTURE/ TEXTURE	.1941 CONSISTENCE/ MINERALOGY	OTHER PROFILE FACTORS .1942 SOIL WETNESS/ COLOR	.1943 SOIL DEPTH	.1956 SAPRO CLASS	.1944 RESTR HORIZ	PROFILE CLASS & LTAR
1		0-9	gr-wk sbk bnd sl fr ssso						.3
		9-21	mfsbk ecbd fr sssp sspl						
		21-48	wkfsbk gr e/l fr ssso common in sop						
2	5/0+ L	0-4	wkfsbk Rbrnd fr ssso						.3
		4-22	mfsbk R-rbrnc fr sposspo						
		22-44	wkfsbk Rbrnd fr ssso						
3		0-12	wkfsbk Rbrnd fr ssso						.3
		12-31	mfsbk Rc fr sso spo						
		31-58	wkfsbk yecl/L fr ssso few common in sop						
4									

DESCRIPTION	INITIAL SYSTEM	REPAIR SYSTEM
Available Space (.1945)	PS	RS
System Type(s)	LPPBDS	LPPBDS
Site LTAR	.3	.3

OTHER FACTORS (.1946): _____
SITE CLASSIFICATION (.1948): R
EVALUATED BY: DRH
OTHER(S) PRESENT: Paul Kennington

COMMENTS: _____


LAKE NORMAN
4@ 70' LPPRPS. w/ Similar Repair
50 67 = 335
MILFORD CIRCLE
50' PUBLIC R/W
1333 sq. ft.
33,125
1332 sq. ft.
43,022
1331 sq. ft.
38,715
DRIVE
765
770
775
780
785
252'
300'
120'
62'
105'
63'
59'
23'
73'
54'