DEPARTMENT OF ENVIRONMENT, HEALTH, AND NATURAL RESOURCES
DIVISION OF ENVIRONMENTAL HEALTH
ON-SITE WASTEWATER SECTION

Sheet ___ of ___
PROPERTY ID #: _____
COUNTY: _____

SOIL/SITE EVALUATION
for ON-SITE WASTEWATER SYSTEM

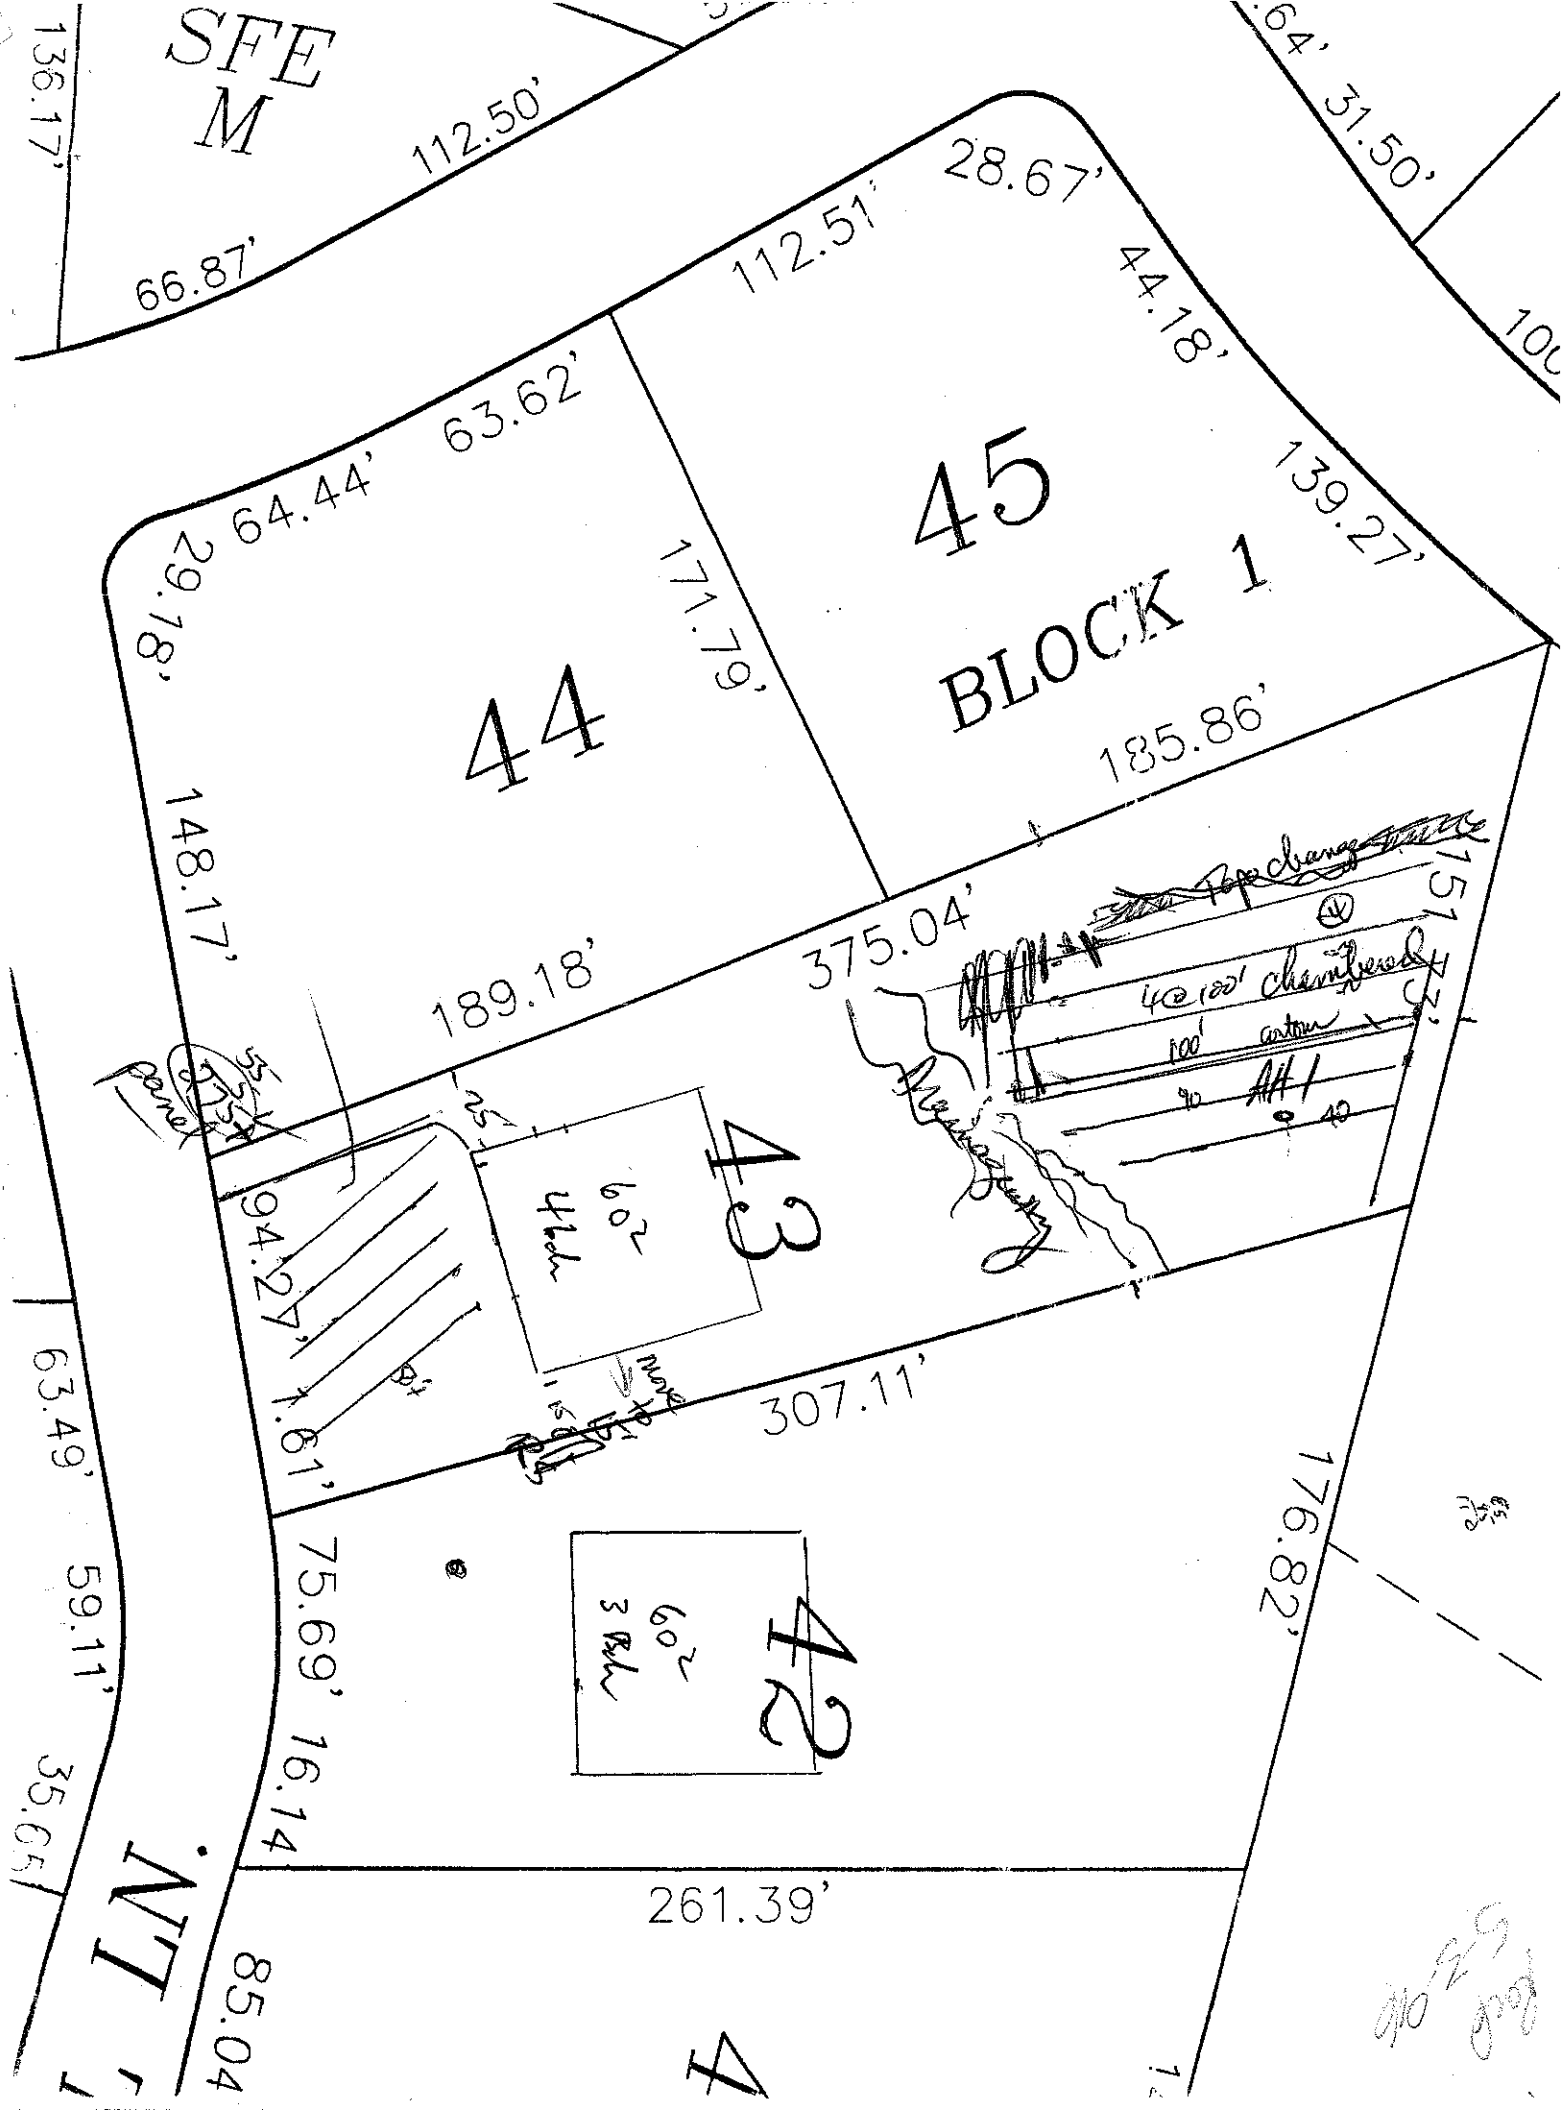
OWNER: CRT APPLICANT: _____
ADDRESS: _____ APPLICATION DATE: 480 gpd DATE EVALUATED: 5-8-96
PROPOSED FACILITY: Lot 43 PROPOSED DESIGN FLOW (.1949): _____ PROPERTY SIZE: _____
LOCATION OF SITE: Harbour Phase 3 PROPERTY RECORDED: _____
WATER SUPPLY: ☐ Private ☒ Public ☒ Well ☐ Spring ☐ Other _____
EVALUATION METHOD: ☒ Auger Boring ☐ Pit ☐ Cut
TYPE OF WASTEWATER: ☒ Sewage ☐ Industrial Process ☐ Mixed

PROFILE #	1940 LANDSCAPE POSITION/ SLOPE %	HORIZON DEPTH (IN.)	SOIL MORPHOLOGY (1941) 1941 STRUCTURE/ TEXTURE	SOIL MORPHOLOGY (1941) 1941 CONSISTENCE/ MINERALOGY	OTHER PROFILE FACTORS 1942 SOIL WETNESS/ COLOR	1943 SOIL DEPTH	1956 SAPRO CLASS	1944 RESTR HORIZ	PROFILE CLASS & LTAR
1	L 2%	0-4 6-23 23-48	gr SaL BR brwsL fr SaBk R Estuf fi,sp 1.1 SaBk RCL fr-fi,ss,sp 2.1 few med mottles 30"+						-3
2	L 2%	0-4 4-22 22-48	Rbrwsl fr SaBk RC fi,sp 1.1 MWK SaBk RCL fi,ss,sp 1.1 few red SAP						-3+
3									
4									

DESCRIPTION	INITIAL SYSTEM	REPAIR SYSTEM
Available Space (.1945)		
System Type(s)		
Site LTAR		

OTHER FACTORS (.1946): _____
SITE CLASSIFICATION (.1948): _____

EVALUATED BY: _____
OTHER(S) PRESENT: _____


SFE
M
112.50'
66.87'
112.51'
28.67'
44.18'
139.27'
63.62'
64.44'
29.18'
171.79'
45
BLOCK 1
185.86'
44
148.17'
189.18'
375.04'
151.42'
43
60'
41th
94.27'
1.61'
307.11'
63.49'
59.11'
35.05'
75.69'
16.14'
176.82'
42
60'
3 Rth
261.39'
85.04'
136.17'
31.50'