WASTEWATER SECTION

COUNTY: _____

SOIL/SITE EVALUATION
for ON-SITE WASTEWATER SYSTEM

NER: _____ APPLICATION DATE _____

DRESS: _____ DATE EVALUATED: _____

POSED FACILITY: _____ PROPOSED DESIGN FLOW (.1949): _____ PROPERTY SIZE: _____

ATION OF SITE: lot 322 Farms TH PROPERTY RECORDED: _____

TER SUPPLY: ☐ Private ☐ Public ☐ Well ☐ Spring ☐ Other _____

LUATION METHOD: ☐ Auger Boring ☐ Pit ☐ Cut

E OF WASTEWATER: ☐ Sewage ☐ Industrial Process ☐ Mixed

.1940 LAND-SCAPE POSITION/ SLOPE %	HORI-ZON DEPTH (IN.)	SOIL MORPHOLOGY (.1941) .1941 STRUCTURE/ TEXTURE	SOIL MORPHOLOGY (.1941) .1941 CONSISTENCE/ MINERALOGY	OTHER PROFILE FACTORS .1942 SOIL WETNESS/ COLOR	.1943 SOIL DEPTH	.1956 SAPRO CLASS	.1944 RESTR HORIZ	PROFILE CLASS & LTAR
	0-10	l GR	fri SSSP					.3 on east wall
	10-48	RC SBK	fri SSSP					or (4) on west wall
	Water	with Plank	Inc. - ¢ C/cl					
	0-7	BSCL ML	fri SSSP					.3
	7-48	RC SBK/MASS	fr. SSSP					
	0-22	SCL WSBK	fr. SSSP					.25-.3
	22-52	RBC SBK/MASS	fr. SP	Mn Inclusions - 22-40				

DESCRIPTION	INITIAL SYSTEM	REPAIR SYSTEM
ailable Space (.1945)		
stem Type(s)		

OTHER FACTORS (.1946): _____

SITE CLASSIFICATION (.1948): _____

EVALUATED BY: _____

OTHER(S) PRESENT: _____

MMENTS: _____

DEPARTMENT OF ENVIRONMENT AND NATURAL RESOURCES
DIVISION OF ENVIRONMENTAL HEALTH
ON-SITE WASTEWATER SECTION

Sheet ___ of ___
PROPERTY ID #: _____
COUNTY: _____

SOIL/SITE EVALUATION
for ON-SITE WASTEWATER SYSTEM

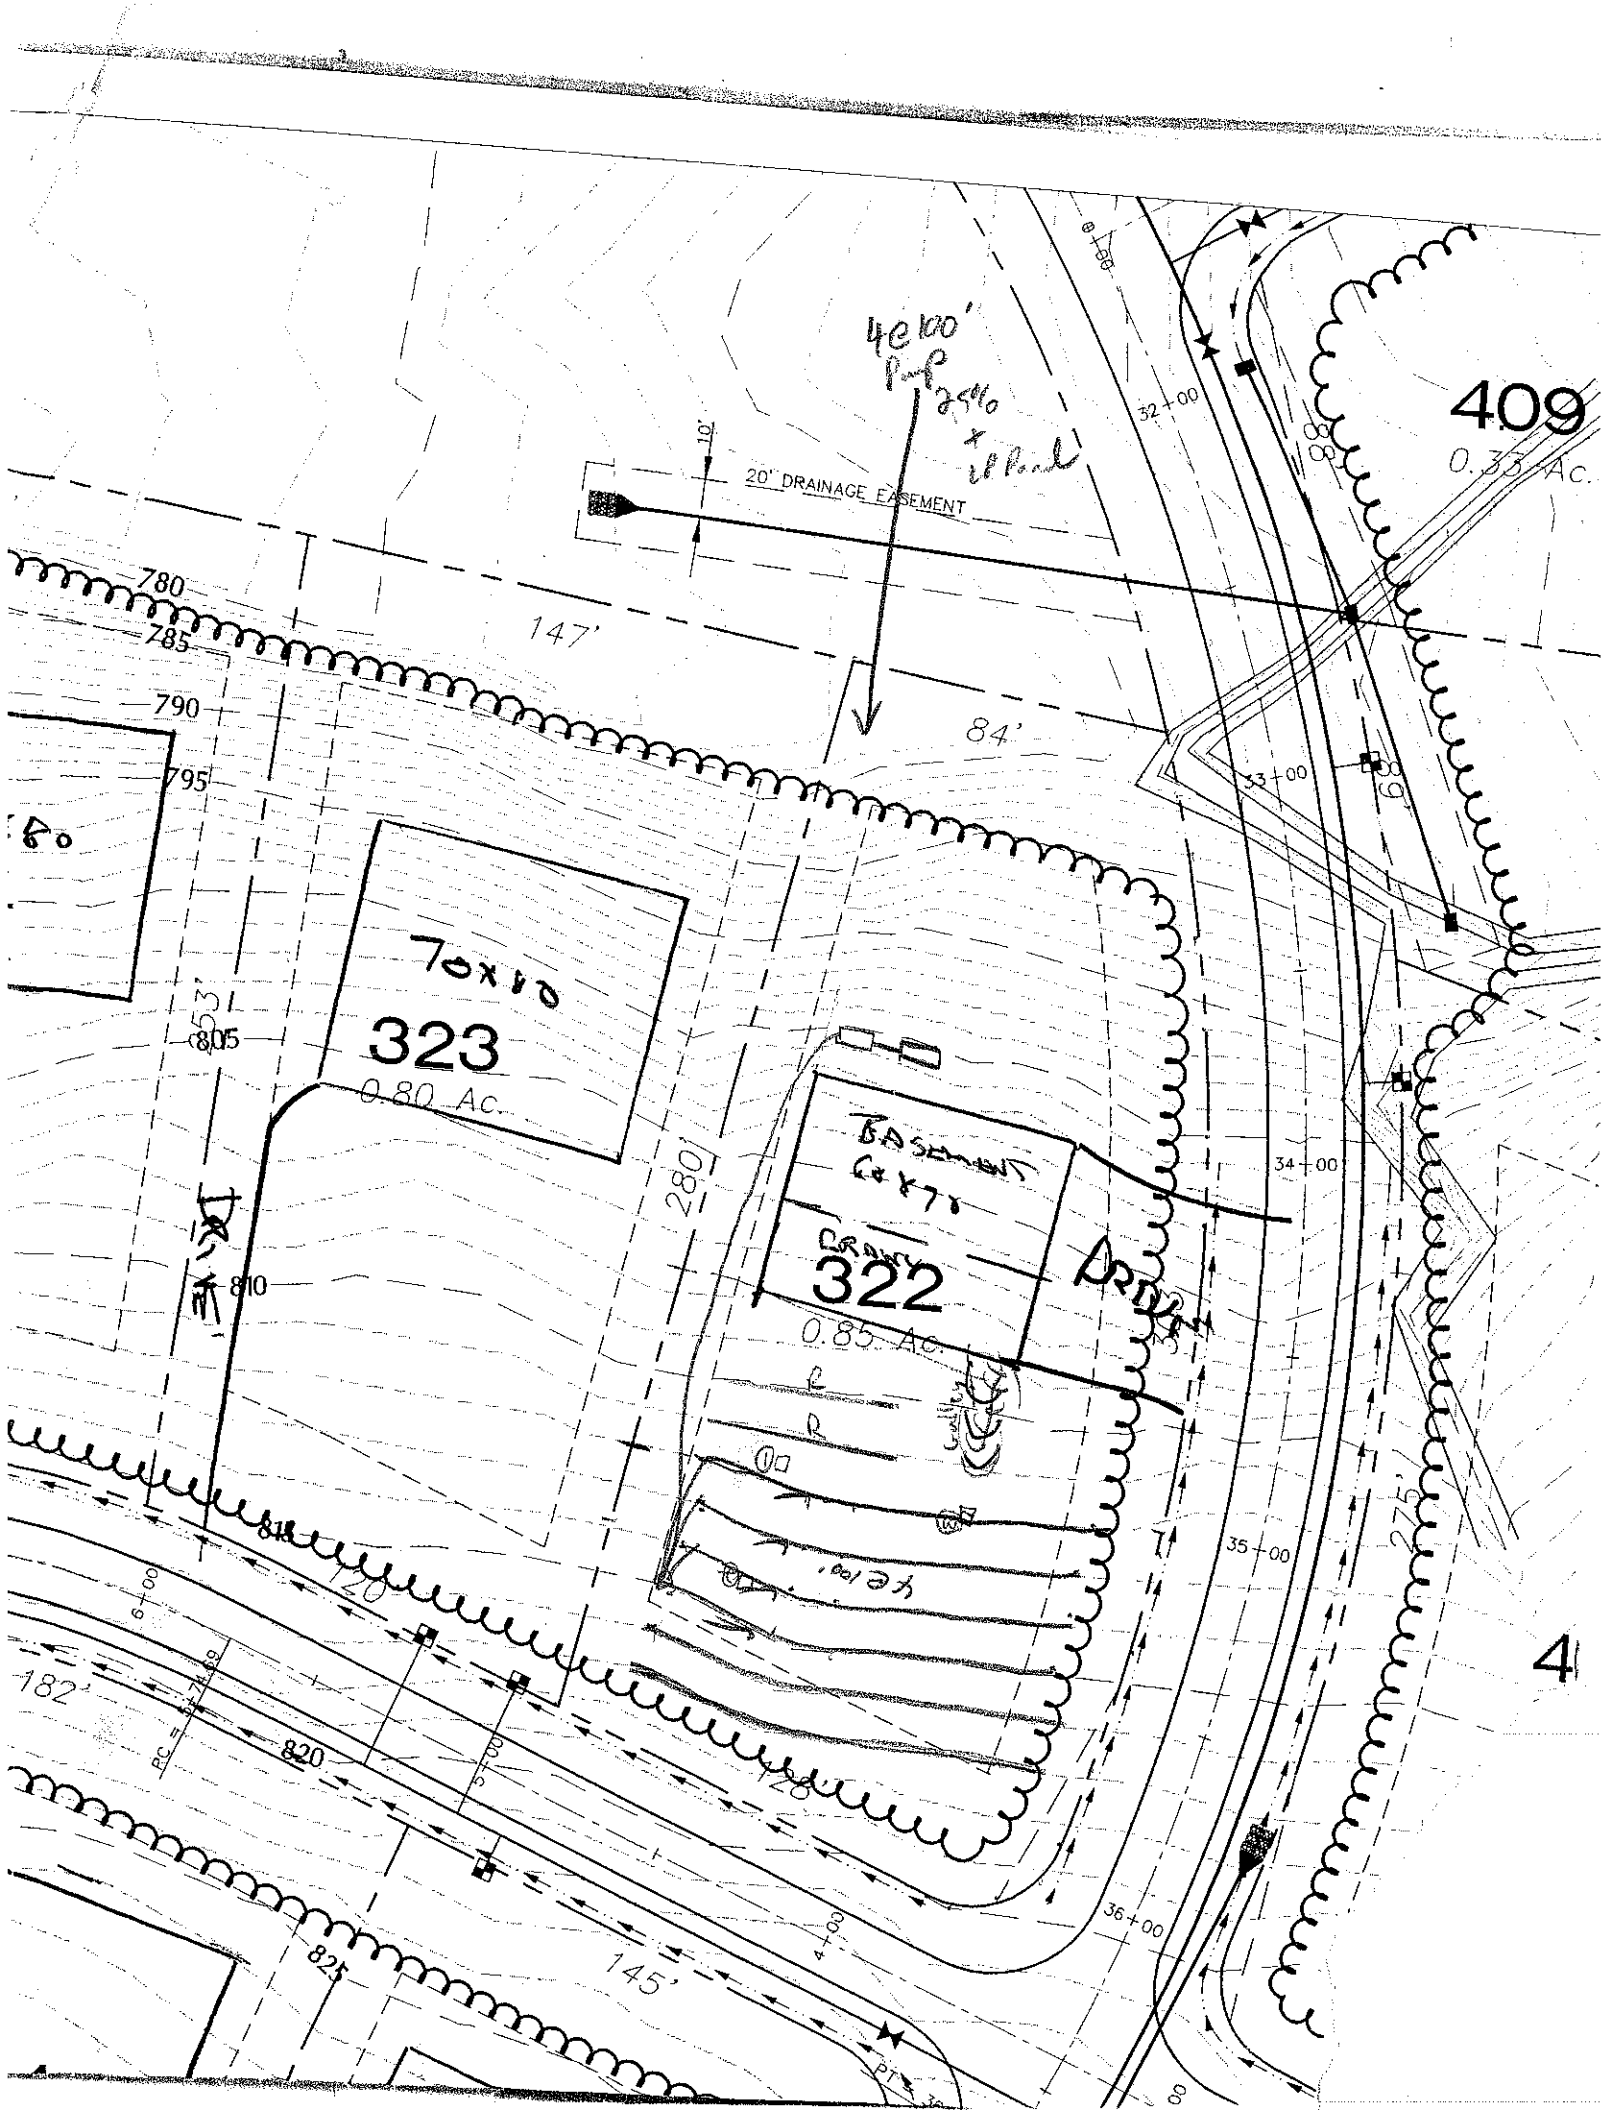
OWNER: Dave Rushing
ADDRESS: _____ APPLICATION DATE _____
PROPOSED FACILITY: _____ PROPOSED DESIGN FLOW (.1949): _____ DATE EVALUATED: 1-10-06
LOCATION OF SITE: The Farms 322 PROPERTY SIZE: _____
WATER SUPPLY: ☐ Private ☐ Public ☐ Well ☐ Spring ☐ Other _____ PROPERTY RECORDED: _____
EVALUATION METHOD: ☒ Auger Boring ☐ Pit ☐ Cut TYPE OF WASTEWATER: ☒ Sewage ☐ Industrial Process ☐ Mixed

PROFILE #	.1940 LANDSCAPE POSITION/ SLOPE %	HORIZON DEPTH (IN.)	SOIL MORPHOLOGY (.1941) .1941 STRUCTURE/ TEXTURE	SOIL MORPHOLOGY (.1941) .1941 CONSISTENCE/ MINERALOGY	OTHER PROFILE FACTORS .1942 SOIL WETNESS/ COLOR	.1943 SOIL DEPTH	.1956 SAPRO CLASS	.1944 RESTR HORIZ	PROFILE CLASS & LTAR
1	10' below house Initial system 8%	0-5	1s bk cl			48			PS .3
		5-30	1sbk c	cr ss/sp SE					
		30-38	1sbk cl						
		38-48	1sbk cl + sap						
2	Repair ~ 60' below house 20%	0-5	cl						PS .25
		5-20	1 abk/sbk c	fi	yellow brown mottles 10YR5/6				
		20-40	1 abk c	fi ss/sp SE					
3									
4									

DESCRIPTION	INITIAL SYSTEM	REPAIR SYSTEM
Available Space (.1945)		
System Type(s)		
Site LTAR		

OTHER FACTORS (.1946): _____
SITE CLASSIFICATION (.1948): _____
EVALUATED BY: _____
OTHER(S) PRESENT: _____

COMMENTS: _____


20' DRAINAGE EASEMENT
409
0.33 Ac.
323
0.80 Ac.
322
0.85 Ac.
147'
84'
280'
780
785
790
795
805
810
820
825
32+00
33+00
34+00
35+00
36+00
182'
145'