DEPARTMENT OF ENVIRONMENT, HEALTH, AND NATURAL RESOURCES
DIVISION OF ENVIRONMENTAL HEALTH
ON-SITE WASTEWATER SECTION

Sheet ___ of ___
PROPERTY ID #: ___
COUNTY: ___

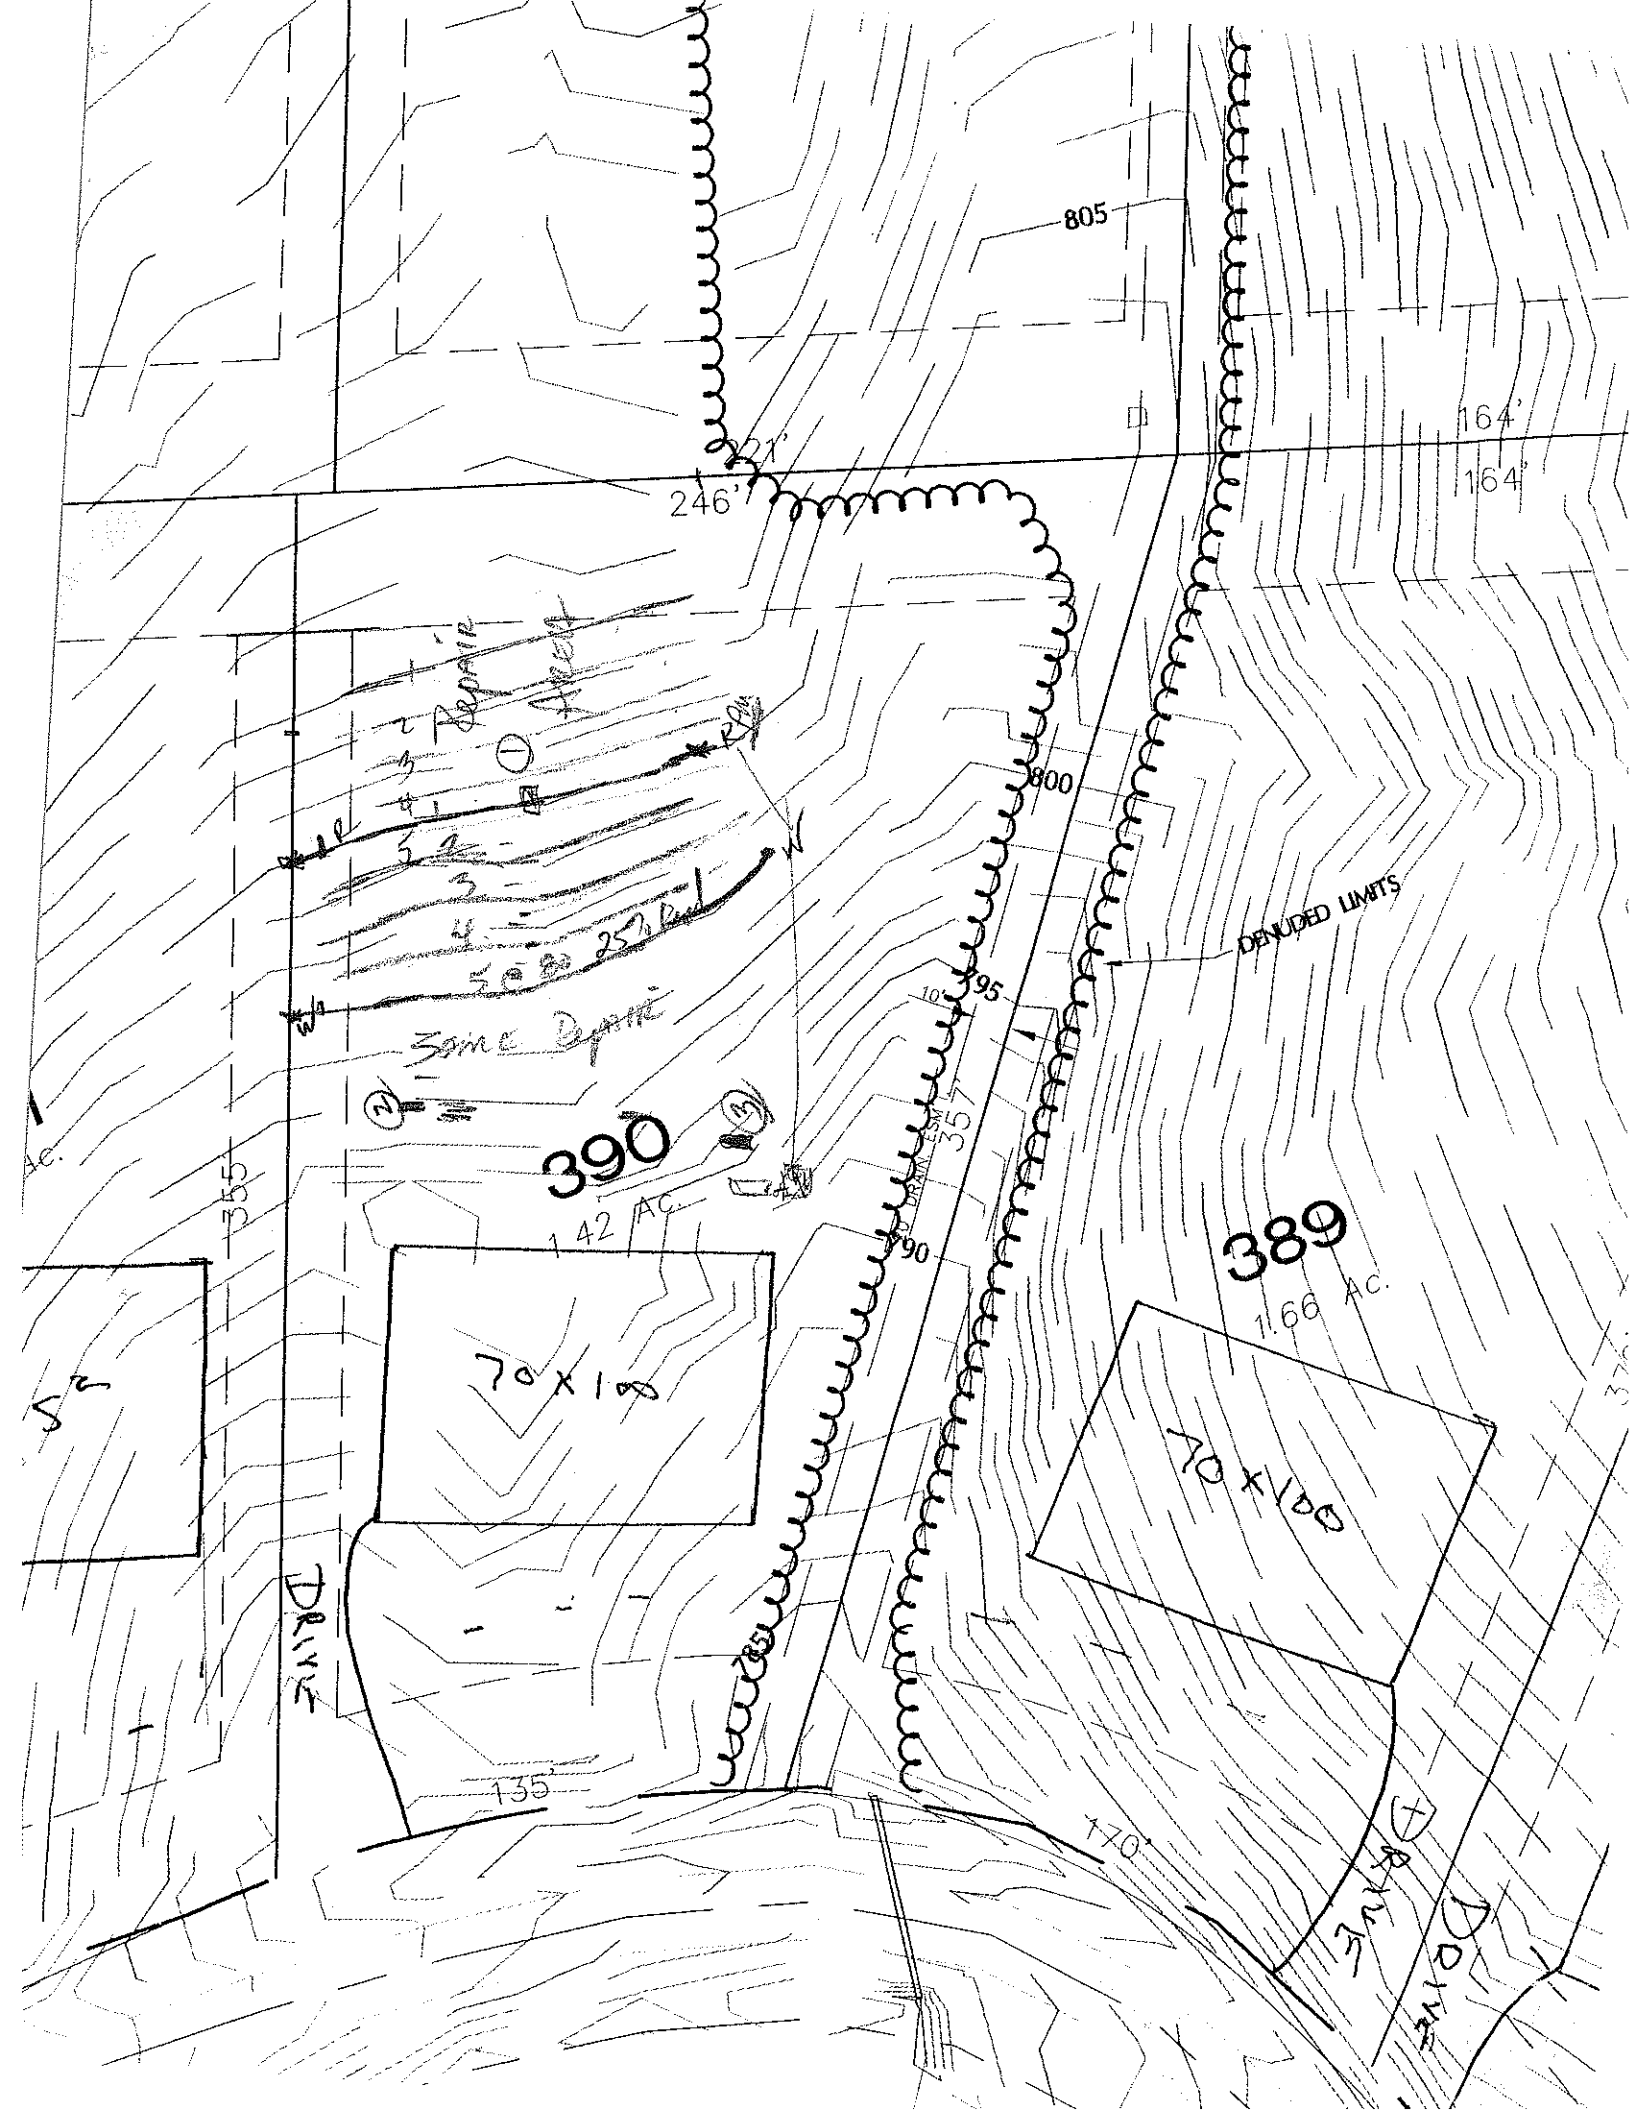
SOIL/SITE EVALUATION
for ON-SITE WASTEWATER SYSTEM

OWNER: The Farms LLC APPLICANT: ___
ADDRESS: ___ APPLICATION DATE: ___ DATE EVALUATED: 2-8-05
PROPOSED FACILITY: SFR PROPOSED DESIGN FLOW (.1949): 480 gpd PROPERTY SIZE: ___
LOCATION OF SITE: lot 390 The Farms PROPERTY RECORDED: ___
WATER SUPPLY: ☐ Private ☒ Public ☒ Well ☐ Spring ☐ Other ___
EVALUATION METHOD: ☐ Auger Boring ☒ Pit ☐ Cut
TYPE OF WASTEWATER: ☒ Sewage ☐ Industrial Process ☐ Mixed

PROFILE #	.1940 LANDSCAPE POSITION/ SLOPE %	HORIZON DEPTH (IN.)	SOIL MORPHOLOGY (.1941) .1941 STRUCTURE/ TEXTURE	SOIL MORPHOLOGY (.1941) .1941 CONSISTENCE/ MINERALOGY	OTHER PROFILE FACTORS .1942 SOIL WETNESS/ COLOR	.1943 SOIL DEPTH	.1956 SAPRO CLASS	.1944 RESTR HORIZ	PROFILE CLASS & LTAR
1	P/O L	0-11	wkSBk scl	fr SSSP					.3
		11-47	mSBk/abk c	fr SSSP					
		47-60	wkSBk cl	fr SSSP few manganese coatings					
2		0-13	wkSBk sicl cl	fr SSSP					.3
		13-48	MASBk RC	fr sp SSSP	SEP				
3		0-4	mgr scl	fr SSSP					.3
		4-35	mSBk cl	fr SSSP few med SAP			PS 35"+		
		35-51	massive LSAP	fr SSSP					
4									

DESCRIPTION	INITIAL SYSTEM	REPAIR SYSTEM
Available Space (.1945)	PS	PS
System Type(s)	pm 25% Red	LPPPBBS
Site LTAR	.3	.3

OTHER FACTORS (.1946): ___
SITE CLASSIFICATION (.1948): PS
EVALUATED BY: DHamm
OTHER(S) PRESENT: Kathleen J TCJ + Assoc


805
221'
246'
164'
164'
800
795
DENUDED LIMITS
390
1.42 AC.
389
1.66 AC.
70 x 100
70 x 100
355
357
135'
170'
Septic