DEPARTMENT OF ENVIRONMENT, HEALTH, AND NATURAL RESOURCES
DIVISION OF ENVIRONMENTAL HEALTH
ON-SITE WASTEWATER SECTION

Sheet ___ of ___
PROPERTY ID #: _____
COUNTY: _____

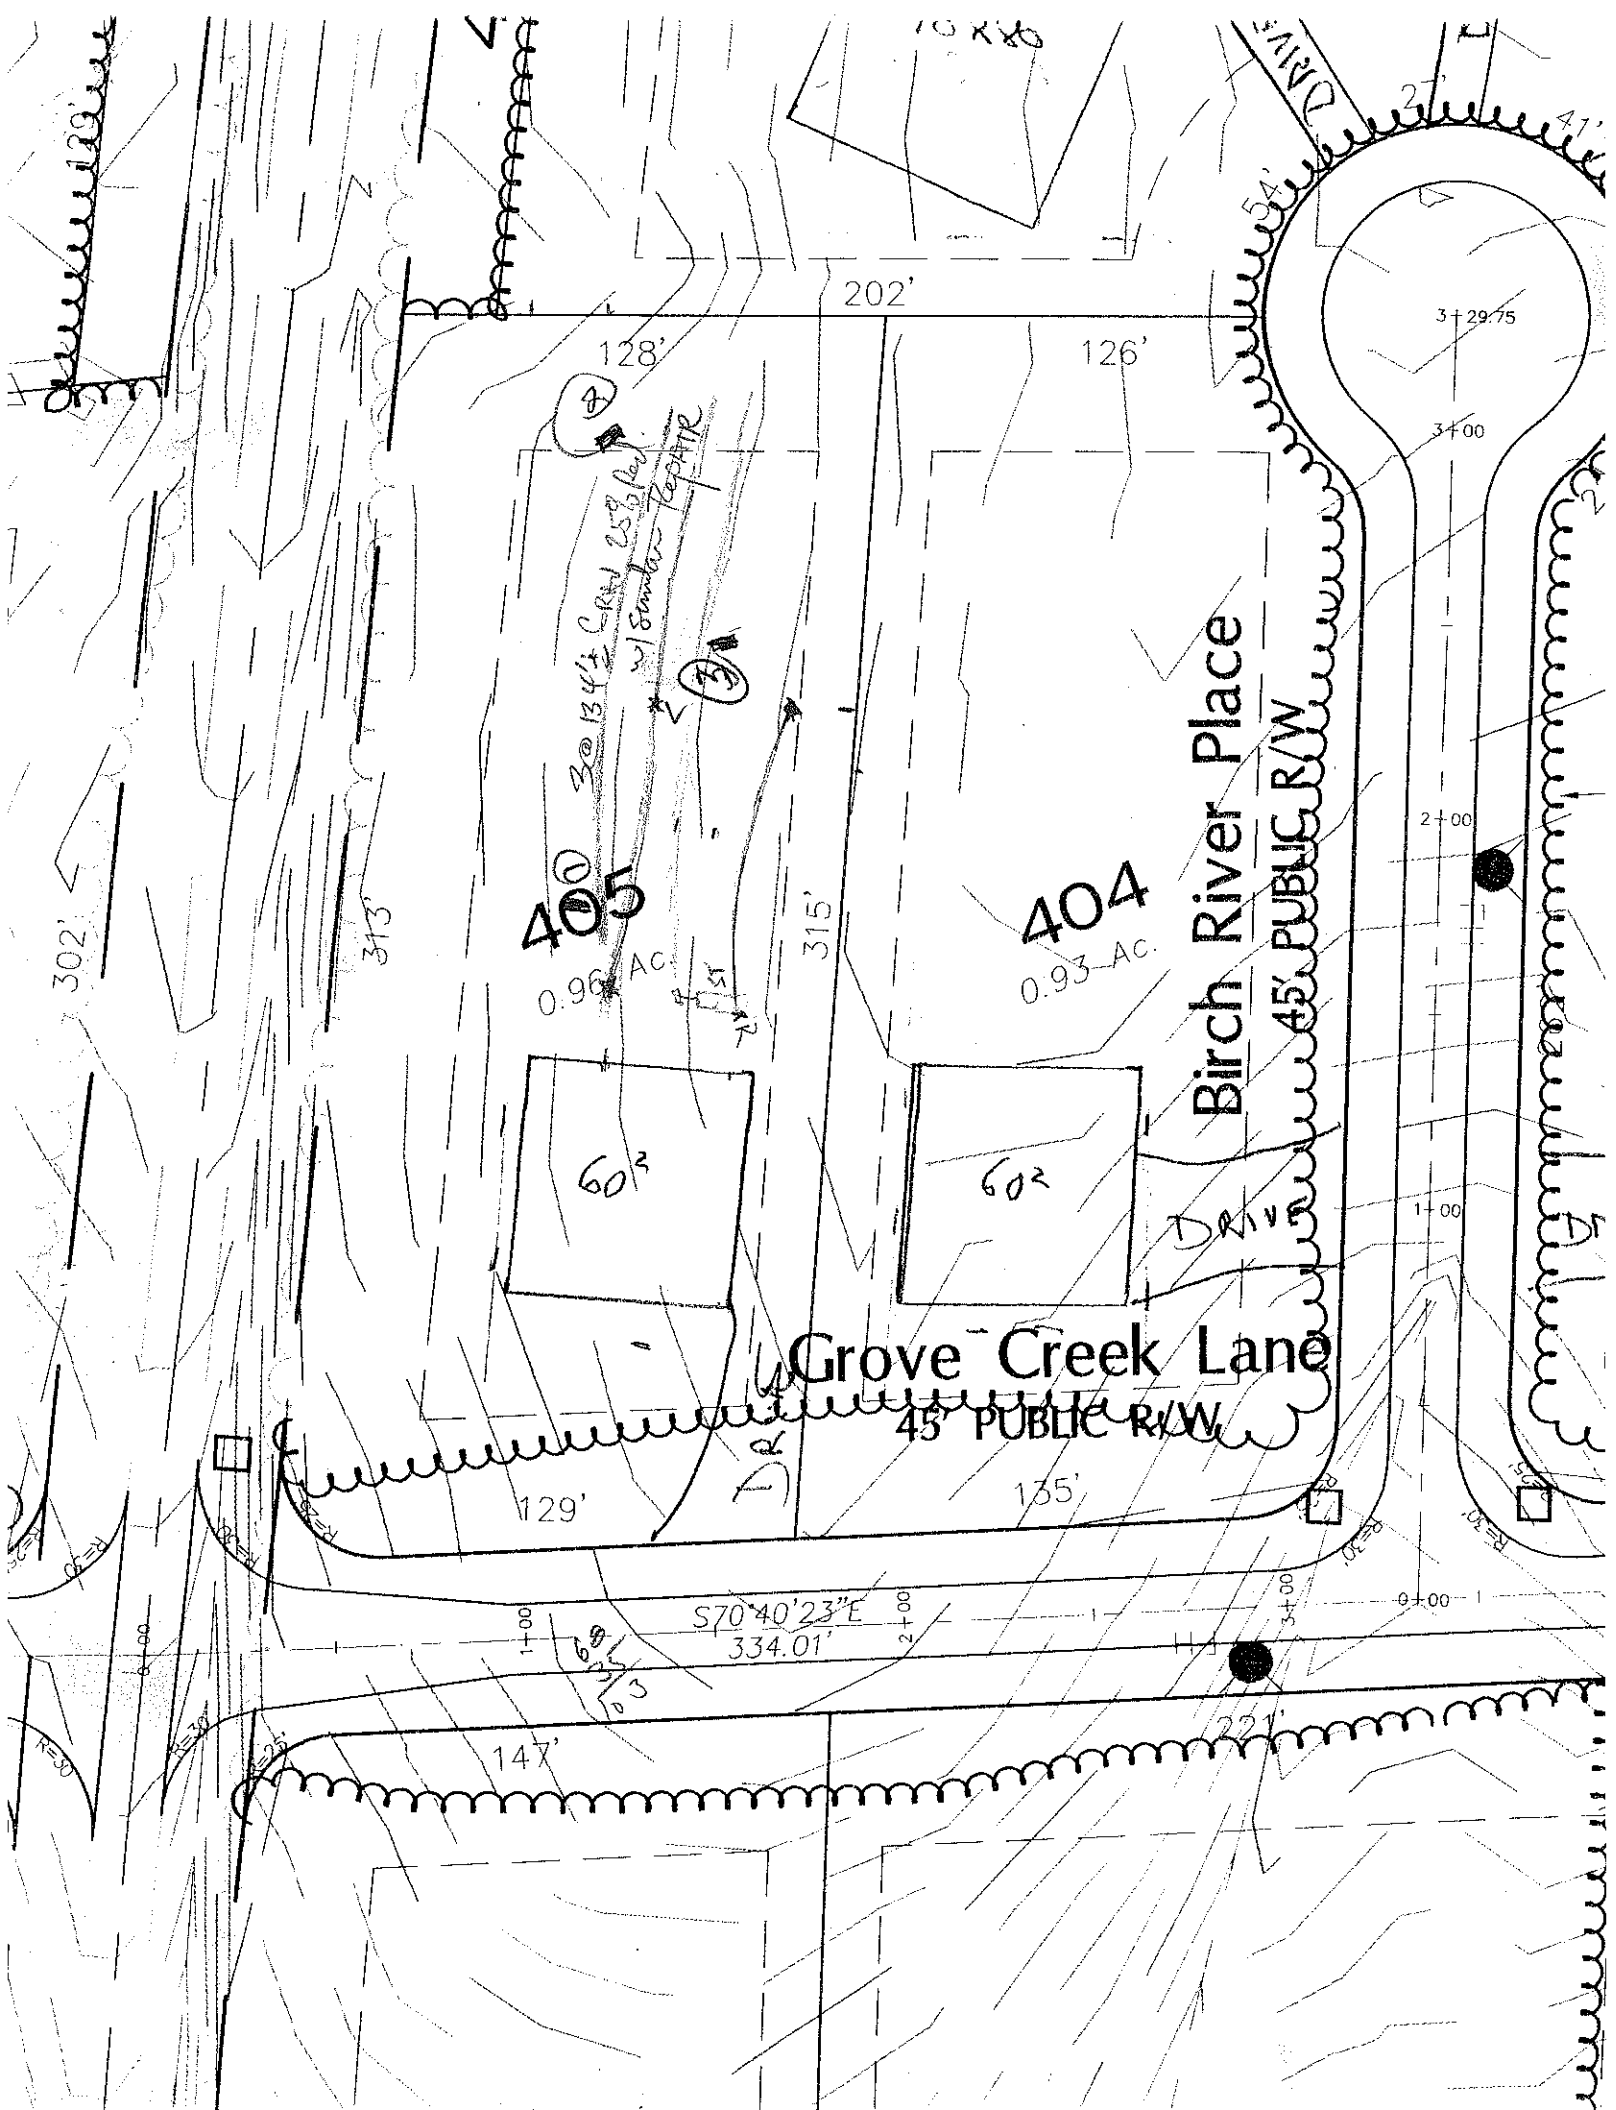
SOIL/SITE EVALUATION
for ON-SITE WASTEWATER SYSTEM

OWNER: The Farms LLC APPLICANT: _____
ADDRESS: _____ APPLICATION DATE: _____ DATE EVALUATED: 2-7-05
PROPOSED FACILITY: STR PROPOSED DESIGN FLOW (.1949): 480 gpd PROPERTY SIZE: _____
LOCATION OF SITE: lot 405 The Farms PROPERTY RECORDED: _____
WATER SUPPLY: ☐ Private ☒ Public ☐ Well ☐ Spring ☐ Other _____
EVALUATION METHOD: ☐ Auger Boring ☒ Pit ☐ Cut
TYPE OF WASTEWATER: ☒ Sewage ☐ Industrial Process ☐ Mixed

PROFILE #	.1940 LANDSCAPE POSITION/ SLOPE %	HORIZON DEPTH (IN.)	SOIL MORPHOLOGY (.1941) .1941 STRUCTURE/ TEXTURE	SOIL MORPHOLOGY (.1941) .1941 CONSISTENCE/ MINERALOGY	OTHER PROFILE FACTORS .1942 SOIL WETNESS/ COLOR	.1943 SOIL DEPTH	.1956 SAPRO CLASS	.1944 RESTR HORIZ	PROFILE CLASS & LTAR
1	SW 5	0-4	wk sbk scl	fr ss sp					.3
		4-30	wk sbk rc	fr ss sp so po					
		30-48	wk sbk gr cl	fr ss sp					
2		0-5	wk sbk sdy scl	fr ss sp					.3
		5-32	wk sbk rc	fr ss sp so po					
		32-48	wk sbk gr cl	fr ss sp					
3		0-4	wk sbk sdy scl	fr ss sp					.3
		4-32	wk sbk rc	fr ss sp so po					
		32-48	wk sbk gr cl	fr ss sp					
4									

DESCRIPTION	INITIAL SYSTEM	REPAIR SYSTEM
Available Space (.1945)	5	5
System Type(s)	Conv 12" Bed	Conv 12" Bed
Site LTAR	.3	.3

OTHER FACTORS (.1946): _____
SITE CLASSIFICATION (.1948): SR
EVALUATED BY: _____
OTHER(S) PRESENT: _____


202'
128'
126'
3+29.75
3+00
2+00
1+00
0+00
405
0.96 AC.
404
0.93 AC.
313'
315'
302'
60'
60'
Birch River Place
45' PUBLIC R/W
Grove Creek Lane
45' PUBLIC R/W
129'
135'
S70°40'23"E
334.01'
147'
221'
DRIVE