DEPARTMENT OF ENVIRONMENT, HEALTH, AND NATURAL RESOURCES
DIVISION OF ENVIRONMENTAL HEALTH
ON-SITE WASTEWATER SECTION

Sheet ___ of ___
PROPERTY ID #: ___
COUNTY: ___

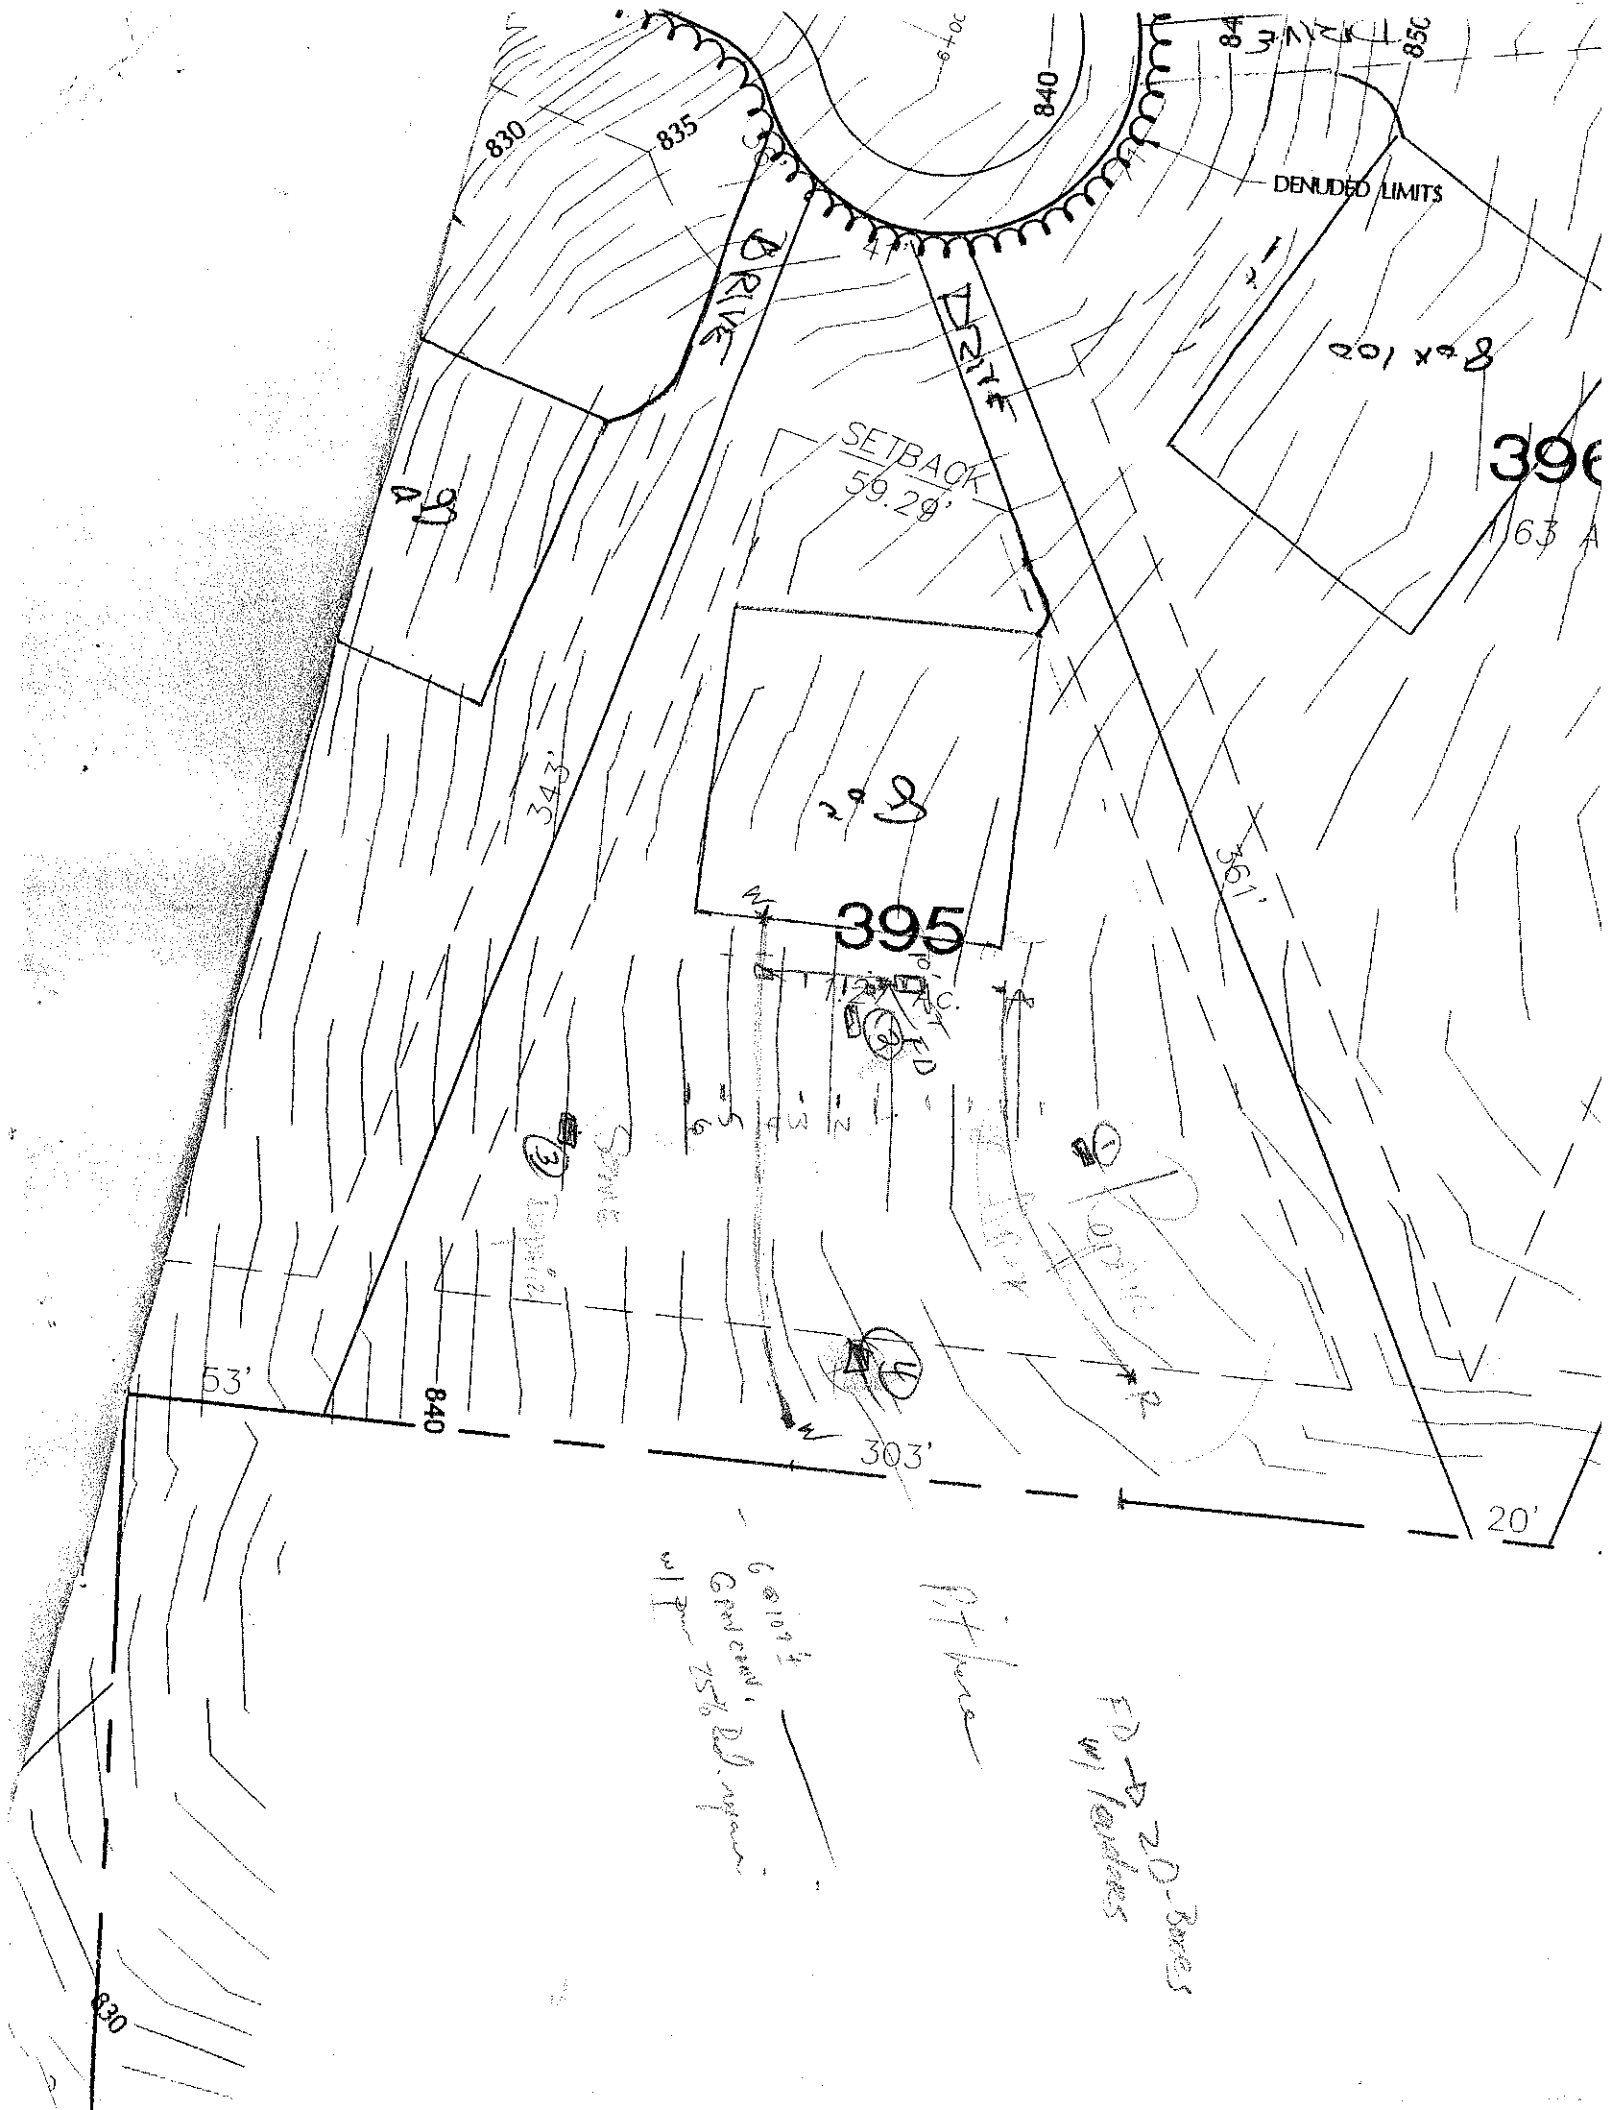
SOIL/SITE EVALUATION
for ON-SITE WASTEWATER SYSTEM

OWNER: The Farms LLC APPLICANT: ___
ADDRESS: ___ APPLICATION DATE: ___ DATE EVALUATED: 2-8-05
PROPOSED FACILITY: SFR PROPOSED DESIGN FLOW (.1949): 480 gpd PROPERTY SIZE: ___
LOCATION OF SITE: Lot 395 The Farms PROPERTY RECORDED: ___
WATER SUPPLY: ☐ Private ☒ Public ☒ Well ☐ Spring ☐ Other ___
EVALUATION METHOD: ☐ Auger Boring ☒ Pit ☐ Cut
TYPE OF WASTEWATER: ☒ Sewage ☐ Industrial Process ☐ Mixed

PROFILE #	.1940 LANDSCAPE POSITION/ SLOPE %	HORIZON DEPTH (IN.)	SOIL MORPHOLOGY (.1941) .1941 STRUCTURE/ TEXTURE	.1941 CONSISTENCE/ MINERALOGY	OTHER PROFILE FACTORS .1942 SOIL WETNESS/ COLOR	.1943 SOIL DEPTH	.1956 SAPRO CLASS	.1944 RESTR HORIZ	PROFILE CLASS & LTAR
1	0% 5% V	0-3	msgr scl	fr sssp					
		3-33	msbk rc	fr sssp ssp	few ind sap & y. w. rock				.25
		33-54	wk sbk cl	fr ssp	common - many ind ssp & y. w. rock				
2	10% V	0-10	wk sbk lam scl	fr sssp					
		10-28	msbk fri c	fr sp-sssp ssp					.25
		28-48	wk-msbk rcl	fr sssp	common - many ind y. w. rock ssp				
3		0-7	wk sbk lam scl	fr sssp					
		7-48	msbk rc	fr sssp ssp	many ind ssp & y. w. rock 324				.25
4	S. West Wall	0-5	gr lam scl	fr sssp					
		5-19	msbk fri c	fr sp sssp					.25
		19-49	wk sbk cl	fr sssp	few-common ind ssp & y. w. rock				
		Dist Well	many w. rock 2411 +		pit predominately soil				

DESCRIPTION	INITIAL SYSTEM	REPAIR SYSTEM
Available Space (.1945)	PS	PS
System Type(s)	CONV.	CONV/pumped 25%
Site LTAR	.25	.25

OTHER FACTORS (.1946): ___
SITE CLASSIFICATION (.1948): PS
EVALUATED BY: [signature]
OTHER(S) PRESENT: ___


830
835
840
DENUDED LIMITS
SETBACK
59.29'
343'
395
361'
53'
303'
20'
840
830