DEPARTMENT OF ENVIRONMENT AND NATURAL RESOURCES
DIVISION OF ENVIRONMENTAL HEALTH
ON-SITE WASTEWATER SECTION

Sheet ___
PROPERTY ID #: ____
COUNTY: ____

SOIL/SITE EVALUATION
for ON-SITE WASTEWATER SYSTEM

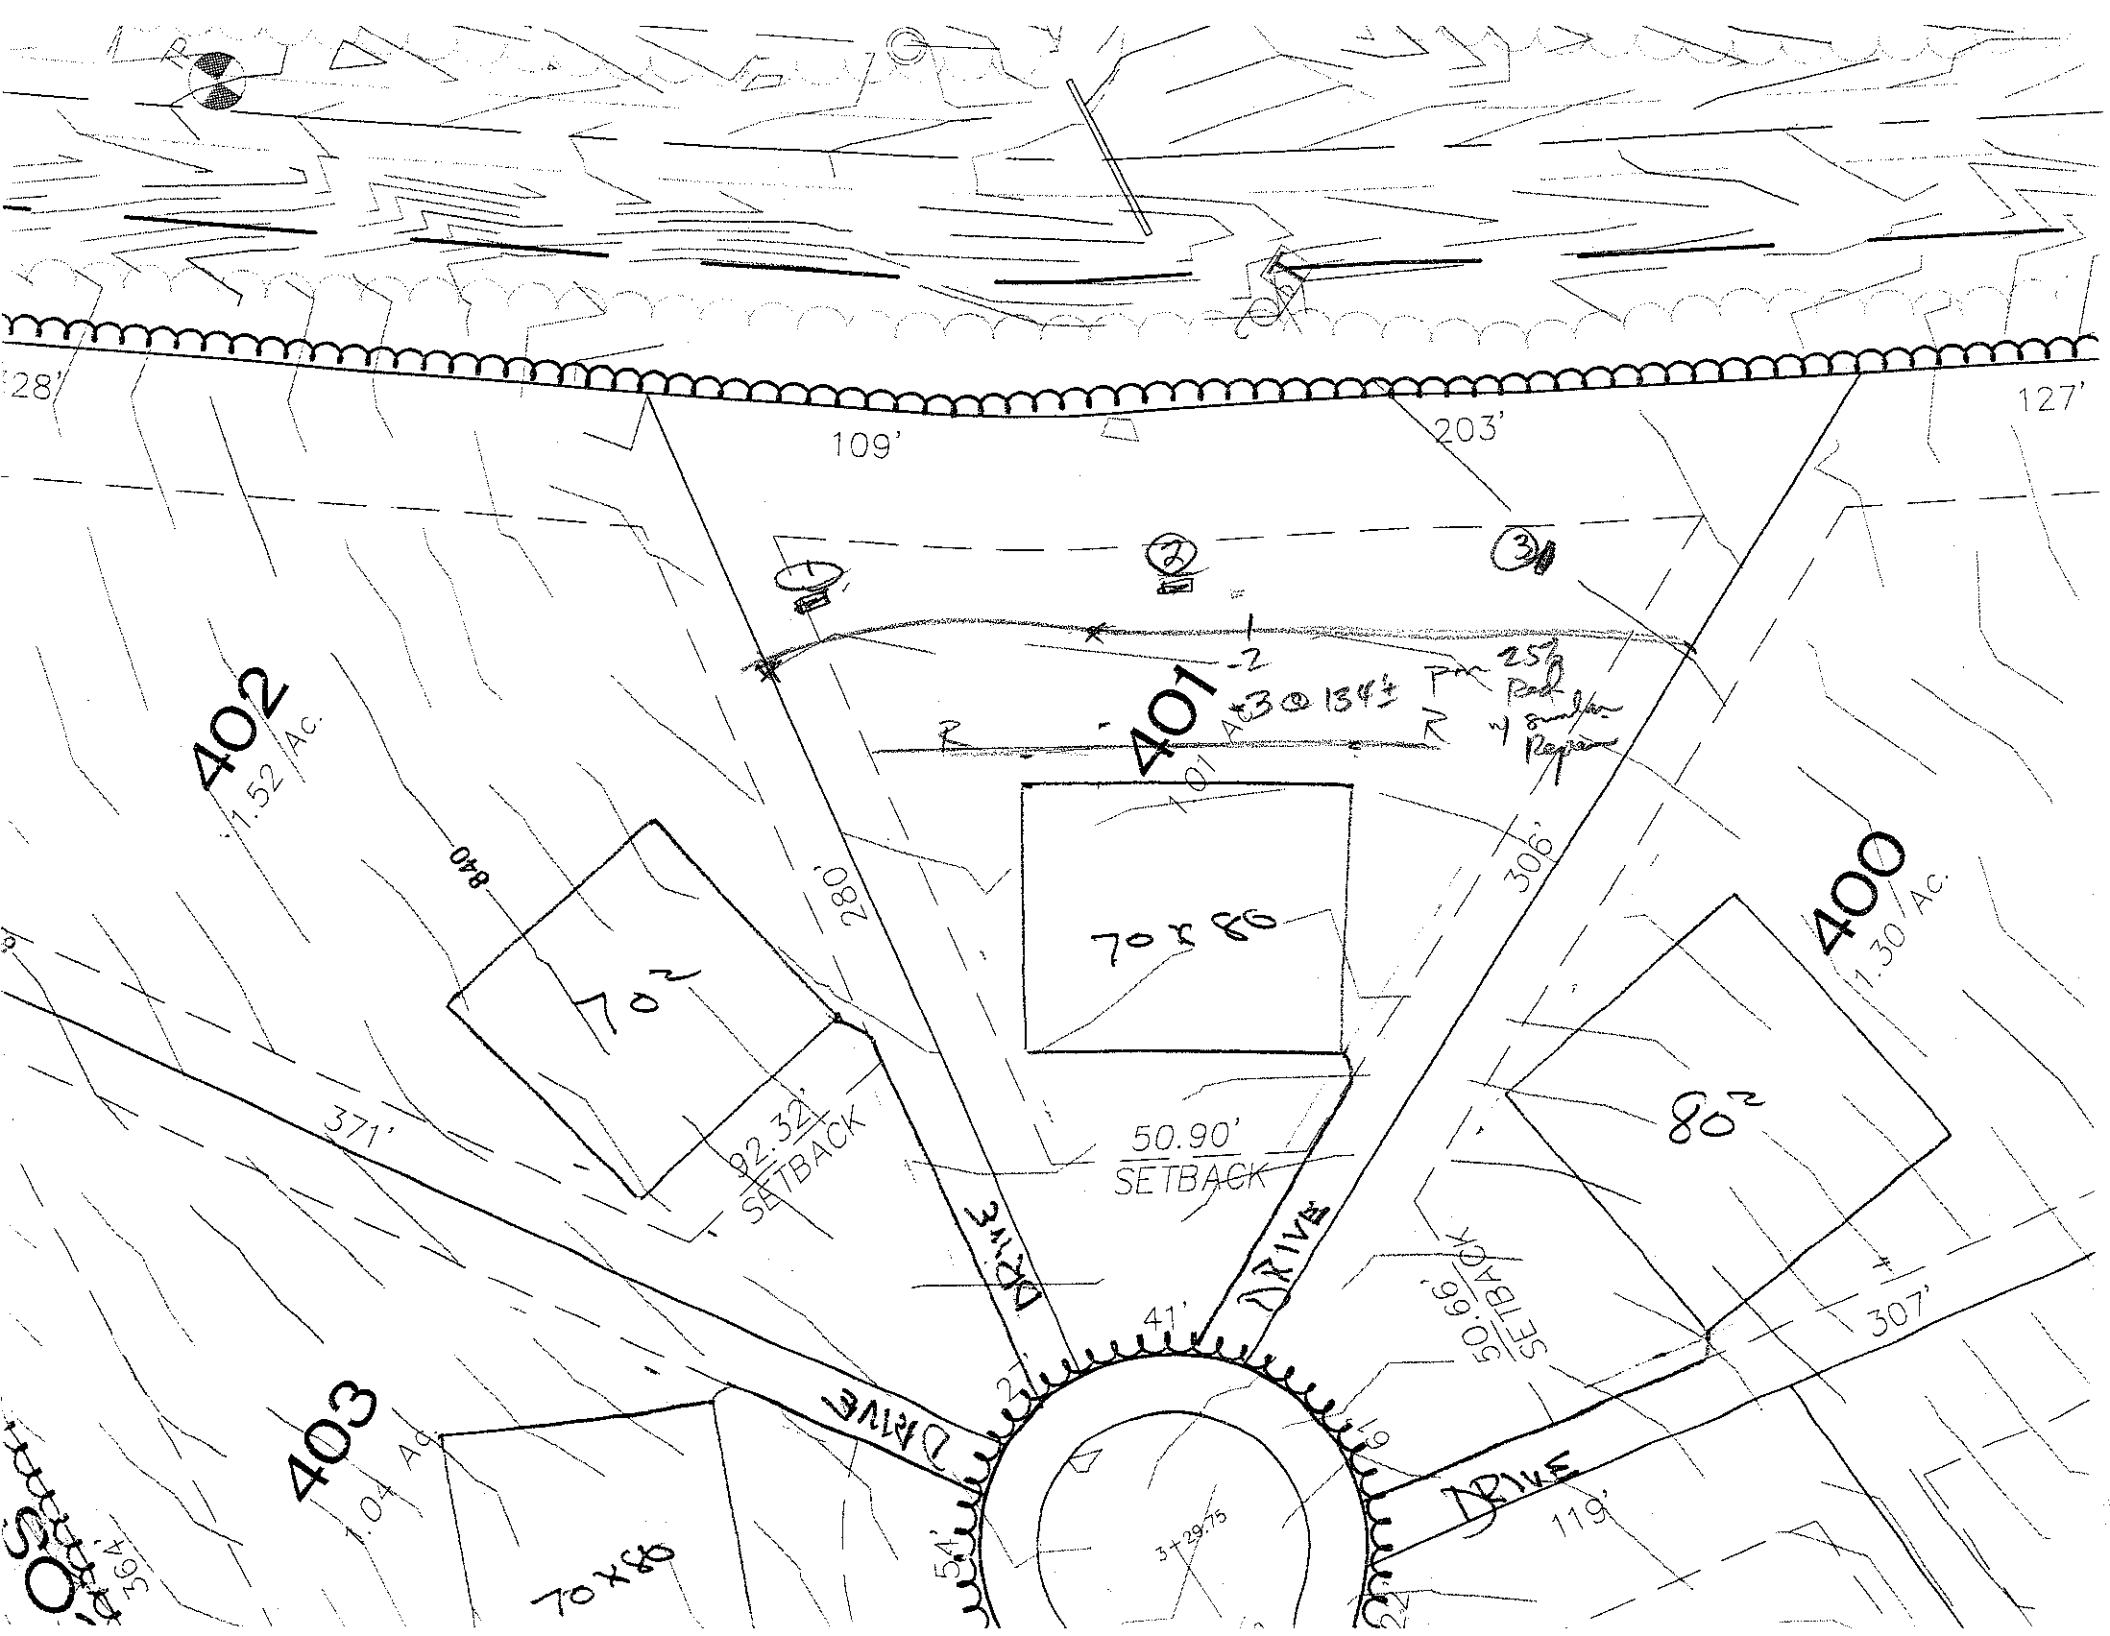
OWNER: The Farms LLC APPLICATION DATE ____
ADDRESS: ____ DATE EVALUATED: 2-705
PROPOSED FACILITY: SFR PROPOSED DESIGN FLOW (.1949): 480gpd PROPERTY SIZE: ____
LOCATION OF SITE: Lot 401 The Farms PROPERTY RECORDED: ____
WATER SUPPLY: ☐ Private ☒ Public ☒ Well ☐ Spring ☐ Other ____
EVALUATION METHOD: ☐ Auger Boring ☒ Pit ☐ Cut
TYPE OF WASTEWATER: ☒ Sewage ☐ Industrial Process ☐ Mixed

PROFILE #	.1940 LANDSCAPE POSITION/ SLOPE %	HORIZON DEPTH (IN.)	SOIL MORPHOLOGY (.1941) .1941 STRUCTURE/ TEXTURE	SOIL MORPHOLOGY (.1941) .1941 CONSISTENCE/ MINERALOGY	OTHER PROFILE FACTORS .1942 SOIL WETNESS/ COLOR	.1943 SOIL DEPTH	.1956 SAPRO CLASS	.1944 RESTR HORIZ	PROFILE CLASS & LTAR
1		0-5	wkSBK fr sdl	frSSSP					.3
		5-35	wkSBK RC	frSSSP SAP					
		35-52	wkSBK yR hvy cl	light frSSSP					
2	3%	0-5	wkSBK fr sdl	frSSSP					.3
		5-32	wkSBK RC	frSSSP SAP					
		32-54	wkSBK gyBr	frSSSP					
3		0-7	wkSBK sdl	frSSSP					.3
		7-35	SBK RC	frSSSP SAP					
		35-50	wkSBK yR sdl	frSSSP					
			fr fine ind SAP						
4									

DESCRIPTION	INITIAL SYSTEM	REPAIR SYSTEM
Available Space (.1945)	RS	RS
System Type(s)	Pm 25% Red	Same
Site LTAR	.3	.3

OTHER FACTORS (.1946): ____
SITE CLASSIFICATION (.1948): PS
EVALUATED BY: [signature]
OTHER(S) PRESENT: Paul Pennington

COMMENTS: ____


128'
109'
203'
127'
402
1.52 AC.
401
1.01 AC.
400
1.30 AC.
403
1.04 AC.
840
280'
306'
371'
70 x 80
70 x 80
80'
92.32'
SETBACK
50.90'
SETBACK
60.99'
SETBACK
DRIVE
DRIVE
DRIVE
DRIVE
41'
54'
307'
119'
3+29.75
Per 25' Road & Sanitary Repair