DEPARTMENT OF ENVIRONMENT AND NATURAL RESOURCES
DIVISION OF ENVIRONMENTAL HEALTH
ON-SITE WASTEWATER SECTION

Sheet ___ of ___
PROPERTY ID #: _____
COUNTY: _____

SOIL/SITE EVALUATION
for ON-SITE WASTEWATER SYSTEM

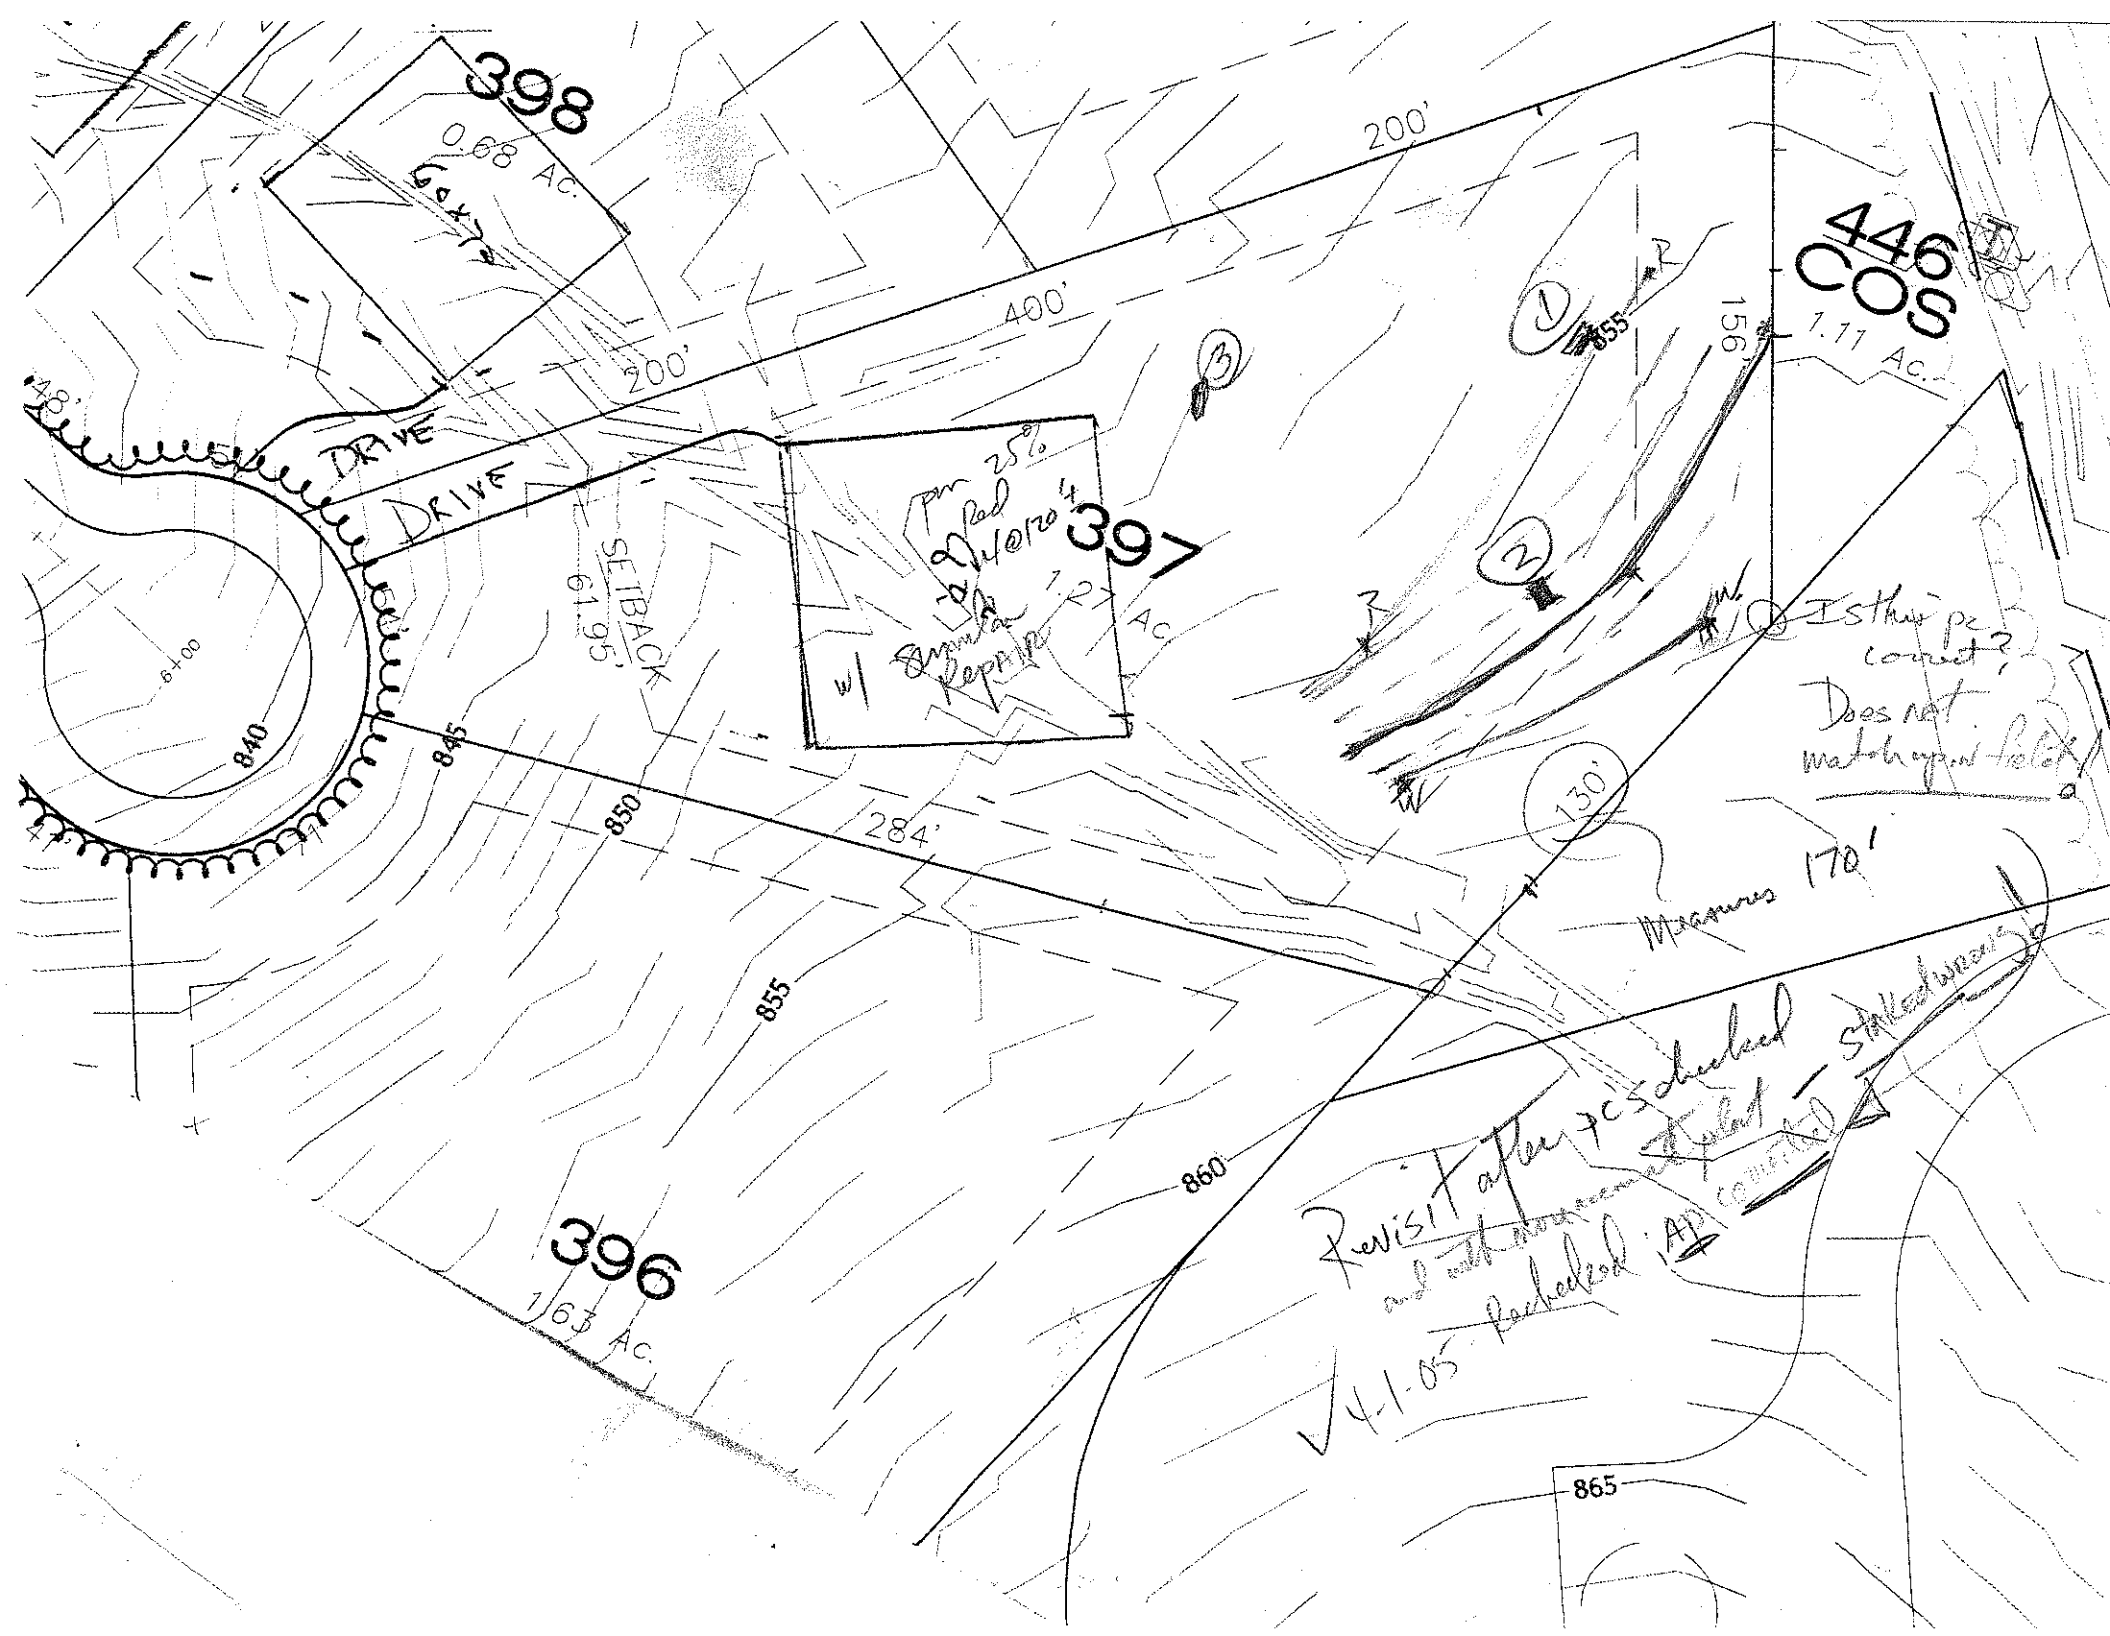
OWNER: The Farms LLC APPLICATION DATE _____
ADDRESS: _____ DATE EVALUATED 2-7-05
PROPOSED FACILITY: SFR PROPOSED DESIGN FLOW (.1949): 480gpd PROPERTY SIZE: _____
LOCATION OF SITE: lot 397 The Farms PROPERTY RECORDED: _____
WATER SUPPLY: ☐ Private ☒ Public ☒ Well ☐ Spring ☐ Other _____
EVALUATION METHOD: ☐ Auger Boring ☒ Pit ☐ Cut
TYPE OF WASTEWATER: ☒ Sewage ☐ Industrial Process ☐ Mixed

PROFILE #	.1940 LAND-SCAPE POSITION/ SLOPE %	HORI-ZON DEPTH (IN.)	SOIL MORPHOLOGY (.1941) .1941 STRUCTURE/ TEXTURE	SOIL MORPHOLOGY (.1941) .1941 CONSISTENCE/ MINERALOGY	OTHER PROFILE FACTORS .1942 SOIL WETNESS/ COLOR	.1943 SOIL DEPTH	.1956 SAPRO CLASS	.1944 RESTR HORIZ	PROFILE CLASS & LTAR
1		0-3	vfsl brn sd	fr ss sp					3
		3-22	mfsbk RC	fr ss sp					
		22-49	wk sbk ygr cl	fr ss sp	few fine mnd sap				
2	4% L	0-5	wk sbk brn sd	fr ss sp					.3
		5-28	mfsbk RC	fr ss sp sap					
		28-49	(gr) wk sbk ygr cl	fr ss sp	few (S WALL) - common (N wall) mi sap few rock w/ few low chr relic mottles				
3		0-8	wk sbk brn sd	fr ss sp					.25
		8-40"	mfsbk RC	fr ss sp	few mi sap on S. wall / common mi sap & W. rock 18"+ on N. wall				
		40-53	wk sbk cl	fr ss sp					
4									

DESCRIPTION	INITIAL SYSTEM	REPAIR SYSTEM
Available Space (.1945)	PS	PS
System Type(s)	pm 25% Red	pm LP 25% Red
Site LTAR	.25+	.25

OTHER FACTORS (.1946): _____
SITE CLASSIFICATION (.1948): PS
EVALUATED BY: DH Jimison, RS
OTHER(S) PRESENT: _____

COMMENTS: _____


398
0.68 Ac.
60x72
200'
400'
200'
48'
DRIVE
DRIVE
SETBACK
61.95'
397
1.27 Ac.
446
COS
1.11 Ac.
156'
855
R
130'
170'
284'
840
845
850
855
860
865
396
1.63 Ac.
Does not match up with Parcel
Revisit after pc's checked and with measurements
Parcel - Stakeboard
4-1-05 Packet