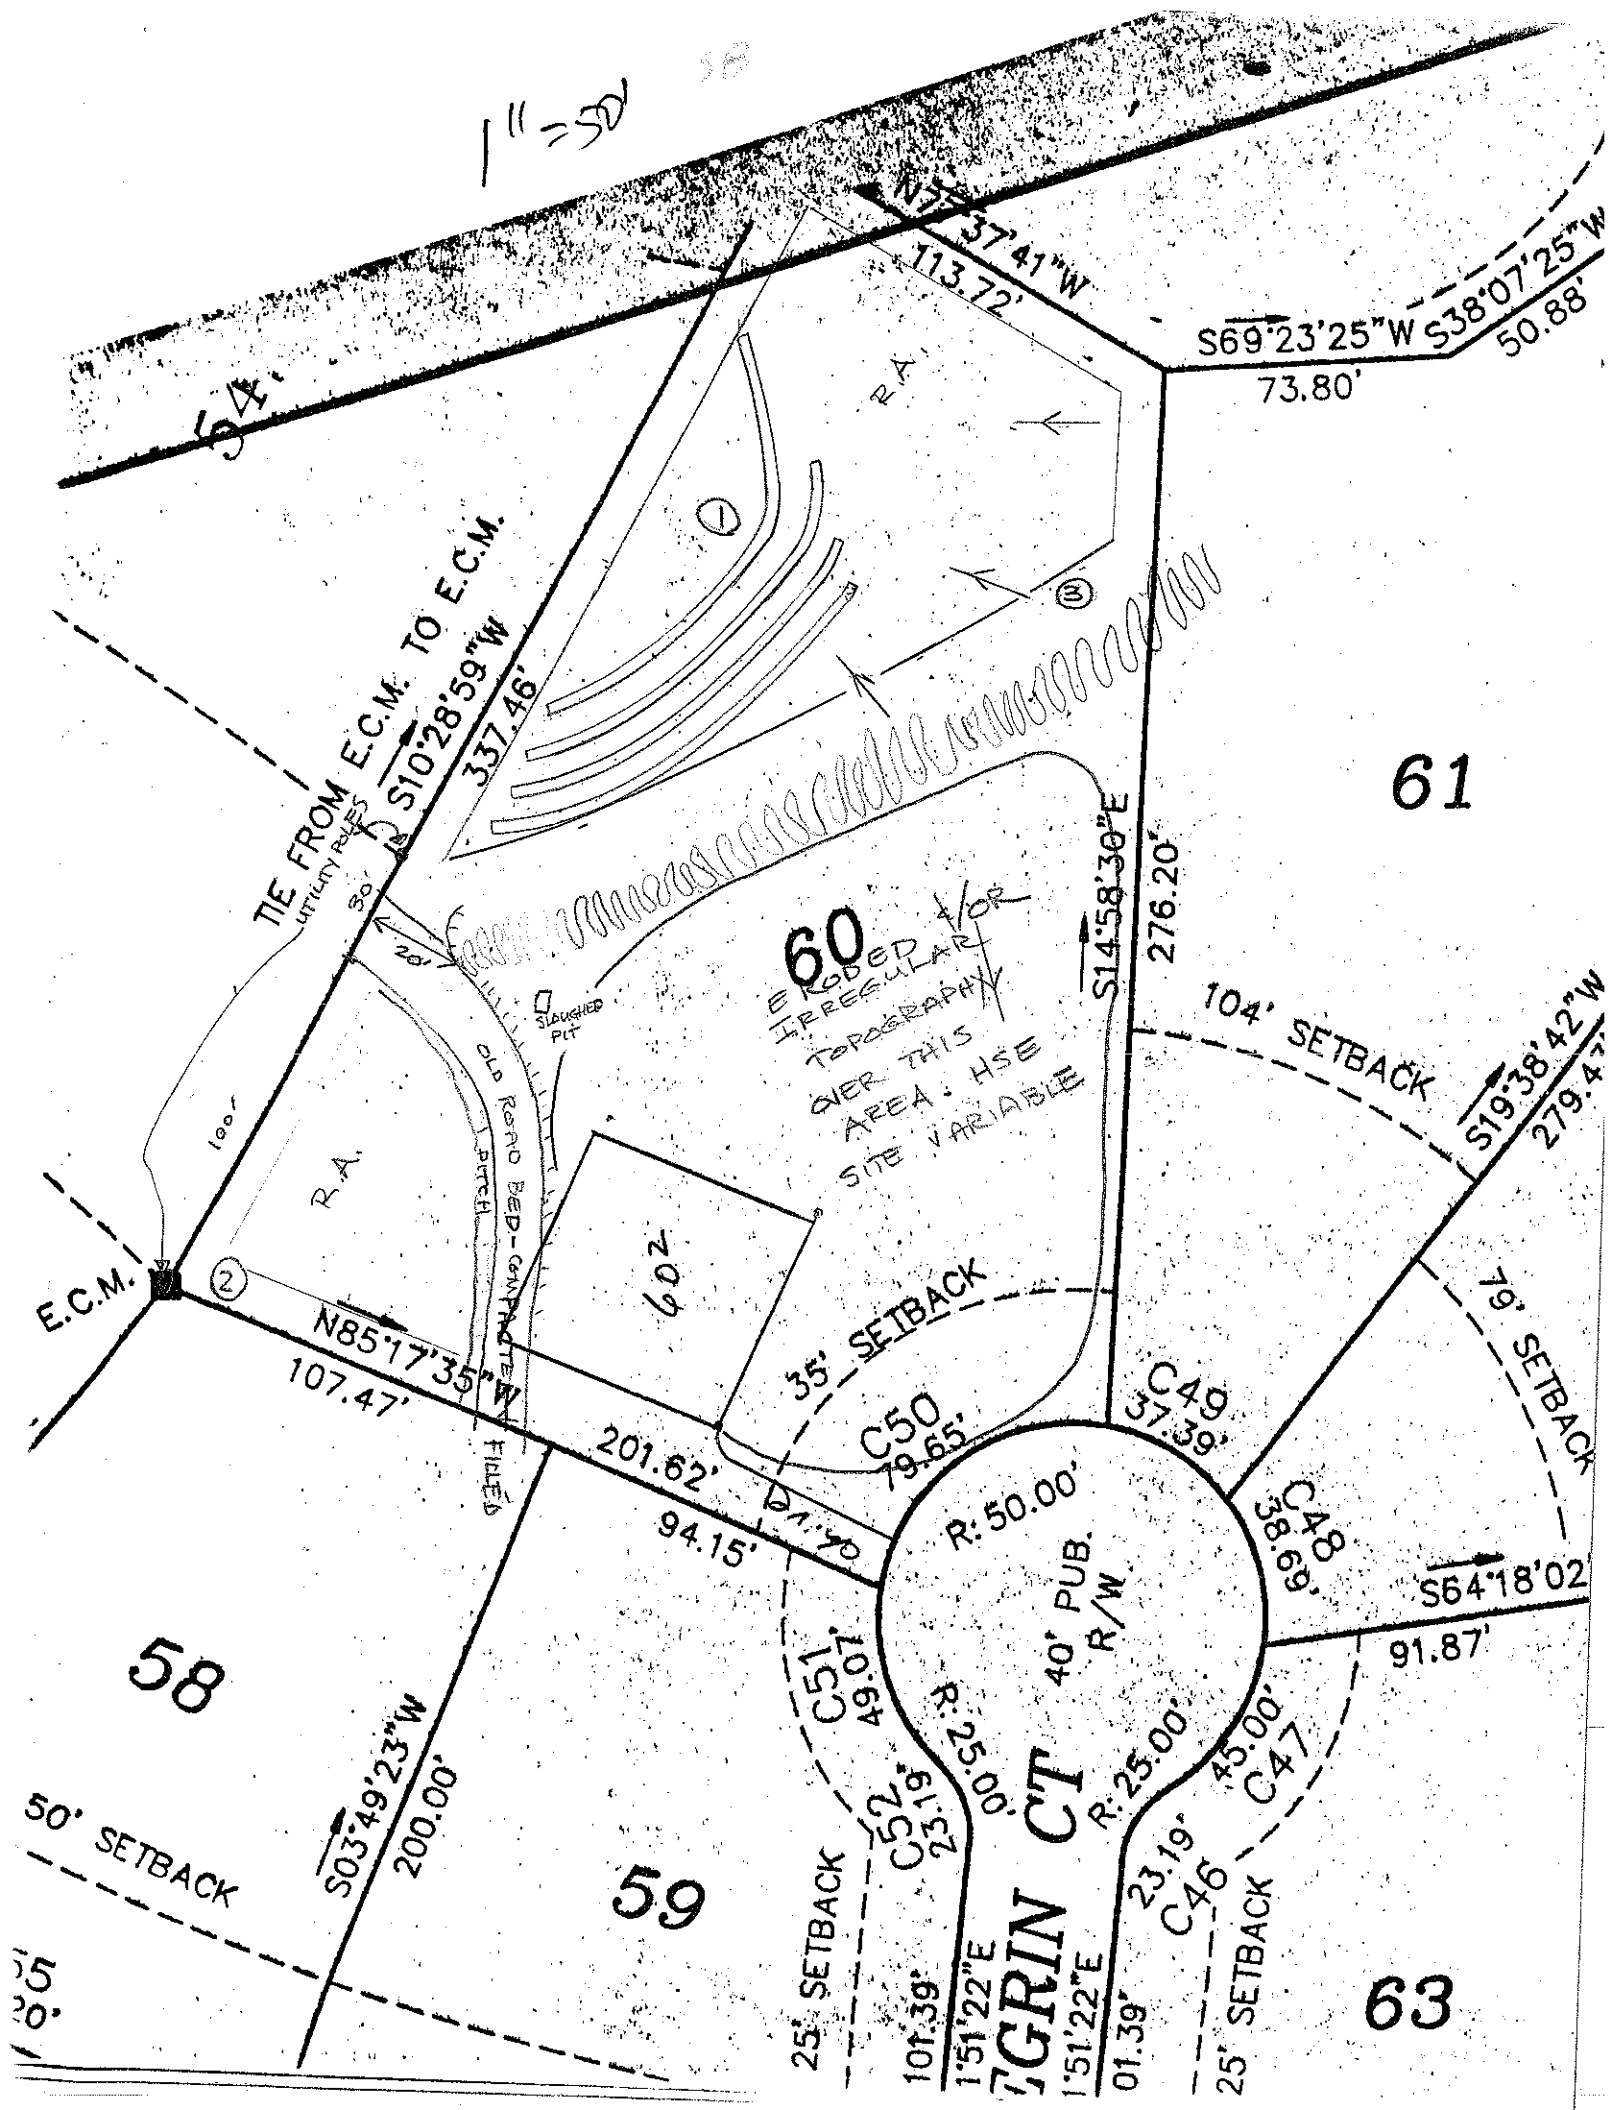

1" = 50'
N37°37'41"W
113.72'
S69°23'25"W
73.80'
S38°07'25"W
50.88'
64'
TIE FROM E.C.M. TO E.C.M.
S10°28'59"W
337.46'
UTILITY POLES
30'
20'
100'
E.C.M.
R.A.
R.A.
SLAUGHTER PIT
OLD ROAD BED-CONTRACTOR FILLED
PITCH
60
E KODER 4/OR IRREGULAR TOPOGRAPHY OVER THIS AREA. HSE SITE VARIABLE
602
61
S14°58'30"E
276.20'
104' SETBACK
S19°38'42"W
279.47'
79' SETBACK
35' SETBACK
N85°17'35"W
107.47'
201.62'
94.15'
C50
79.65'
C49
37.39'
C48
38.69'
R: 50.00'
40' PUB. R/W
S64°18'02"
91.87'
C51
49.07'
C52
23.19'
R: 25.00'
R: 25.00'
C47
45.00'
C46
23.19'
58
59
63
S03°49'23"W
200.00'
50' SETBACK
25' SETBACK
25' SETBACK
101.39'
N1°51'22"E
101.39'
GRIN CT

DEPARTMENT OF ENVIRONMENT,
HEALTH, & NATURAL RESOURCES
DIVISION OF ENVIRONMENTAL HEALTH

SHEET ____ OF ____
PROPERTY I.D.#: ____
PROPERTY RECORDED: ____
COUNTY: ____

# SOIL/SITE EVALUATION
## FOR
## ON-SITE WASTEWATER SYSTEM

APPLICANT: Toney Jacobs CPSS
ADDRESS: Crescent Resources / PO Box 1803 / Charlotte
OWNER / AGENT: ____ PHONE: ____
APPLICATION DATE: ____ DATE EVALUATED: ____
PROPOSED FACILITY: SFR 360 gpd
PROPERTY SIZE: ____
LOCATION OF SITE: Harbour lot 60 map C phase I
WATER SUPPLY: On-Site Well ____ Comm. Well ____ Public ____ Other ____ EVAL. METHOD: Auger Boring / Pit ____ Cut ____

| PROFILE # | .1940 LANDSCP POS. (%) | HORIZON DEPTH (IN.) | .1941 STRUCTURE/TEXTURE | .1941 MINERALOGY/ CONSISTENCE | .1942 WETNESS COND. | .1944 RESTRICT HORIZONS | .1948 CLASS OF HORIZ | 1943/ 1956 SAPRLT CLASS. | HORIZON LTAR |
|---|---|---|---|---|---|---|---|---|---|
| 1 | | 0-10 | cl mod-wk gran | mfr | - | - | P | - | 0.4 |
| | | 10-24 | c wk sbk | msfi | - | - | P | - | 0.3 |
| | | 24-36 | c wk sbk | dry | 24" | - | U | - | |
| | | 36-41 | c + Sap | dry brittle | - | 41" | U | - | - |
| | | 41-44 | Saprolite | dry brittle | - | - | - | 4 | - |
| 2 | | 0-10 | cl wk gran | mfr | - | - | - | - | - |
| | | 10-25 | c wk sbk | msfi | - | - | P | - | 0.3 |
| | | 25-35 / 25-33 | c wk sbk | mfi | >35 | >35 | P | - | 0.3 |
| | | terminated due to felsic rock inclusions | | | | | | | |
| 3 | | 0-12 | l mod grain | mfr | - | - | P | - | 0.4 |
| | | 12-24 | cl mod-wk sbk | msfi | - | - | P | - | 0.35-.3 |
| | | 24-44 | c wk sbk | mfi | - | - | P | - | 0.3 |
| | | 44-49 | c wk sbk | mvfi | >49 | >49 | P | - | .3-.25 |
| 4 | | | | | | | | | |
| 5 | | | | | | | | | |

AVAILABLE SPACE (.1945) S SITE CLASSIFICATION (.1948): P SITE LONG-TERM ACCEPTANCE RATE: 0.35gpd/025REP
EVALUATED BY: AL OTHER(S) PRESENT: NONE
COMMENTS: 2.5YR 4/6(mo) 10YR 6/6-7/1-7/3-7/6 ; 10YR 5/8(Matrix) 2.5YR 4/6 10YR 7/1-7/3-7/6 ; CONV SYS + PPBPS REPAIR