DEPARTMENT OF ENVIRONMENT AND NATURAL RESOURCES
DIVISION OF ENVIRONMENTAL HEALTH
ON-SITE WASTEWATER SECTION

Sheet ___ of ___
PROPERTY ID #: _____
COUNTY: _____

SOIL/SITE EVALUATION
for ON-SITE WASTEWATER SYSTEM

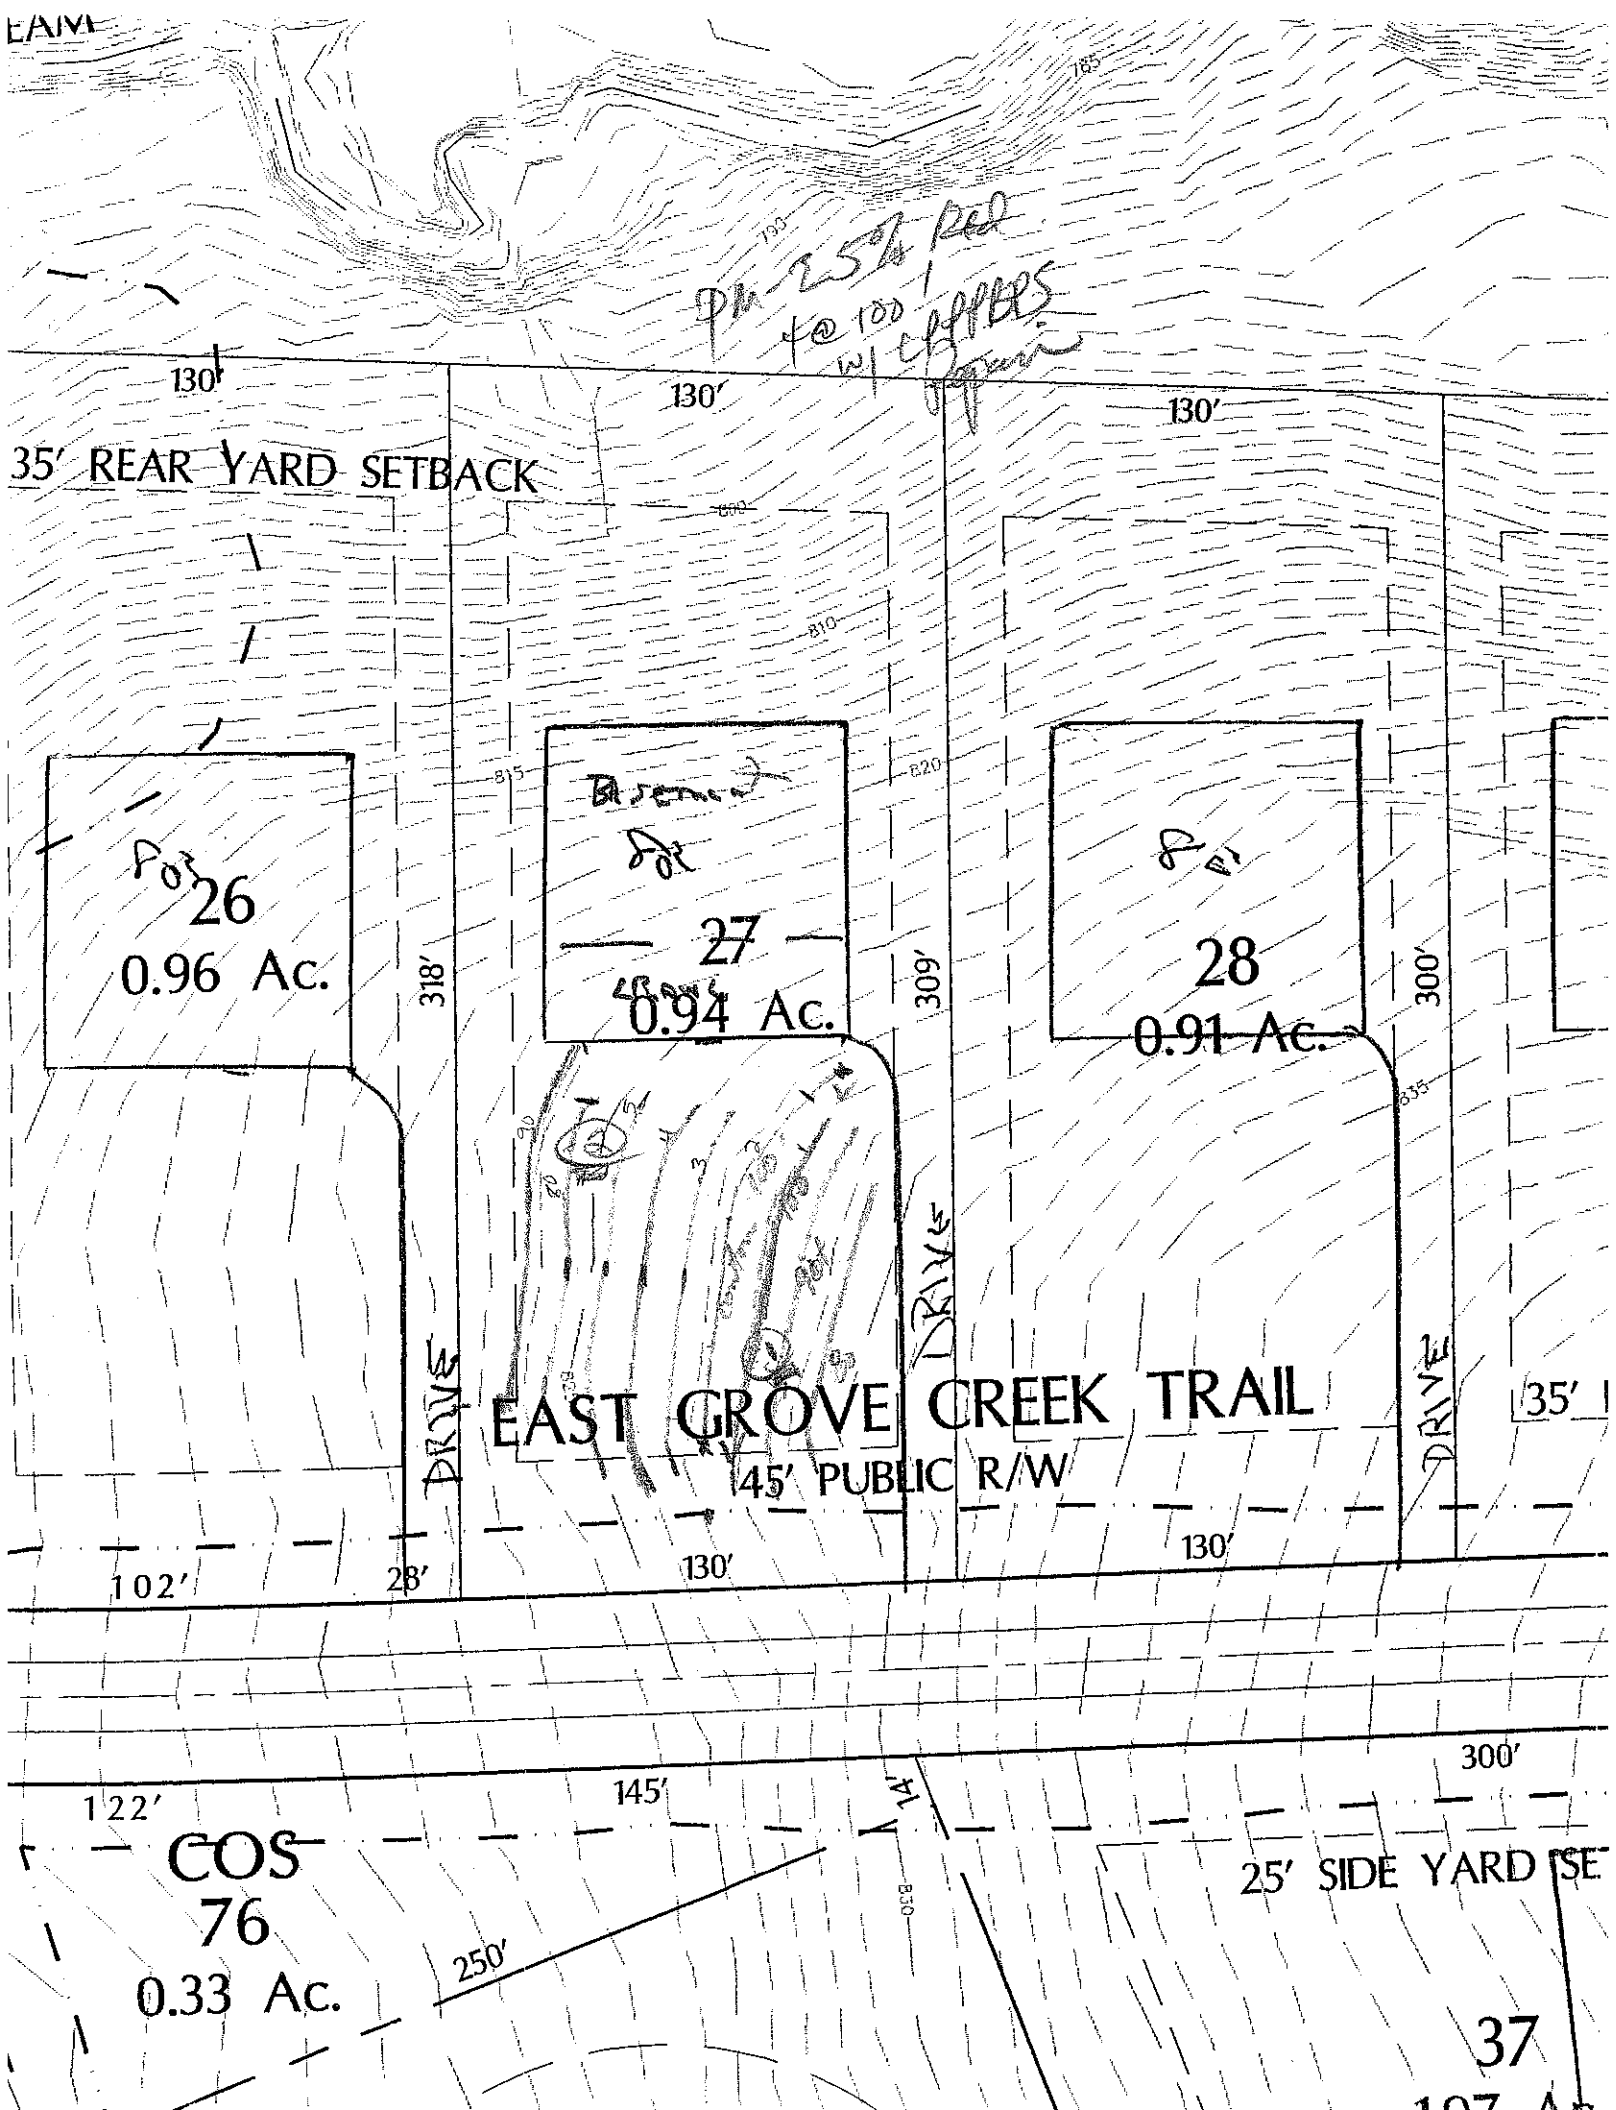
OWNER: CRI APPLICATION DATE _____
ADDRESS: _____ DATE EVALUATED: 3-28-07
PROPOSED FACILITY: _____ PROPOSED DESIGN FLOW (.1949): 4 bdrm SF PROPERTY SIZE: _____
LOCATION OF SITE: Lot 27 Wildwest PROPERTY RECORDED: _____
WATER SUPPLY: ☐ Private ☒ Public ☒ Well ☐ Spring ☐ Other _____
EVALUATION METHOD: ☐ Auger Boring ☒ Pit ☐ Cut
TYPE OF WASTEWATER: ☒ Sewage ☐ Industrial Process ☐ Mixed

PROFILE #	.1940 LAND-SCAPE POSITION/ SLOPE %	HORI-ZON DEPTH (IN.)	SOIL MORPHOLOGY (.1941) .1941 STRUCTURE/ TEXTURE	SOIL MORPHOLOGY (.1941) .1941 CONSISTENCE/ MINERALOGY	OTHER PROFILE FACTORS .1942 SOIL WETNESS/ COLOR	OTHER PROFILE FACTORS .1943 SOIL DEPTH	OTHER PROFILE FACTORS .1956 SAPRO CLASS	OTHER PROFILE FACTORS .1944 RESTR HORIZ	PROFILE CLASS & LTAR
1		0-16	sl fsk RC	fr SO SOP					.3
		16-51 (BC)	wk sbk gr-cy sl fksl	fr sp	common in hsp				
2	~7%	0-6	gr-wk sbk L branch	fr sp					.3
		6-16	m fsbk RC	fr sp SO SOP					
		16-53 (BC)	wk f-m sbk gr-cy sl fksl	fr sp	few common in hsp				
3									
4									

DESCRIPTION	INITIAL SYSTEM	REPAIR SYSTEM
Available Space (.1945)	Ps	Ps
System Type(s)	Pm - 75% Red	Pm/LP 25-50% Red
Site LTAR	.3	.3

OTHER FACTORS (.1946): _____
SITE CLASSIFICATION (.1948): S
EVALUATED BY: _____
OTHER(S) PRESENT: Paul Pennington

COMMENTS: _____


130'
130'
130'
35' REAR YARD SETBACK
26
0.96 Ac.
318'
27
0.94 Ac.
309'
28
0.91 Ac.
300'
DRIVE
DRIVE
DRIVE
EAST GROVE CREEK TRAIL
45' PUBLIC R/W
35'
102'
28'
130'
130'
300'
122'
145'
COS
76
0.33 Ac.
250'
25' SIDE YARD SE
37