DEPARTMENT OF ENVIRONMENT AND NATURAL RESOURCES
DIVISION OF ENVIRONMENTAL HEALTH
ON-SITE WASTEWATER SECTION

Sheet ___ of ___
PROPERTY ID #: _____
COUNTY: _____

SOIL/SITE EVALUATION for ON-SITE WASTEWATER SYSTEM

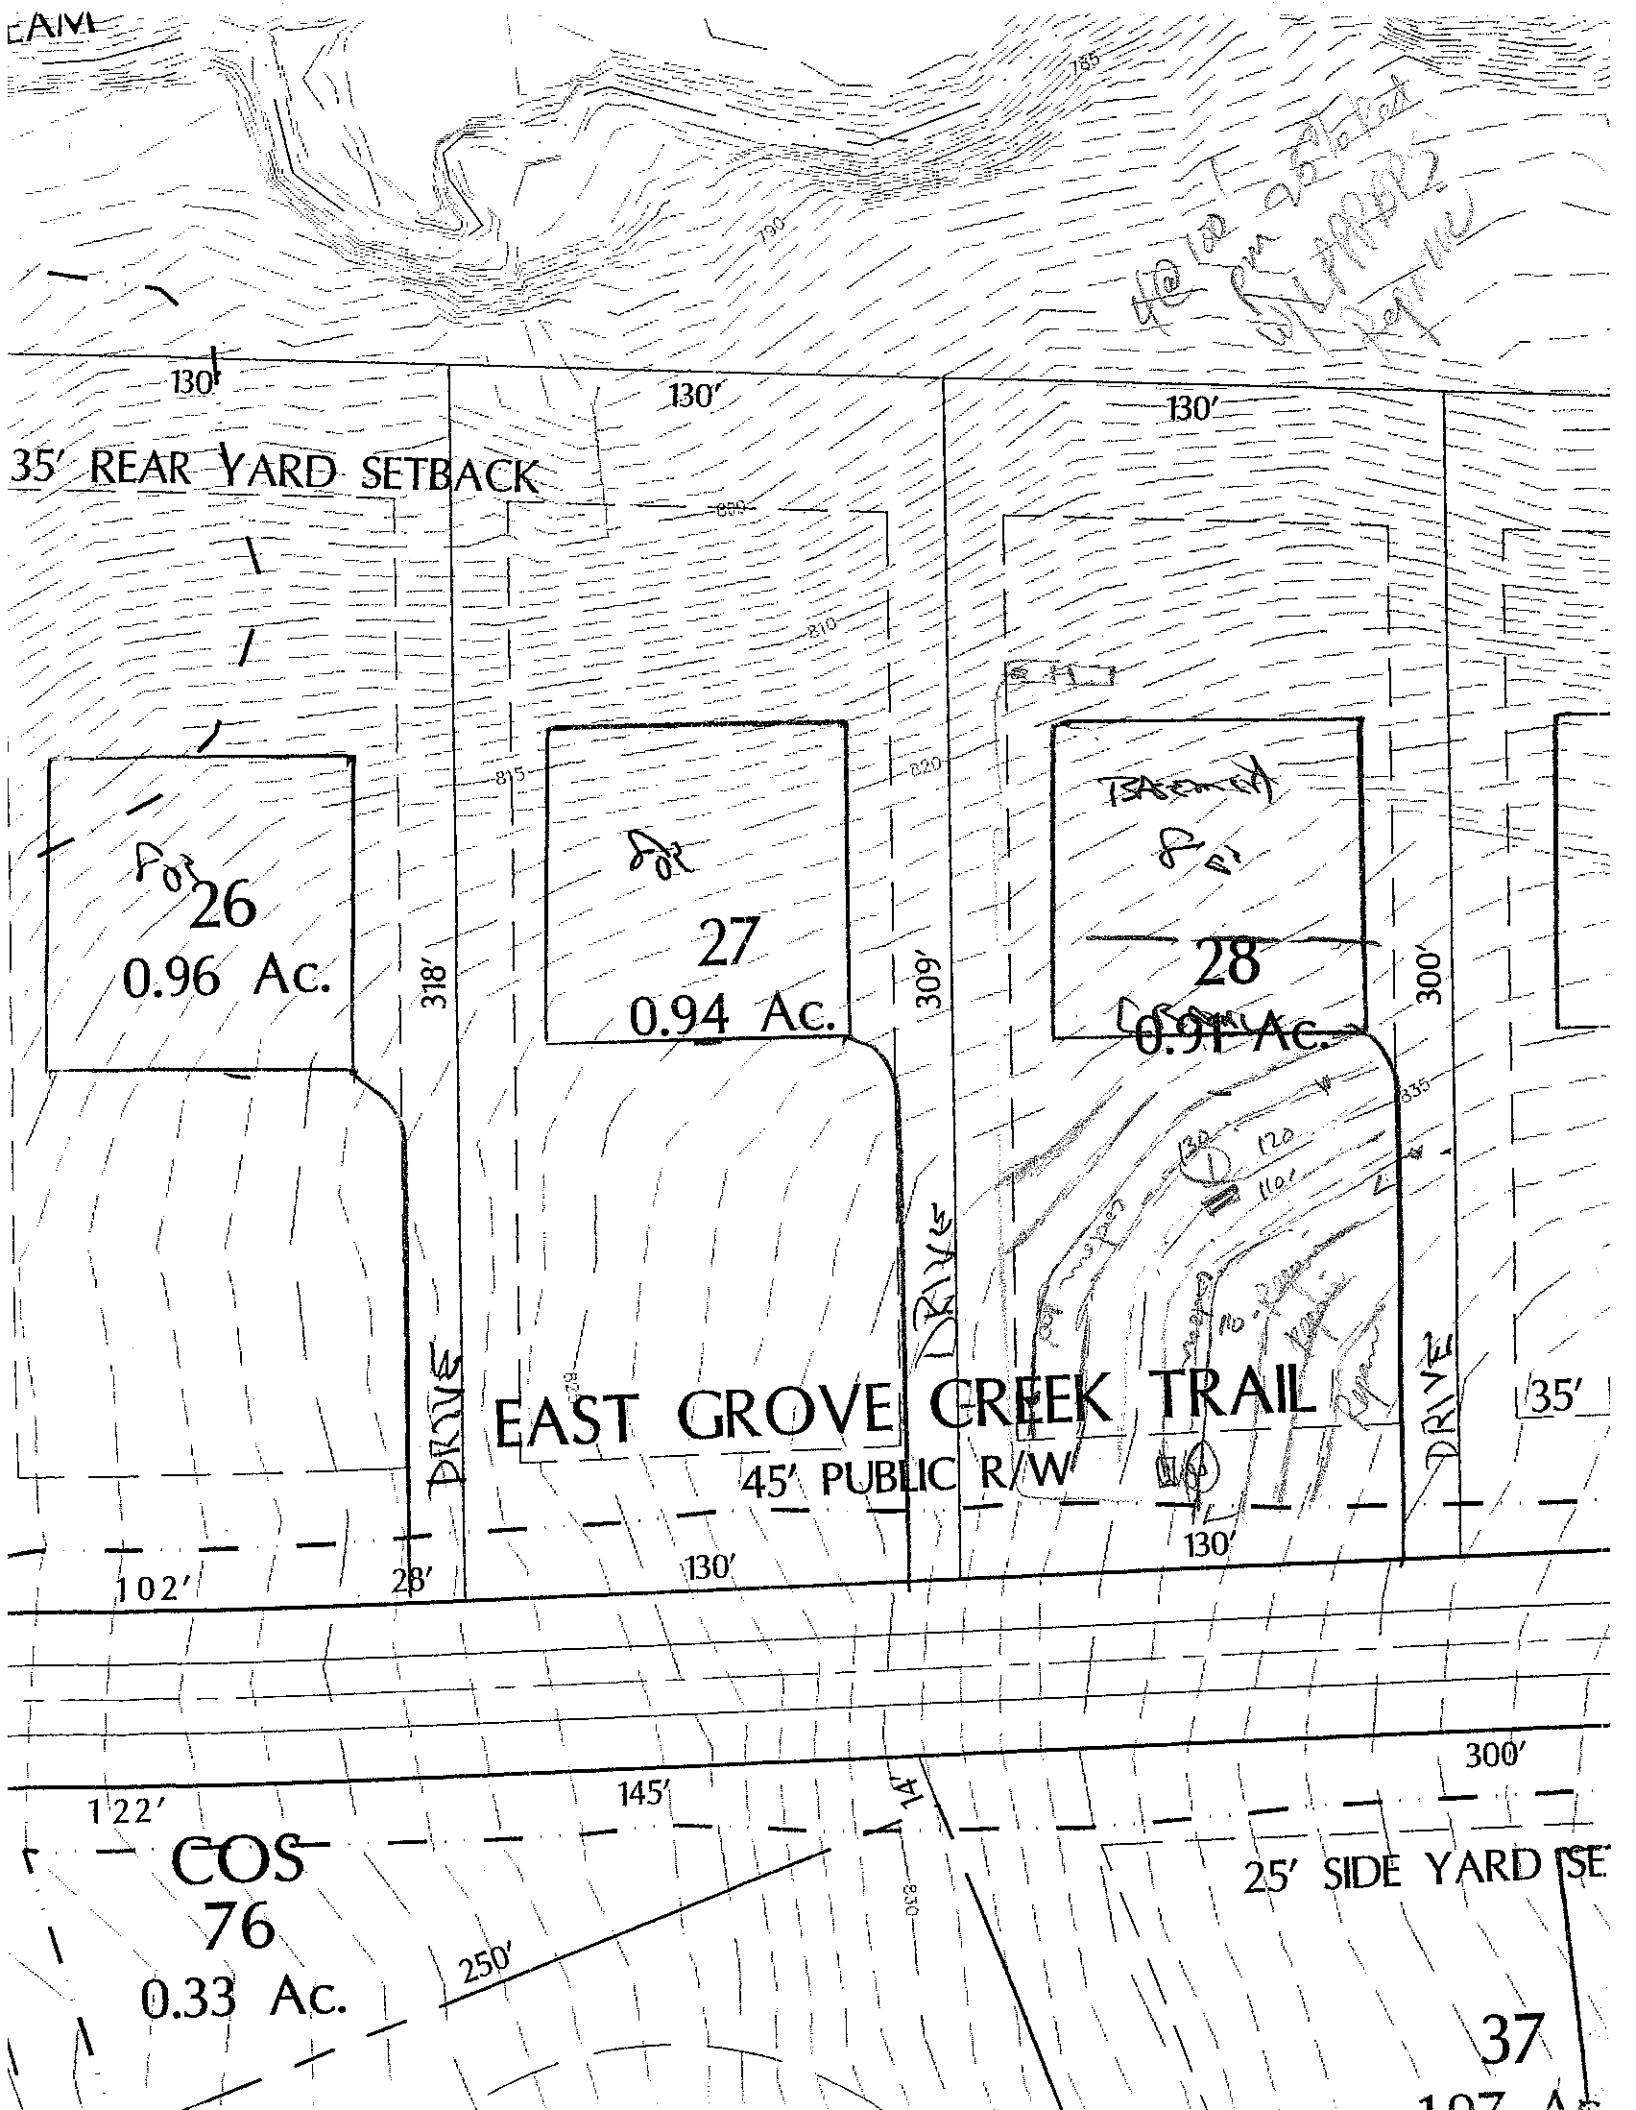
OWNER: CRT APPLICATION DATE _____
ADDRESS: _____ DATE EVALUATED: 3-28-03
PROPOSED FACILITY: _____ PROPOSED DESIGN FLOW (.1949): _____ PROPERTY SIZE: _____
LOCATION OF SITE: Lot 28 Lake Forest PROPERTY RECORDED: _____
WATER SUPPLY: ☐ Private ☒ Public ☒ Well ☐ Spring ☐ Other _____
EVALUATION METHOD: ☐ Auger Boring ☒ Pit ☐ Cut
TYPE OF WASTEWATER: ☒ Sewage ☐ Industrial Process ☐ Mixed

PROFILE #	.1940 LAND-SCAPE POSITION/ SLOPE %	HORI-ZON DEPTH (IN.)	SOIL MORPHOLOGY (.1941) .1941 STRUCTURE/ TEXTURE	SOIL MORPHOLOGY (.1941) .1941 CONSISTENCE/ MINERALOGY	OTHER PROFILE FACTORS .1942 SOIL WETNESS/ COLOR	OTHER PROFILE FACTORS .1943 SOIL DEPTH	OTHER PROFILE FACTORS .1956 SAPRO CLASS	OTHER PROFILE FACTORS .1944 RESTR HORIZ	PROFILE CLASS & LTAR
1	6-8%	0-10	gr SaSpn SCL	frSSSP					.3
		10-31	NH A-SCL RC	frSSP					
		31-50	WH SCL yRCl (BC)	frSSSP	few common mic SSP				
2		0-10	wk SCL chunk	frSSSP					.3
		10-28	M SCL RC	frSP SBK					
		28-52	WH A-SCL yRCl (BC)	frSSSP	common mic SSP				
3									
4									

DESCRIPTION	INITIAL SYSTEM	REPAIR SYSTEM
Available Space (.1945)	PS	PS per .1956
System Type(s)	pm 25% Red	LPPPBPS
Site LTAR	.3	.3

OTHER FACTORS (.1946): _____
SITE CLASSIFICATION (.1948): PS
EVALUATED BY: DRT
OTHER(S) PRESENT: Paul Pennington

COMMENTS: _____


130'
130'
130'
35' REAR YARD SETBACK
26
0.96 Ac.
27
0.94 Ac.
28
0.91 Ac.
318'
309'
300'
DRIVE
DRIVE
DRIVE
EAST GROVE CREEK TRAIL
45' PUBLIC R/W
35'
102'
28'
130'
130'
300'
122'
145'
14'
COS
76
0.33 Ac.
250'
25' SIDE YARD SE
37