DEPARTMENT OF ENVIRONMENT AND NATURAL RESOURCES
DIVISION OF ENVIRONMENTAL HEALTH
ON-SITE WASTEWATER SECTION

Sheet ___ of ___
PROPERTY ID #: _____
COUNTY: _____

SOIL/SITE EVALUATION
for ON-SITE WASTEWATER SYSTEM

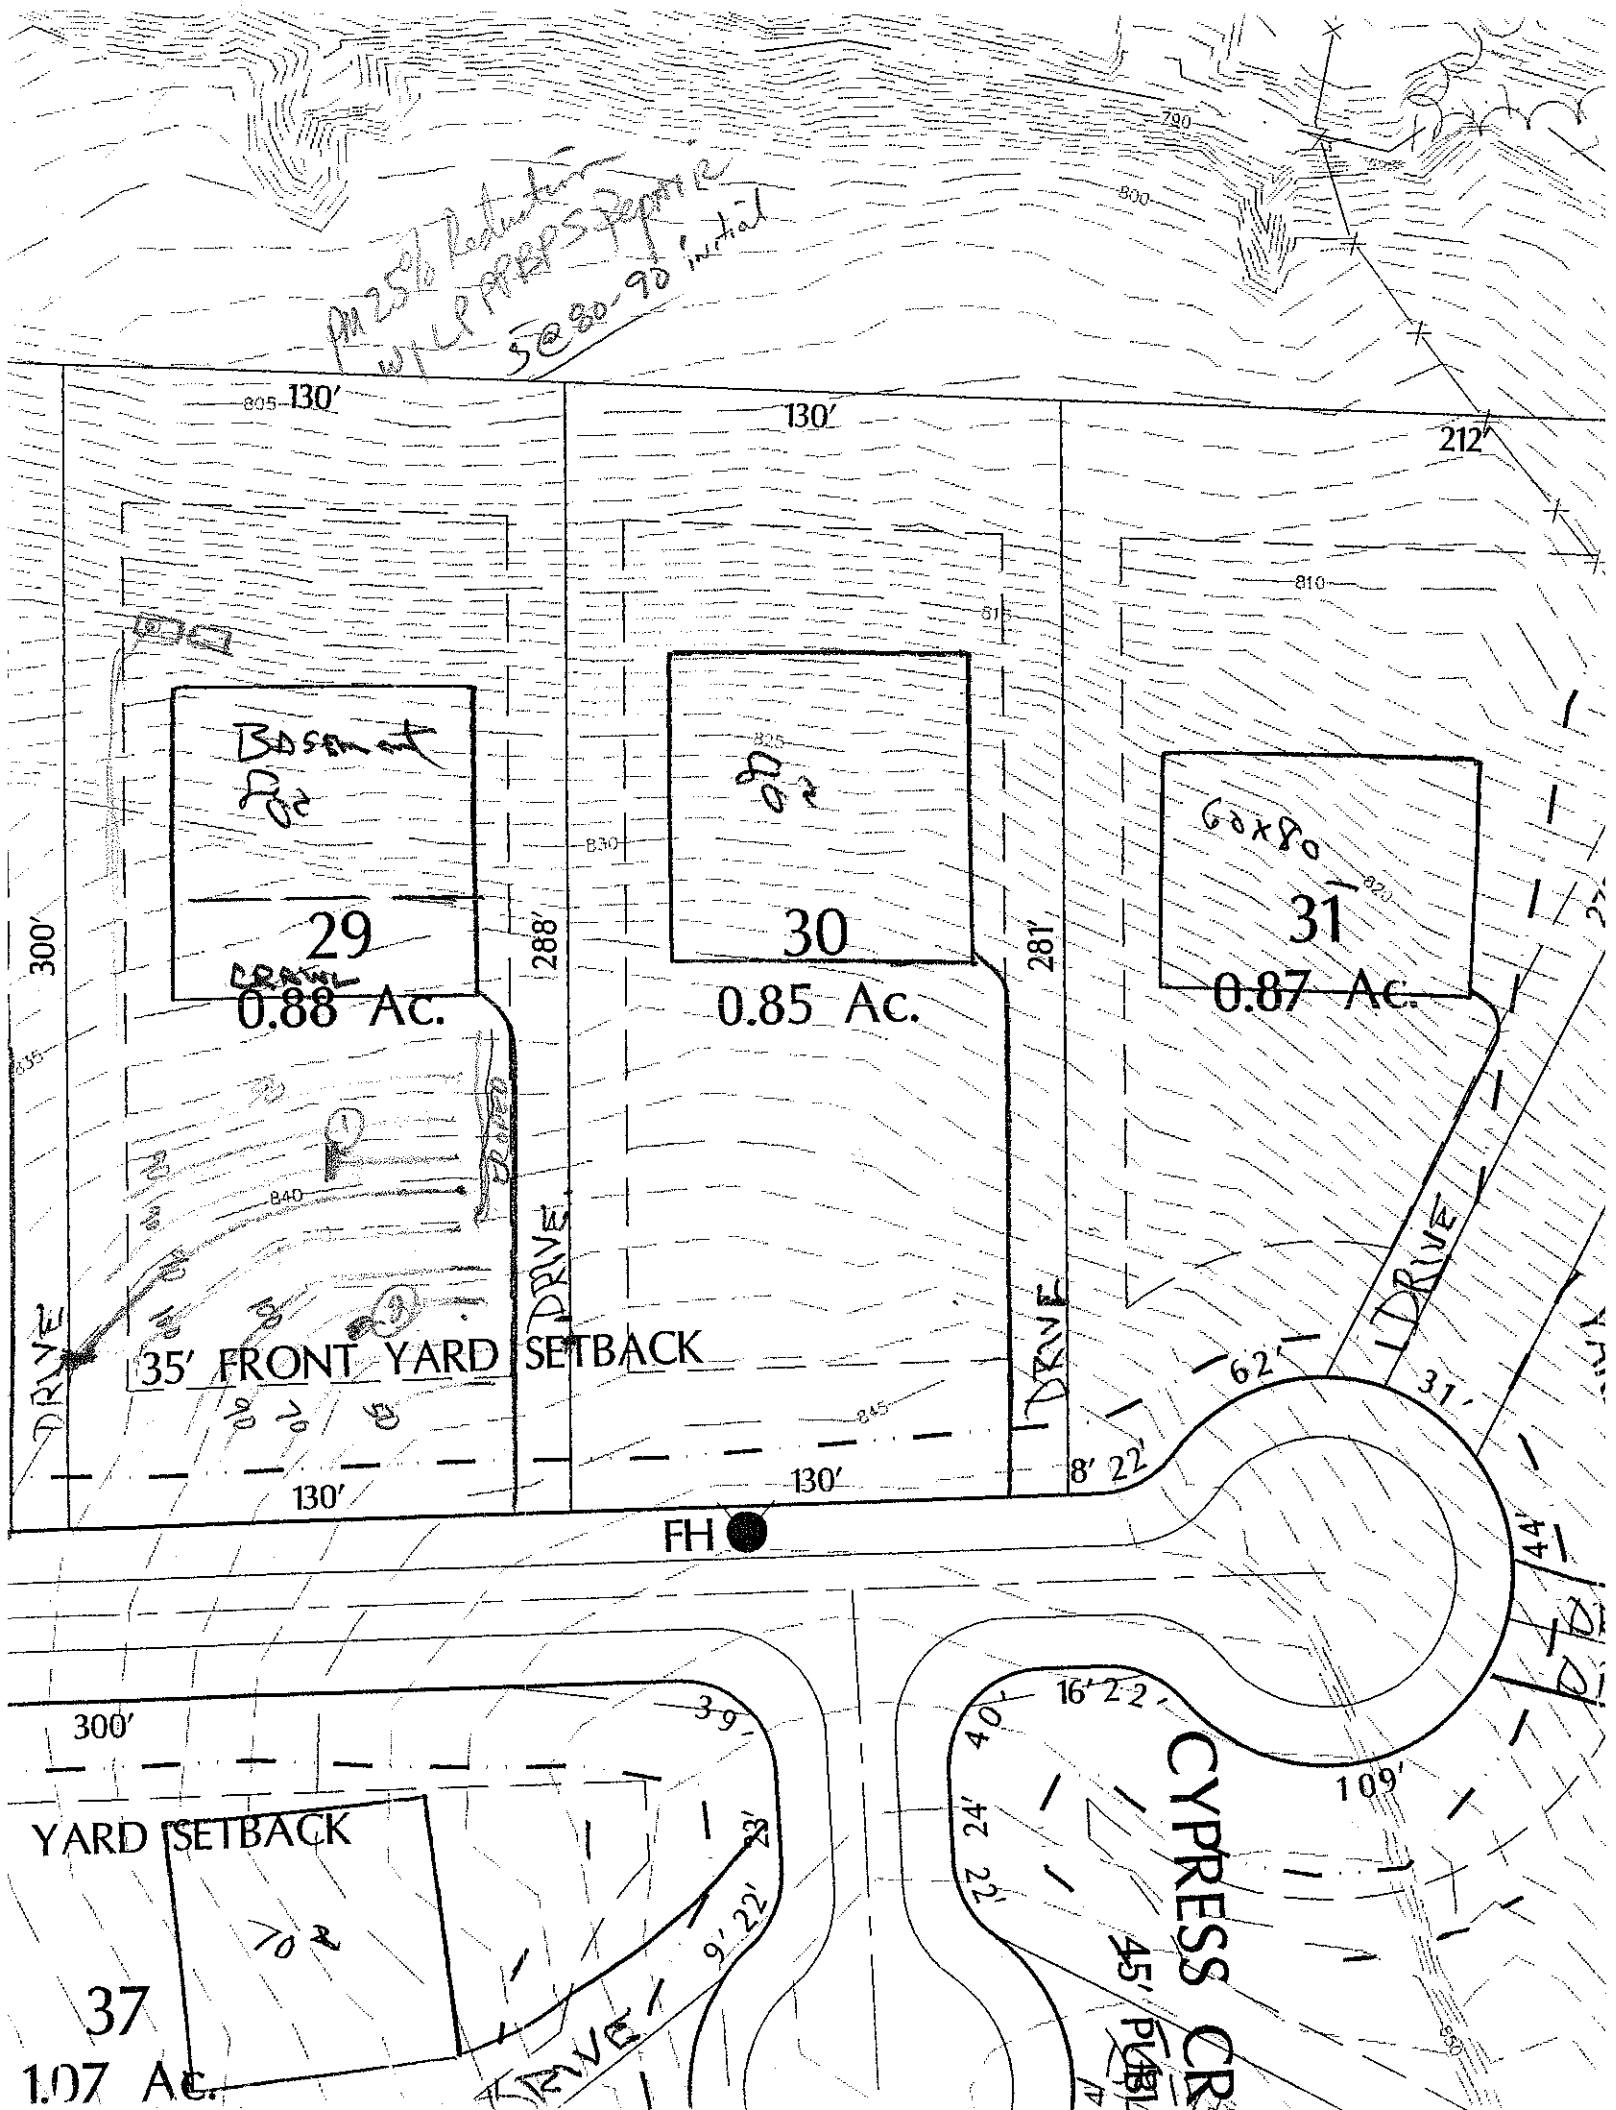
OWNER: CKT APPLICATION DATE _____
ADDRESS: _____ DATE EVALUATED: 3-28-03
PROPOSED FACILITY: _____ PROPOSED DESIGN FLOW (.1949): 480gpd PROPERTY SIZE: _____
LOCATION OF SITE: Lot 29 Lakefront PROPERTY RECORDED: _____
WATER SUPPLY: ☐ Private ☒ Public ☒ Well ☐ Spring ☐ Other _____
EVALUATION METHOD: ☐ Auger Boring ☒ Pit ☐ Cut
TYPE OF WASTEWATER: ☒ Sewage ☐ Industrial Process ☐ Mixed

PROFILE #	.1940 LANDSCAPE POSITION/ SLOPE %	HORIZON DEPTH (IN.)	SOIL MORPHOLOGY (.1941) .1941 STRUCTURE/ TEXTURE	.1941 CONSISTENCE/ MINERALOGY	OTHER PROFILE FACTORS .1942 SOIL WETNESS/ COLOR	.1943 SOIL DEPTH	.1956 SAPRO CLASS	.1944 RESTR HORIZ	PROFILE CLASS & LTAR
1	~6%	0-18	mfsbk, rc	frsssp sop					.3
		18-35	m-wk fsbk rcl	frsssp					
		35-54	(B-C) wk fsbk ry scl	frsssp common-mdsap					
2		0-2	gr drn sl	frsssp					.3
		2-18	wk-m fsbk rc	fr sp sop					
		18-36	wk fsbk R-yrd	frsssp few mdsap					
		36-60	(B-C) wk fsbk-mbk gy-ry l	frsssp common-many mdsap					
3									
4									

DESCRIPTION	INITIAL SYSTEM	REPAIR SYSTEM
Available Space (.1945)	PS	PS per 1956
System Type(s)	Gm-25% Red	LPP PPBPS
Site LTAR	.3	.3

OTHER FACTORS (.1946): _____
SITE CLASSIFICATION (.1948): PS
EVALUATED BY: DKT
OTHER(S) PRESENT: Paul Pennington

COMMENTS: _____


Pm 25% Reduction
w/ LP PRPS Septic
SE 80-90 Initial
130'
130'
212'
805
790
800
810
820
825
830
835
840
845
Basement
Bdr
29
Crawl
0.88 Ac.
288'
300'
DRIVE
30
0.85 Ac.
281'
Bdr
60x80
31
0.87 Ac.
35' FRONT YARD SETBACK
130'
130'
62'
31'
8' 22'
FH
44'
300'
YARD SETBACK
37
1.07 Ac.
9' 22'
16' 22'
40'
24'
22'
109'
CYPRESS CR
45'