DEPARTMENT OF ENVIRONMENT AND NATURAL RESOURCES
DIVISION OF ENVIRONMENTAL HEALTH
ON-SITE WASTEWATER SECTION

Sheet ___ of ___
PROPERTY ID #: _____
COUNTY: _____

SOIL/SITE EVALUATION
for ON-SITE WASTEWATER SYSTEM

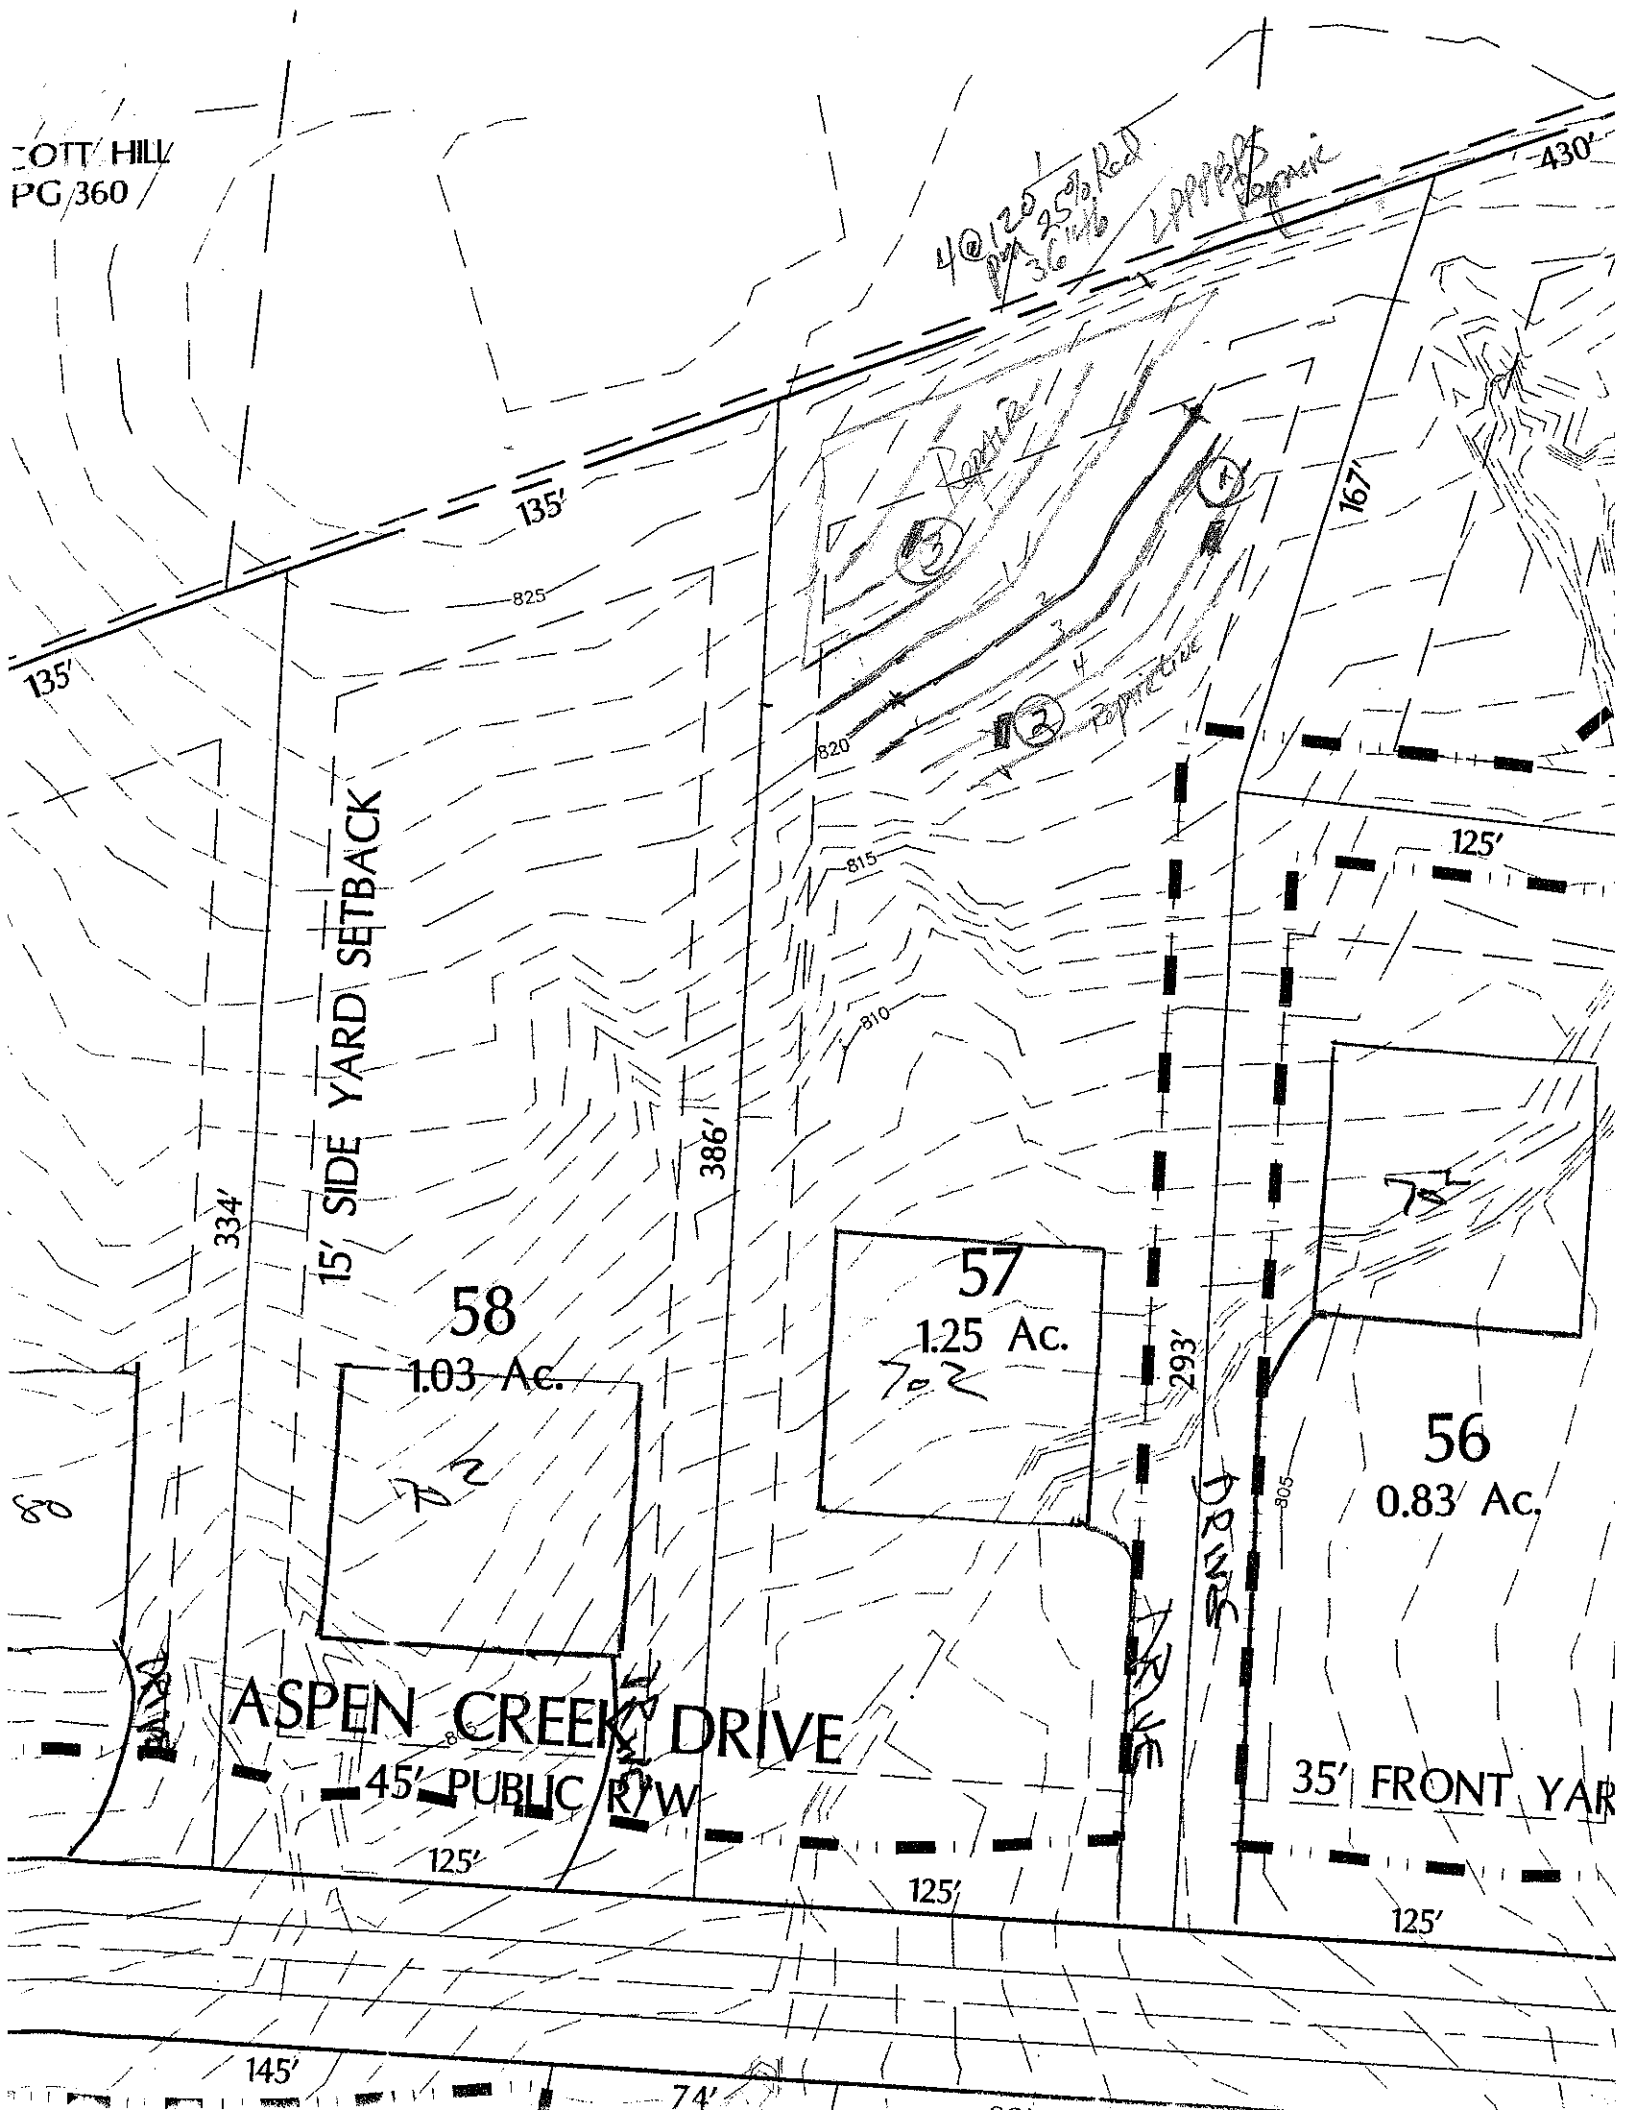
OWNER: CRI APPLICATION DATE _____
ADDRESS: _____
PROPOSED FACILITY: _____ PROPOSED DESIGN FLOW (.1949): 4BR gpd DATE EVALUATED: 4-17-03
LOCATION OF SITE: lot 57 Lakefrost PROPERTY SIZE: _____
WATER SUPPLY: ☐ Private ☐ Public ☒ Well ☐ Spring ☐ Other _____ PROPERTY RECORDED: _____
EVALUATION METHOD: ☐ Auger Boring ☒ Pit ☐ Cut
TYPE OF WASTEWATER: ☒ Sewage ☐ Industrial Process ☐ Mixed

PROFILE #	.1940 LANDSCAPE POSITION/ SLOPE %	HORIZON DEPTH (IN.)	SOIL MORPHOLOGY (.1941) .1941 STRUCTURE/ TEXTURE	SOIL MORPHOLOGY (.1941) .1941 CONSISTENCE/ MINERALOGY	OTHER PROFILE FACTORS .1942 SOIL WETNESS/ COLOR	.1943 SOIL DEPTH	.1956 SAPRO CLASS	.1944 RESTR HORIZ	PROFILE CLASS & LTAR
1		0-10	gr brsl	fr ss sp					.25 to 36" 2444
		10-36	sl gr sbk pgfl	fr sp					
			8" water in pit bottom						
2	2%	0-4	gr brsl	fr ss sp					.2<30 -37>30
		4-30	m f sbk RC	fr sp common many p bounded					
		30-57	wk f sbk yel fine ss sp						
3		0-7	gr sl	fr ss sp					.2<30 .37>30
		7-30	m f sbk c	fr sp common p boundaries					
		30-52	wk f sbk cl	fr ss sp					
4									

DESCRIPTION	INITIAL SYSTEM	REPAIR SYSTEM
Available Space (.1945)	PS	PS per .1956
System Type(s)	Dm 25% Red	LPP BPS
Site LTAR	.25	.2 - .25

OTHER FACTORS (.1946): _____
SITE CLASSIFICATION (.1948): PS
EVALUATED BY: DRH
OTHER(S) PRESENT: Paul Pennington

COMMENTS: _____


SCOTT HILL
PG/360
135'
135'
825
820
815
810
805
430'
167'
125'
386'
334'
15' SIDE YARD SETBACK
58
1.03 Ac.
57
1.25 Ac.
56
0.83 Ac.
293'
ASPEN CREEK DRIVE
45' PUBLIC R/W
35' FRONT YAR
125'
125'
125'
145'
74'