DEPARTMENT OF ENVIRONMENT AND NATURAL RESOURCES
DIVISION OF ENVIRONMENTAL HEALTH
ON-SITE WASTEWATER SECTION

Sheet ___ of ___
PROPERTY ID #: _____
COUNTY: _____

SOIL/SITE EVALUATION
for ON-SITE WASTEWATER SYSTEM

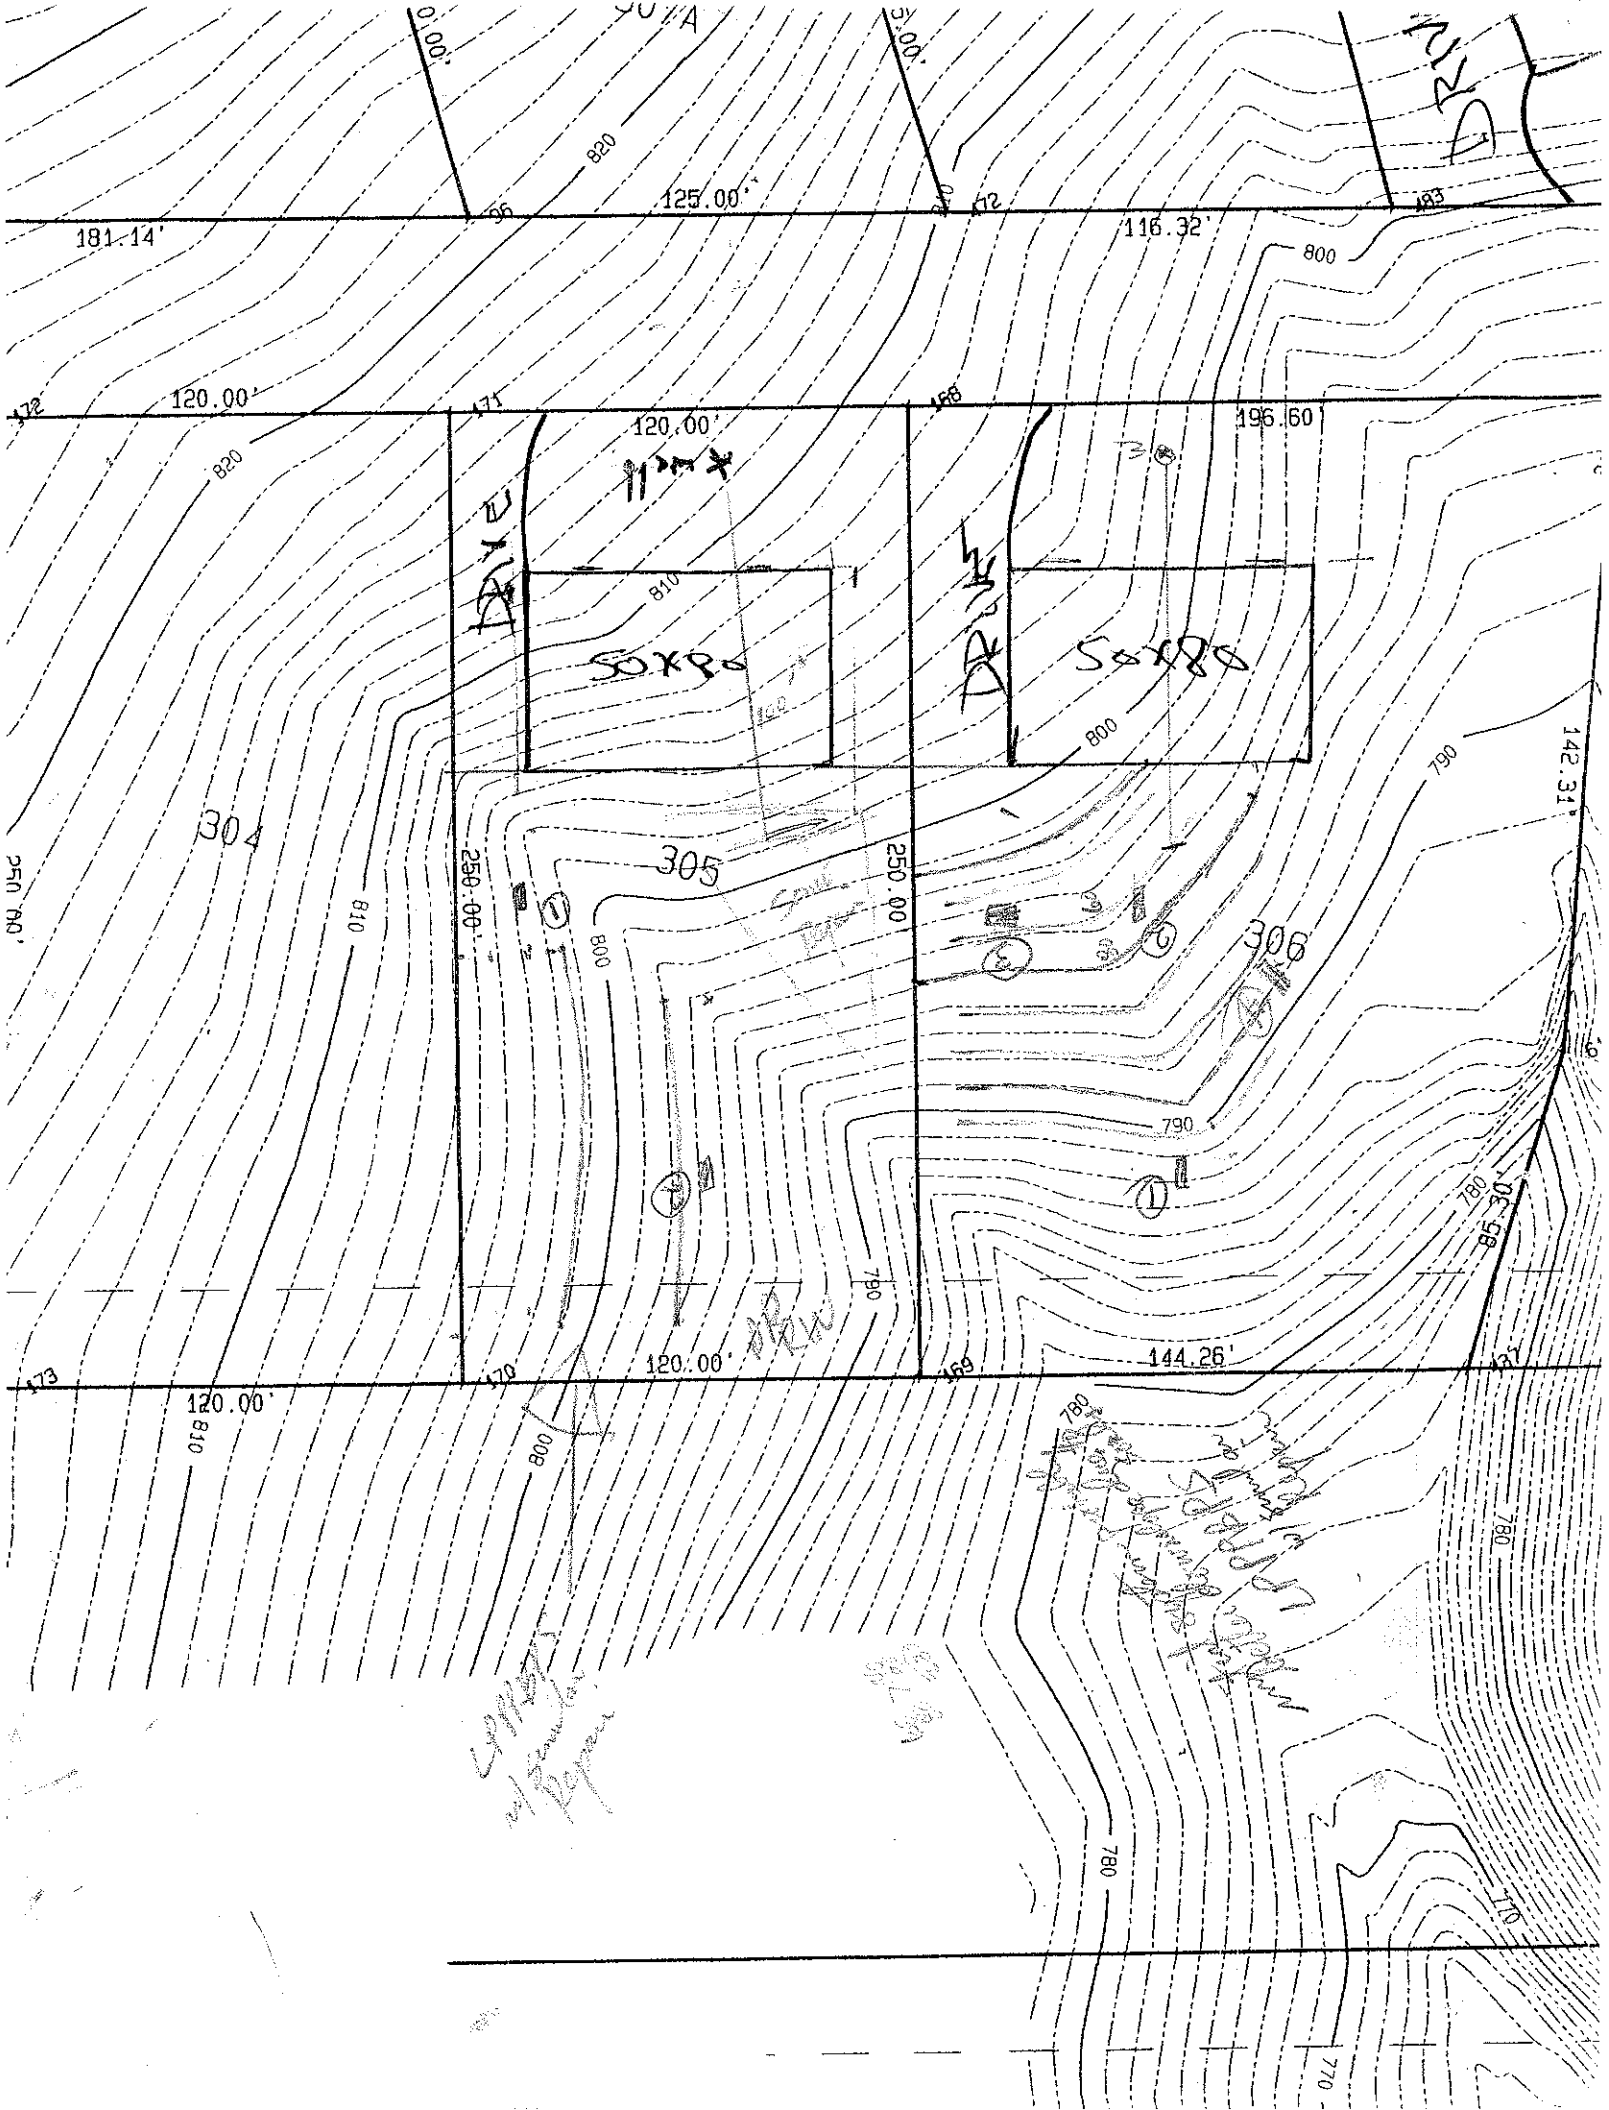
OWNER: _____ APPLICATION DATE _____
ADDRESS: _____ DATE EVALUATED: 8-26-02
PROPOSED FACILITY: _____ PROPOSED DESIGN FLOW (.1949): _____ PROPERTY SIZE: _____
LOCATION OF SITE: Lot 306 Shoreline Bluffs PROPERTY RECORDED: _____
WATER SUPPLY: ☐ Private ☐ Public ☐ Well ☐ Spring ☐ Other _____
EVALUATION METHOD: ☐ Auger Boring ☐ Pit ☐ Cut
TYPE OF WASTEWATER: ☐ Sewage ☐ Industrial Process ☐ Mixed Dig 2 maps

PROFILE #	.1940 LANDSCAPE POSITION/ SLOPE %	HORIZON DEPTH (IN.)	SOIL MORPHOLOGY (.1941) .1941 STRUCTURE/ TEXTURE	SOIL MORPHOLOGY (.1941) .1941 CONSISTENCE/ MINERALOGY	OTHER PROFILE FACTORS .1942 SOIL WETNESS/ COLOR	.1943 SOIL DEPTH	.1956 SAPRO CLASS	.1944 RESTR HORIZ	PROFILE CLASS & LTAR
1		0-4	gr fr sl	fr ss sp					
		4-30	msbk rc	fi sp					.3
		30-53	m sbk yr cl	fr ss sp					
			few-common intrusive rock						
			fr mn l sp						
2		0-4	sl gr sl	fr ss sp					
		4-29	sbk rd cl	fr ss sp ss sp					.2
		29-51	sb rc	fi sp					
					common rock on the surface common granite outcrops also appear on the adjacent property				
3		0-9	m sbk fr sl sl	fr ss sp					
		9-43	m sbk fr rc	fi sp ss sp					.25
				fair/poor bluff face					
4		0-6	gr fr sl sl	fi fr ss sp					
		6-45	m sbk rd cl	fi sp ss sp					.25-.3
			fr mn l sp						

DESCRIPTION	INITIAL SYSTEM	REPAIR SYSTEM
Available Space (.1945)		
System Type(s)		
Site LTAR		

OTHER FACTORS (.1946): _____
SITE CLASSIFICATION (.1948): _____
EVALUATED BY: _____
OTHER(S) PRESENT: _____

COMMENTS: Initial system to be installed on site (below bluff) due to better soils


125.00'
181.14'
116.32'
120.00'
120.00'
196.60'
50x80
50x80
304
305
306
250.00'
250.00'
142.31'
120.00'
144.26'
120.00'
820
810
800
790
780
770