DEPARTMENT OF ENVIRONMENT AND NATURAL RESOURCES
DIVISION OF ENVIRONMENTAL HEALTH
ON-SITE WASTEWATER SECTION

Sheet ___ of ___
PROPERTY ID #: _____
COUNTY: _____

SOIL/SITE EVALUATION
for ON-SITE WASTEWATER SYSTEM

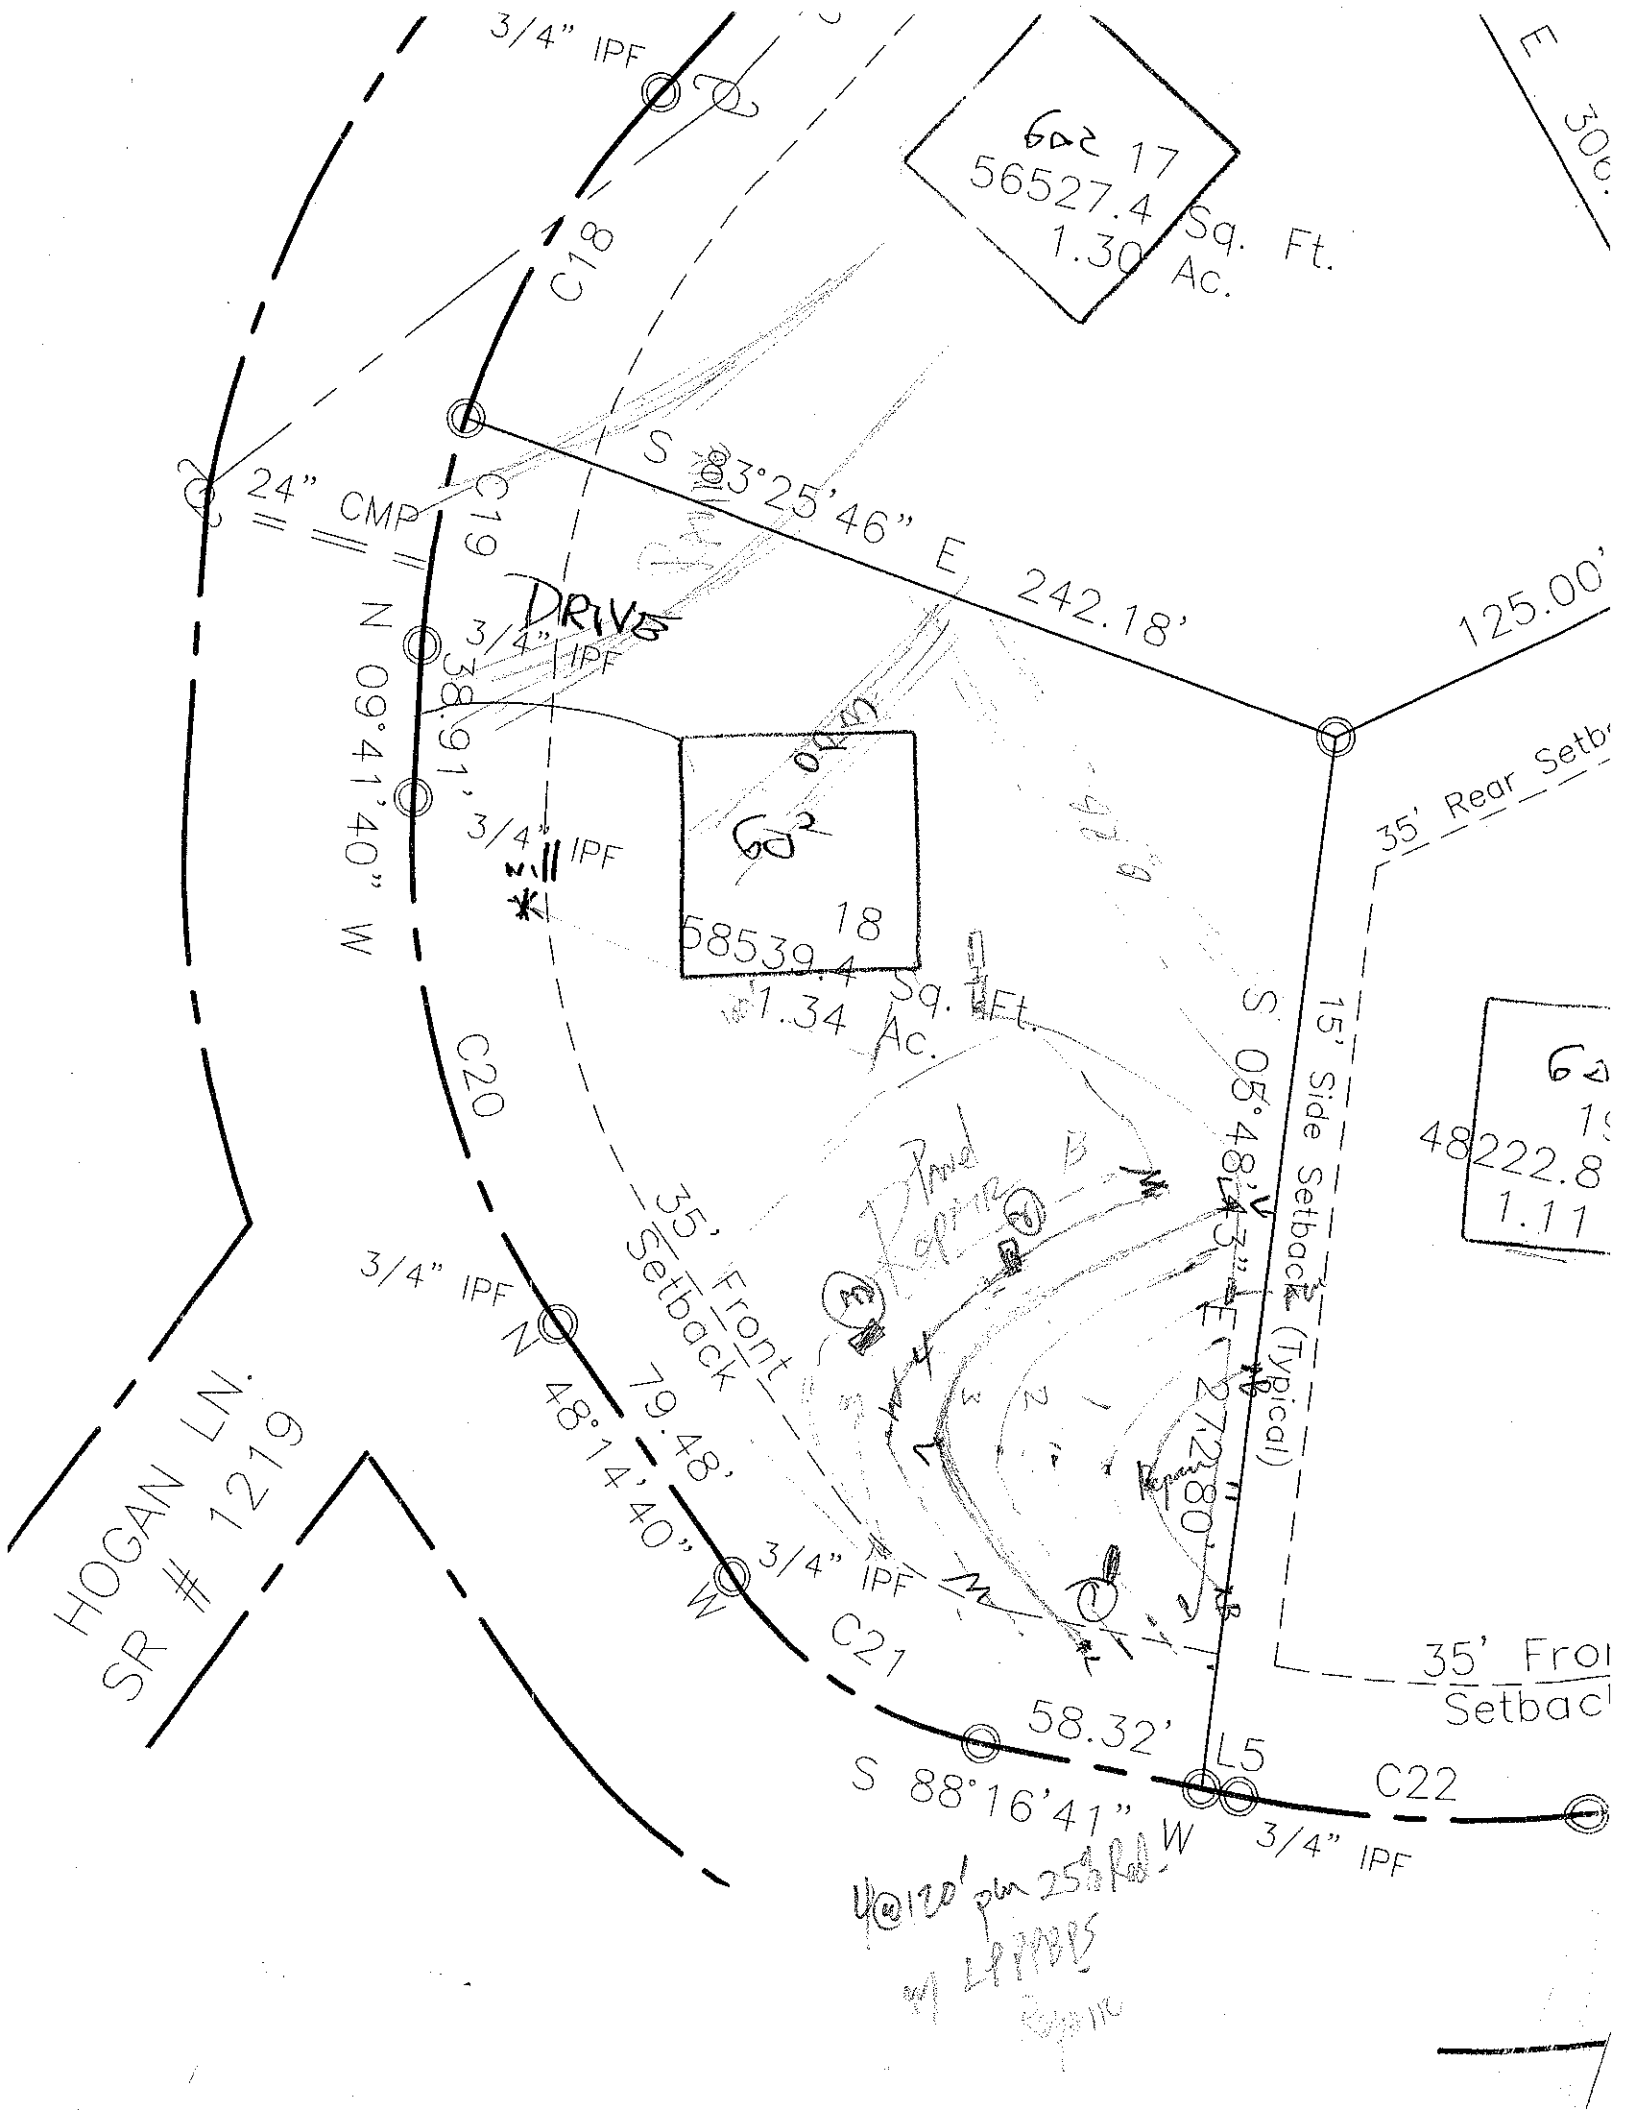
OWNER: _____ APPLICATION DATE _____
ADDRESS: _____
PROPOSED FACILITY: _____ PROPOSED DESIGN FLOW (.1949): 4 bedroom DATE EVALUATED: 7-30-03
LOCATION OF SITE: Lot 18 Green Bay PROPERTY SIZE: _____
WATER SUPPLY: ☒ Private ☐ Public ☒ Well ☐ Spring ☐ Other _____ PROPERTY RECORDED: _____
EVALUATION METHOD: ☐ Auger Boring ☒ Pit ☐ Cut
TYPE OF WASTEWATER: ☒ Sewage ☐ Industrial Process ☐ Mixed

PROFILE #	.1940 LANDSCAPE POSITION/ SLOPE %	HORIZON DEPTH (IN.)	SOIL MORPHOLOGY (.1941) .1941 STRUCTURE/ TEXTURE	SOIL MORPHOLOGY (.1941) .1941 CONSISTENCE/ MINERALOGY	OTHER PROFILE FACTORS .1942 SOIL WETNESS/ COLOR	.1943 SOIL DEPTH	.1956 SAPRO CLASS	.1944 RESTR HORIZ	PROFILE CLASS & LTAR
1		0-6	gr-wkSBK fr ws sl/scl	fr SSSP					.12-.25 ×3
		6-26	m/f SBK RC	fr SP	common brown mottles				
		26-57	wk f SBK RCl	fr SSSP					
									mod act .25
2		0-11	gr fr sl	fr SSSP					.3
		11-24	m/f SBK RC	fr SP SSSP					
		24-55	(R)wk f SBK R-yp cl	fr SSSP	few common iron stg				
3		0-48	rc/cl	fi fr SP-SSSP	few-common iron stg				.3
			too close to yellow jacket nest						
4									

DESCRIPTION	INITIAL SYSTEM	REPAIR SYSTEM
Available Space (.1945)	PS	PS
System Type(s)	Trench 25% Red.	Trench 25-50% Red.
Site LTAR	.25-.3	.25-.3

OTHER FACTORS (.1946): _____
SITE CLASSIFICATION (.1948): PS
EVALUATED BY: DRH
OTHER(S) PRESENT: Paul Pennington

COMMENTS: _____


3/4" IPF
Lot 17
56527.4 Sq. Ft.
1.30 Ac.
C18
24" CMP
C19
S 83°25'46" E 242.18'
125.00'
DRIVE
3/4" IPF
N 09°41'40" W
381.91'
3/4" IPF
Lot 18
58539.4 Sq. Ft.
1.34 Ac.
35' Rear Setback
15' Side Setback (Typical)
S 05°48'43" E 272.80'
C20
35' Front Setback
3/4" IPF
N 48°14'40" W
79.48'
3/4" IPF
C21
58.32'
L5
C22
S 88°16'41" W
3/4" IPF
HOGAN LN.
SR # 1219
Proposed Building
Repeat
35' Front Setback