DEPARTMENT OF ENVIRONMENT AND NATURAL RESOURCES
DIVISION OF ENVIRONMENTAL HEALTH
ON-SITE WASTEWATER SECTION

Sheet ___ of ___
PROPERTY ID #: _____
COUNTY: _____

SOIL/SITE EVALUATION
for ON-SITE WASTEWATER SYSTEM

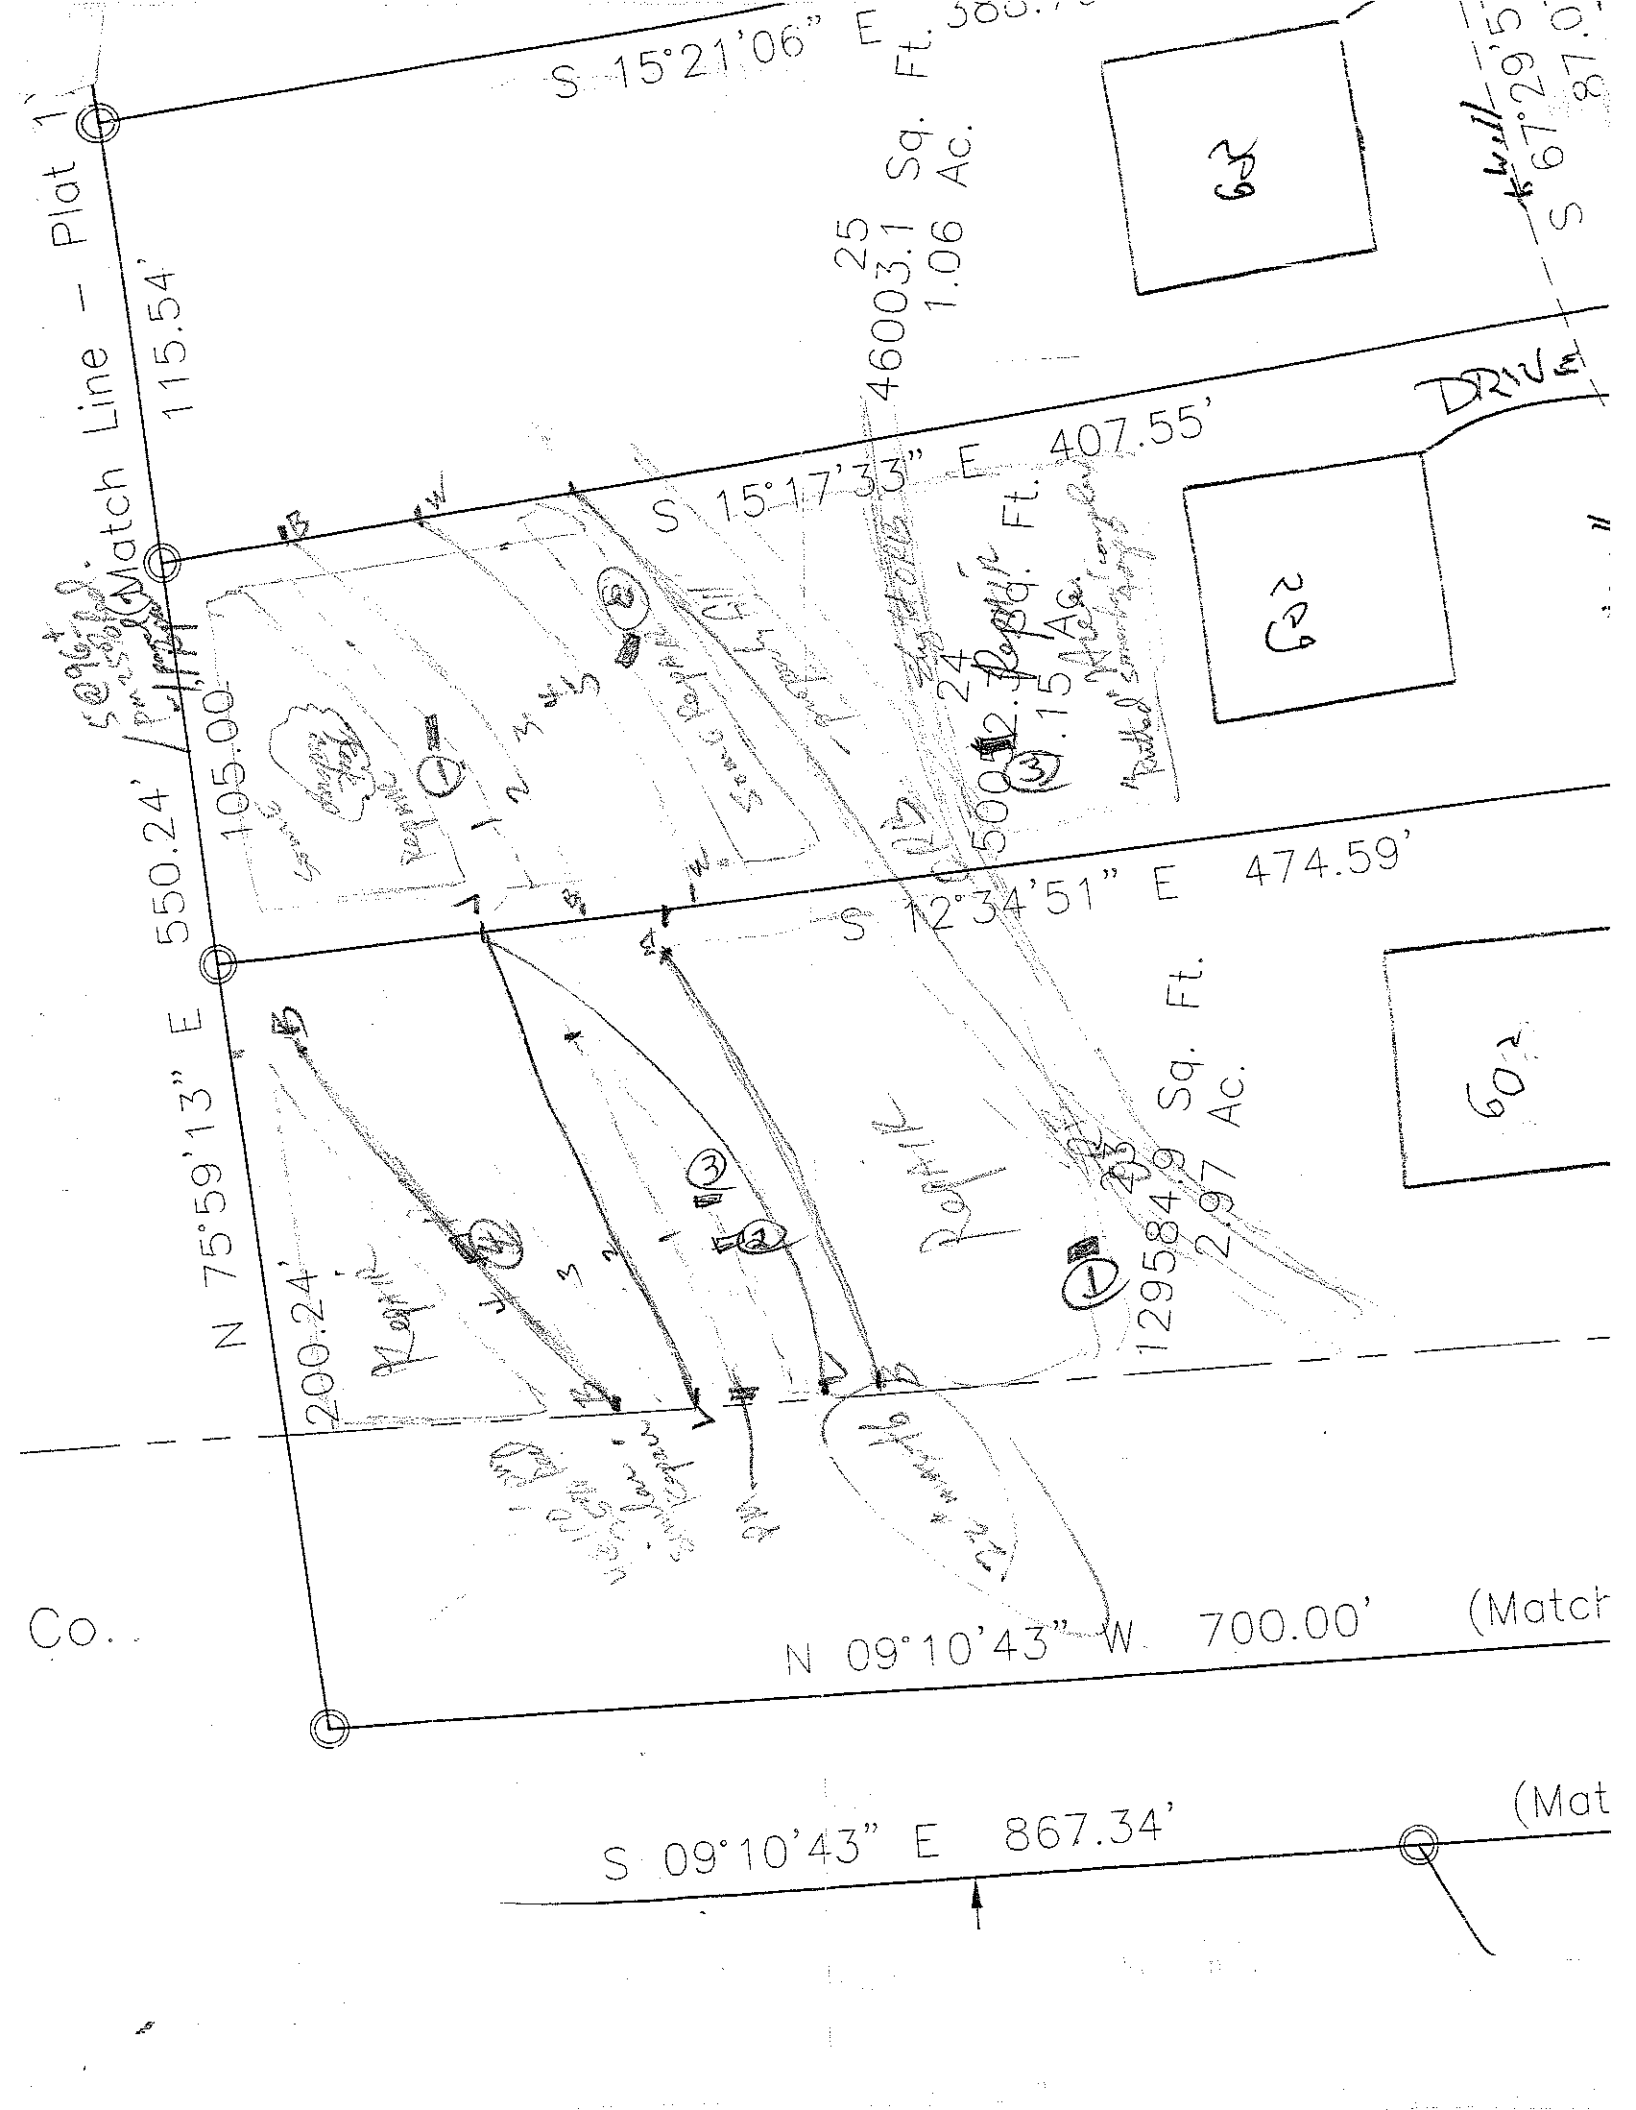
OWNER: _____ APPLICATION DATE _____
ADDRESS: _____
PROPOSED FACILITY: _____ PROPOSED DESIGN FLOW (.1949): 480gpd DATE EVALUATED: 8-7-03
LOCATION OF SITE: Lot 24 GREENBAY PROPERTY SIZE: _____
WATER SUPPLY: ☒ Private ☐ Public ☒ Well ☐ Spring ☐ Other _____ PROPERTY RECORDED: _____
EVALUATION METHOD: ☐ Auger Boring ☒ Pit ☐ Cut
TYPE OF WASTEWATER: ☒ Sewage ☐ Industrial Process ☐ Mixed

PROFILE #	.1940 LAND-SCAPE POSITION/ SLOPE %	HORI-ZON DEPTH (IN.)	SOIL MORPHOLOGY (.1941) .1941 STRUCTURE/ TEXTURE	SOIL MORPHOLOGY (.1941) .1941 CONSISTENCE/ MINERALOGY	OTHER PROFILE FACTORS .1942 SOIL WETNESS/ COLOR	.1943 SOIL DEPTH	.1956 SAPRO CLASS	.1944 RESTR HORIZ	PROFILE CLASS & LTAR
1		0-11	gr sa bans L	fr ss sp					.3
		11-30	wk fsbk yr sch	fr ss sp					
		30-51	massive yr sl ss	fr ss sp					
2		0-15	gr sa bans L	fr ss sp	very poorly drained				~~.4~~ .2 .3
		15-37	m fsbk yr cl	fr ss sp					
		37-55	wk fsbk yr cl	fr ss sp					
3		0-9	gr wk fsbk sch	fr ss sp	few common yellowish brown mottles				.25
		9-30/41	wk fsbk sa sch	fr ss sp					
		30/41-51	massive sl ss sp	fr ss sp					
4									

DESCRIPTION	INITIAL SYSTEM	REPAIR SYSTEM
Available Space (.1945)	RS	RS
System Type(s)	25% Red	25% Red
Site LTAR	.25	.25

OTHER FACTORS (.1946): _____
SITE CLASSIFICATION (.1948): RS
EVALUATED BY: DGH
OTHER(S) PRESENT: Paul Hennington

COMMENTS: _____


S 15°21'06" E
Match Line – Plat 1
115.54'
25
46003.1 Sq. Ft.
1.06 Ac.
S 67°29'55"
87.0'
DRIVE
S 15°17'33" E 407.55'
105.00'
550.24'
N 75°59'13" E
S 12°34'51" E 474.59'
200.24'
20 ft. R
12958.4 Sq. Ft.
2.97 Ac.
N 09°10'43" W 700.00'
S 09°10'43" E 867.34'
Co.
(Match