DEPARTMENT OF ENVIRONMENT AND NATURAL RESOURCES
DIVISION OF ENVIRONMENTAL HEALTH
ON-SITE WASTEWATER SECTION

Sheet ___ of ___
PROPERTY ID #: _____
COUNTY: _____

SOIL/SITE EVALUATION
for ON-SITE WASTEWATER SYSTEM

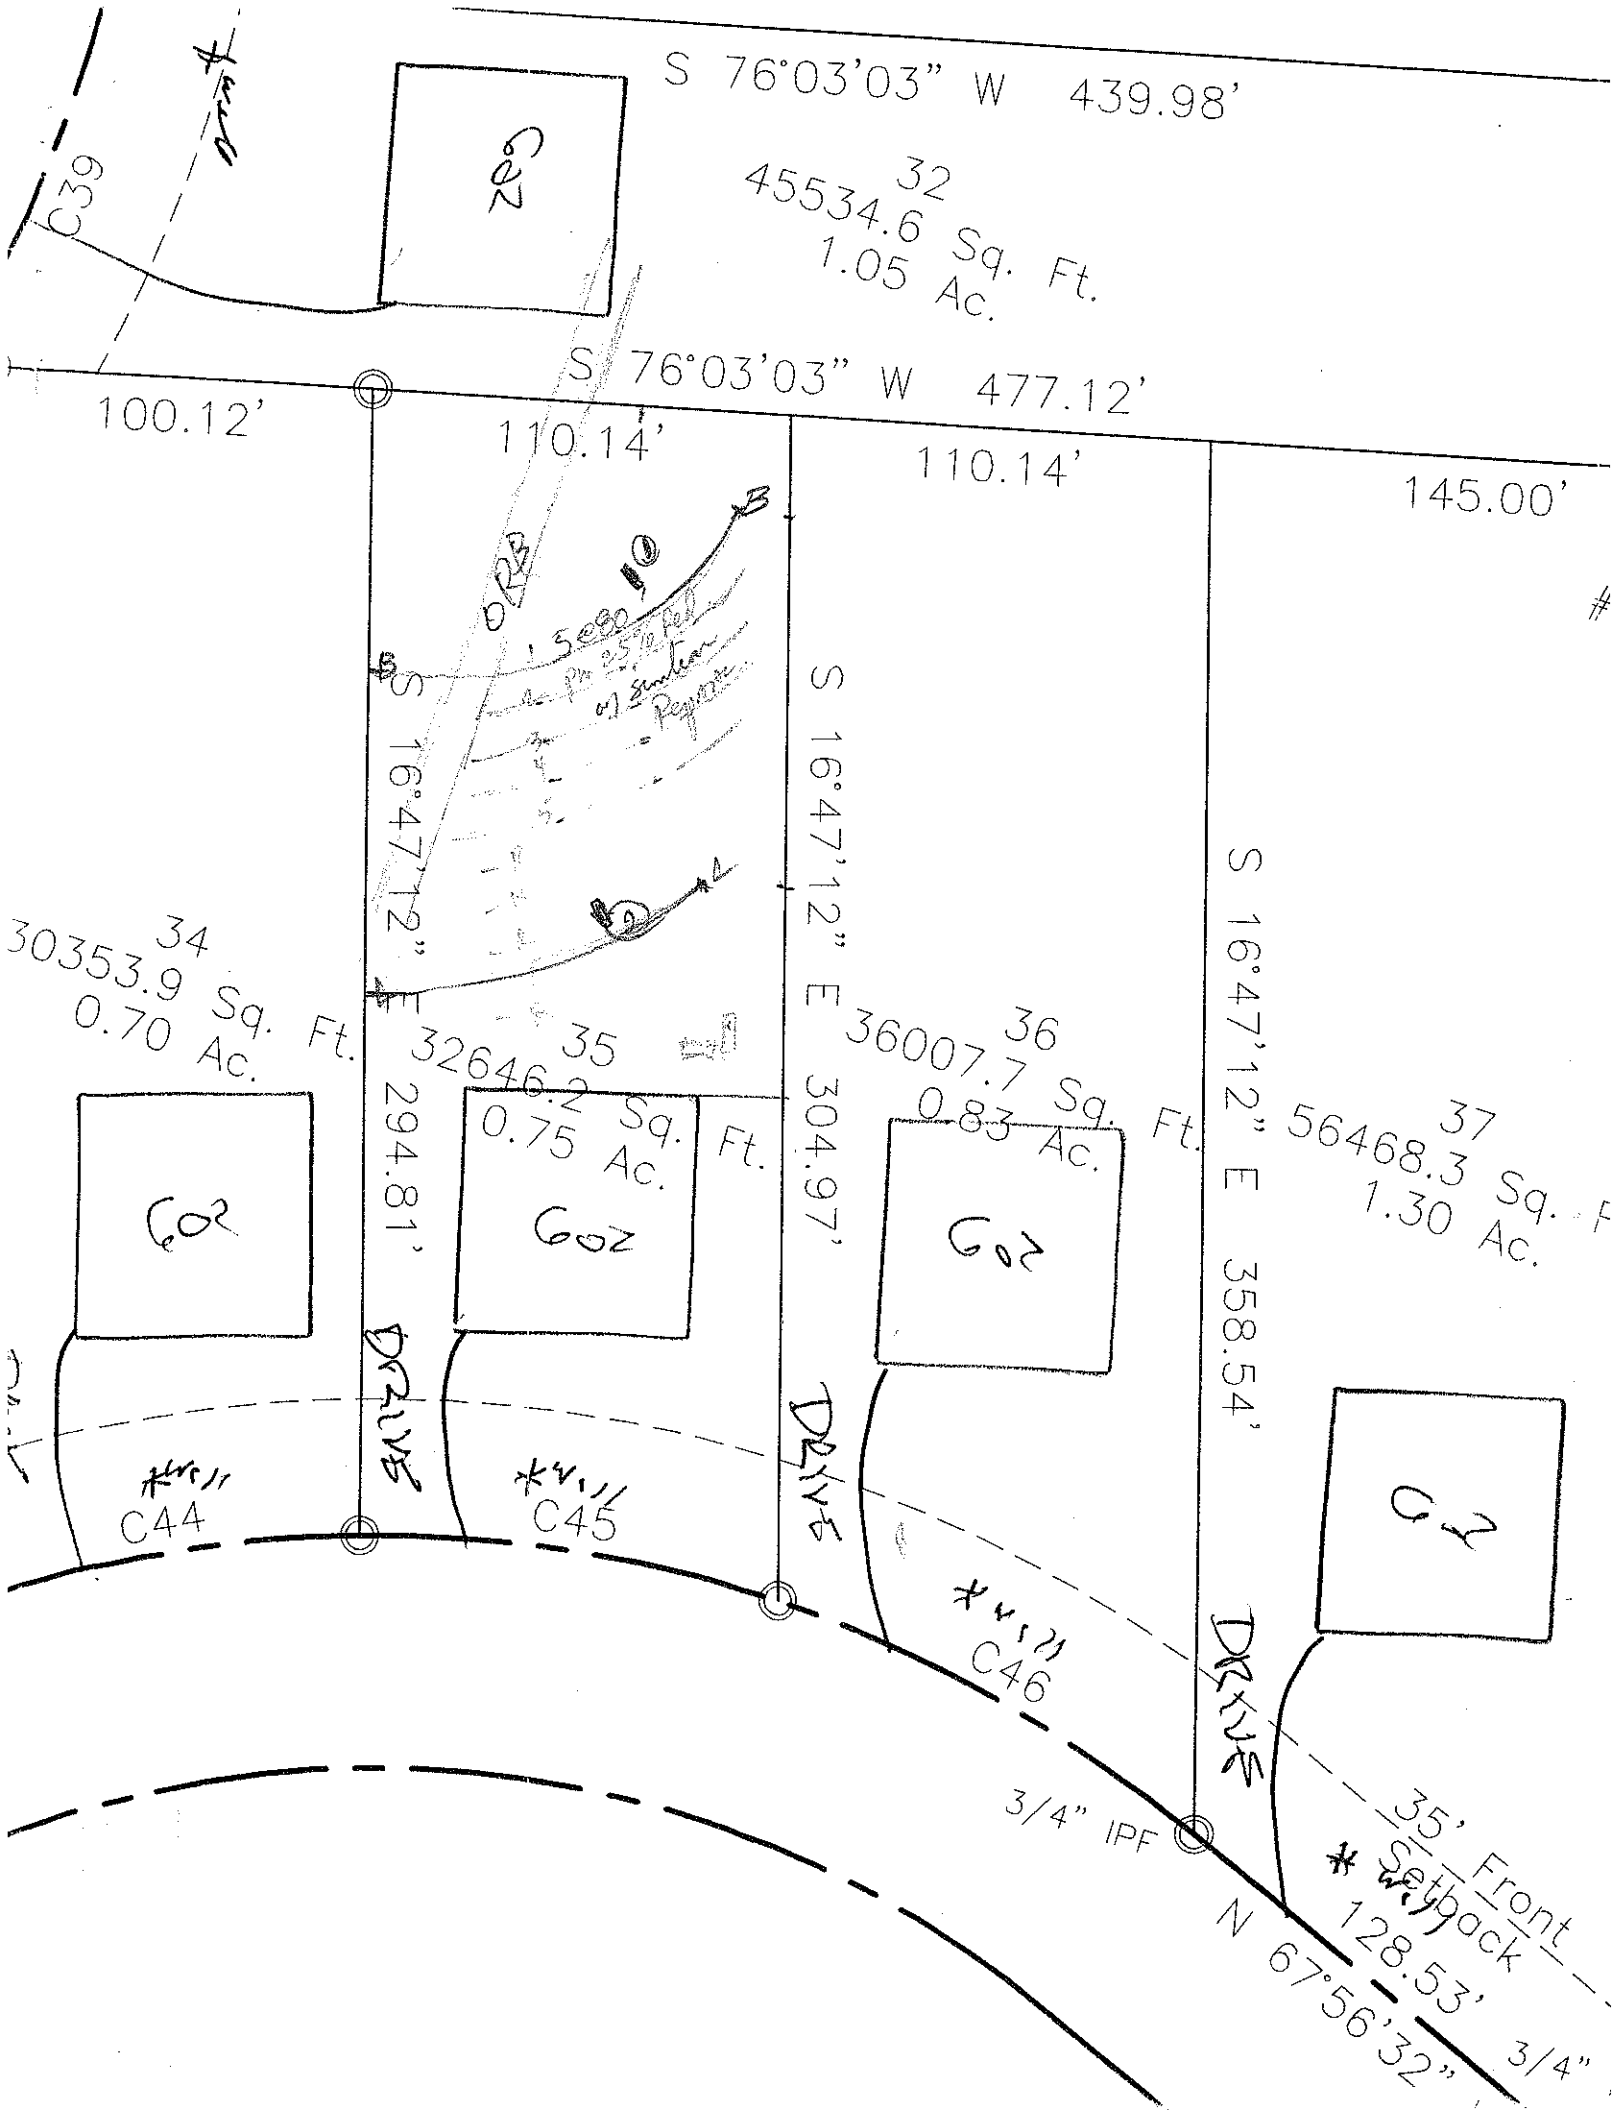
OWNER: _____ APPLICATION DATE _____
ADDRESS: _____ DATE EVALUATED: 8-7-03
PROPOSED FACILITY: _____ PROPOSED DESIGN FLOW (.1949): 480 gpd PROPERTY SIZE: _____
LOCATION OF SITE: Lot 35 Greenway PROPERTY RECORDED: _____
WATER SUPPLY: ☒ Private ☐ Public ☐ Well ☐ Spring ☐ Other _____
EVALUATION METHOD: ☐ Auger Boring ☒ Pit ☐ Cut
TYPE OF WASTEWATER: ☒ Sewage ☐ Industrial Process ☐ Mixed

PROFILE #	.1940 LAND-SCAPE POSITION/ SLOPE %	HORI-ZON DEPTH (IN.)	SOIL MORPHOLOGY (.1941) .1941 STRUCTURE/ TEXTURE	SOIL MORPHOLOGY (.1941) .1941 CONSISTENCE/ MINERALOGY	OTHER PROFILE FACTORS .1942 SOIL WETNESS/ COLOR	.1943 SOIL DEPTH	.1956 SAPRO CLASS	.1944 RESTR HORIZ	PROFILE CLASS & LTAR
1	10%	0-7	gr fri sdl	fr sss p					
		7-35	M sbk RC	fr-fr sp sso	fair mod sap/yellow mottles p m.				.3
		35-50	wk sbk yel	fr sss p fair	common mod sap				
2		0-6	gr wk sbk bar	sl/scl fr sss p					
		6-24	mfsbk RC	fr sp. sss p so p					.3
		24-49	(RC) wk sbk yel	fr fr sss p	few mod mottles fine sap				
3									
4									

DESCRIPTION	INITIAL SYSTEM	REPAIR SYSTEM
Available Space (.1945)	PS	PS
System Type(s)	Pon 25% Rd.	Pon 25% Rd
Site LTAR	.3	.3

OTHER FACTORS (.1946): _____
SITE CLASSIFICATION (.1948): PS
EVALUATED BY: DLH
OTHER(S) PRESENT: Paul Brunson

COMMENTS: _____


S 76°03'03" W 439.98'
32
45534.6 Sq. Ft.
1.05 Ac.
C39
G2
S 76°03'03" W 477.12'
100.12'
110.14'
110.14'
145.00'
S 16°47'12" E 294.81'
S 16°47'12" E 304.97'
S 16°47'12" E 358.54'
34
30353.9 Sq. Ft.
0.70 Ac.
35
32646.2 Sq. Ft.
0.75 Ac.
36
36007.7 Sq. Ft.
0.83 Ac.
37
56468.3 Sq. Ft.
1.30 Ac.
G2
G2
G2
G2
DRIVE
DRIVE
DRIVE
DRIVE
C44
C45
C46
3/4" IPF
35' Front Setback
N 67°56'32" E
128.53'
3/4"