DEPARTMENT OF ENVIRONMENT AND NATURAL RESOURCES
DIVISION OF ENVIRONMENTAL HEALTH
ON-SITE WASTEWATER SECTION

Sheet ____ of ____
PROPERTY ID #: ____
COUNTY: ____

SOIL/SITE EVALUATION
for ON-SITE WASTEWATER SYSTEM


OWNER: ____ APPLICATION DATE ____
ADDRESS: ____
PROPOSED FACILITY: ____ PROPOSED DESIGN FLOW (.1949): 480gpd DATE EVALUATED: 8-7-03
LOCATION OF SITE: lot 37 Green Way PROPERTY SIZE: ____
WATER SUPPLY: ☒ Private ☐ Public ☒ Well ☐ Spring ☐ Other ____ PROPERTY RECORDED: ____
EVALUATION METHOD: ☐ Auger Boring ☒ Pit ☐ Cut
TYPE OF WASTEWATER: ☒ Sewage ☐ Industrial Process ☐ Mixed

PROFILE #	.1940 LANDSCAPE POSITION/ SLOPE %	HORIZON DEPTH (IN.)	SOIL MORPHOLOGY (.1941) .1941 STRUCTURE/ TEXTURE	SOIL MORPHOLOGY (.1941) .1941 CONSISTENCE/ MINERALOGY	OTHER PROFILE FACTORS .1942 SOIL WETNESS/ COLOR	.1943 SOIL DEPTH	.1956 SAPRO CLASS	.1944 RESTR HORIZ	PROFILE CLASS & LTAR
1		0-4	gr brnsl	frssso					.4
		4-50	mfsbk	ry-ybrnsel frssso					
2	ridge N-S	0-9	gr brnsl	frssso					.3 / .25 → .25
		9-38	mfsbk RC	frssso SEXP					
		38-50	mfsbk yR C	frssso	few manganese coatings on ped faces				
3		0-5	gr brnsl	frssso					.25
		5-25	mfsbk RC	frso-bsso SEXP					
		25-55	m-wk fabk/sbk RBrn c/ch Fe-	frssso common manganese coatings					
4									

DESCRIPTION	INITIAL SYSTEM	REPAIR SYSTEM
Available Space (.1945)	PS	PS
System Type(s)	LPPPBPS	LPPPBPS
Site LTAR	.25	.25

OTHER FACTORS (.1946): ____
SITE CLASSIFICATION (.1948): PS
EVALUATED BY: DRH
OTHER(S) PRESENT: Paul Pennington

COMMENTS: ____

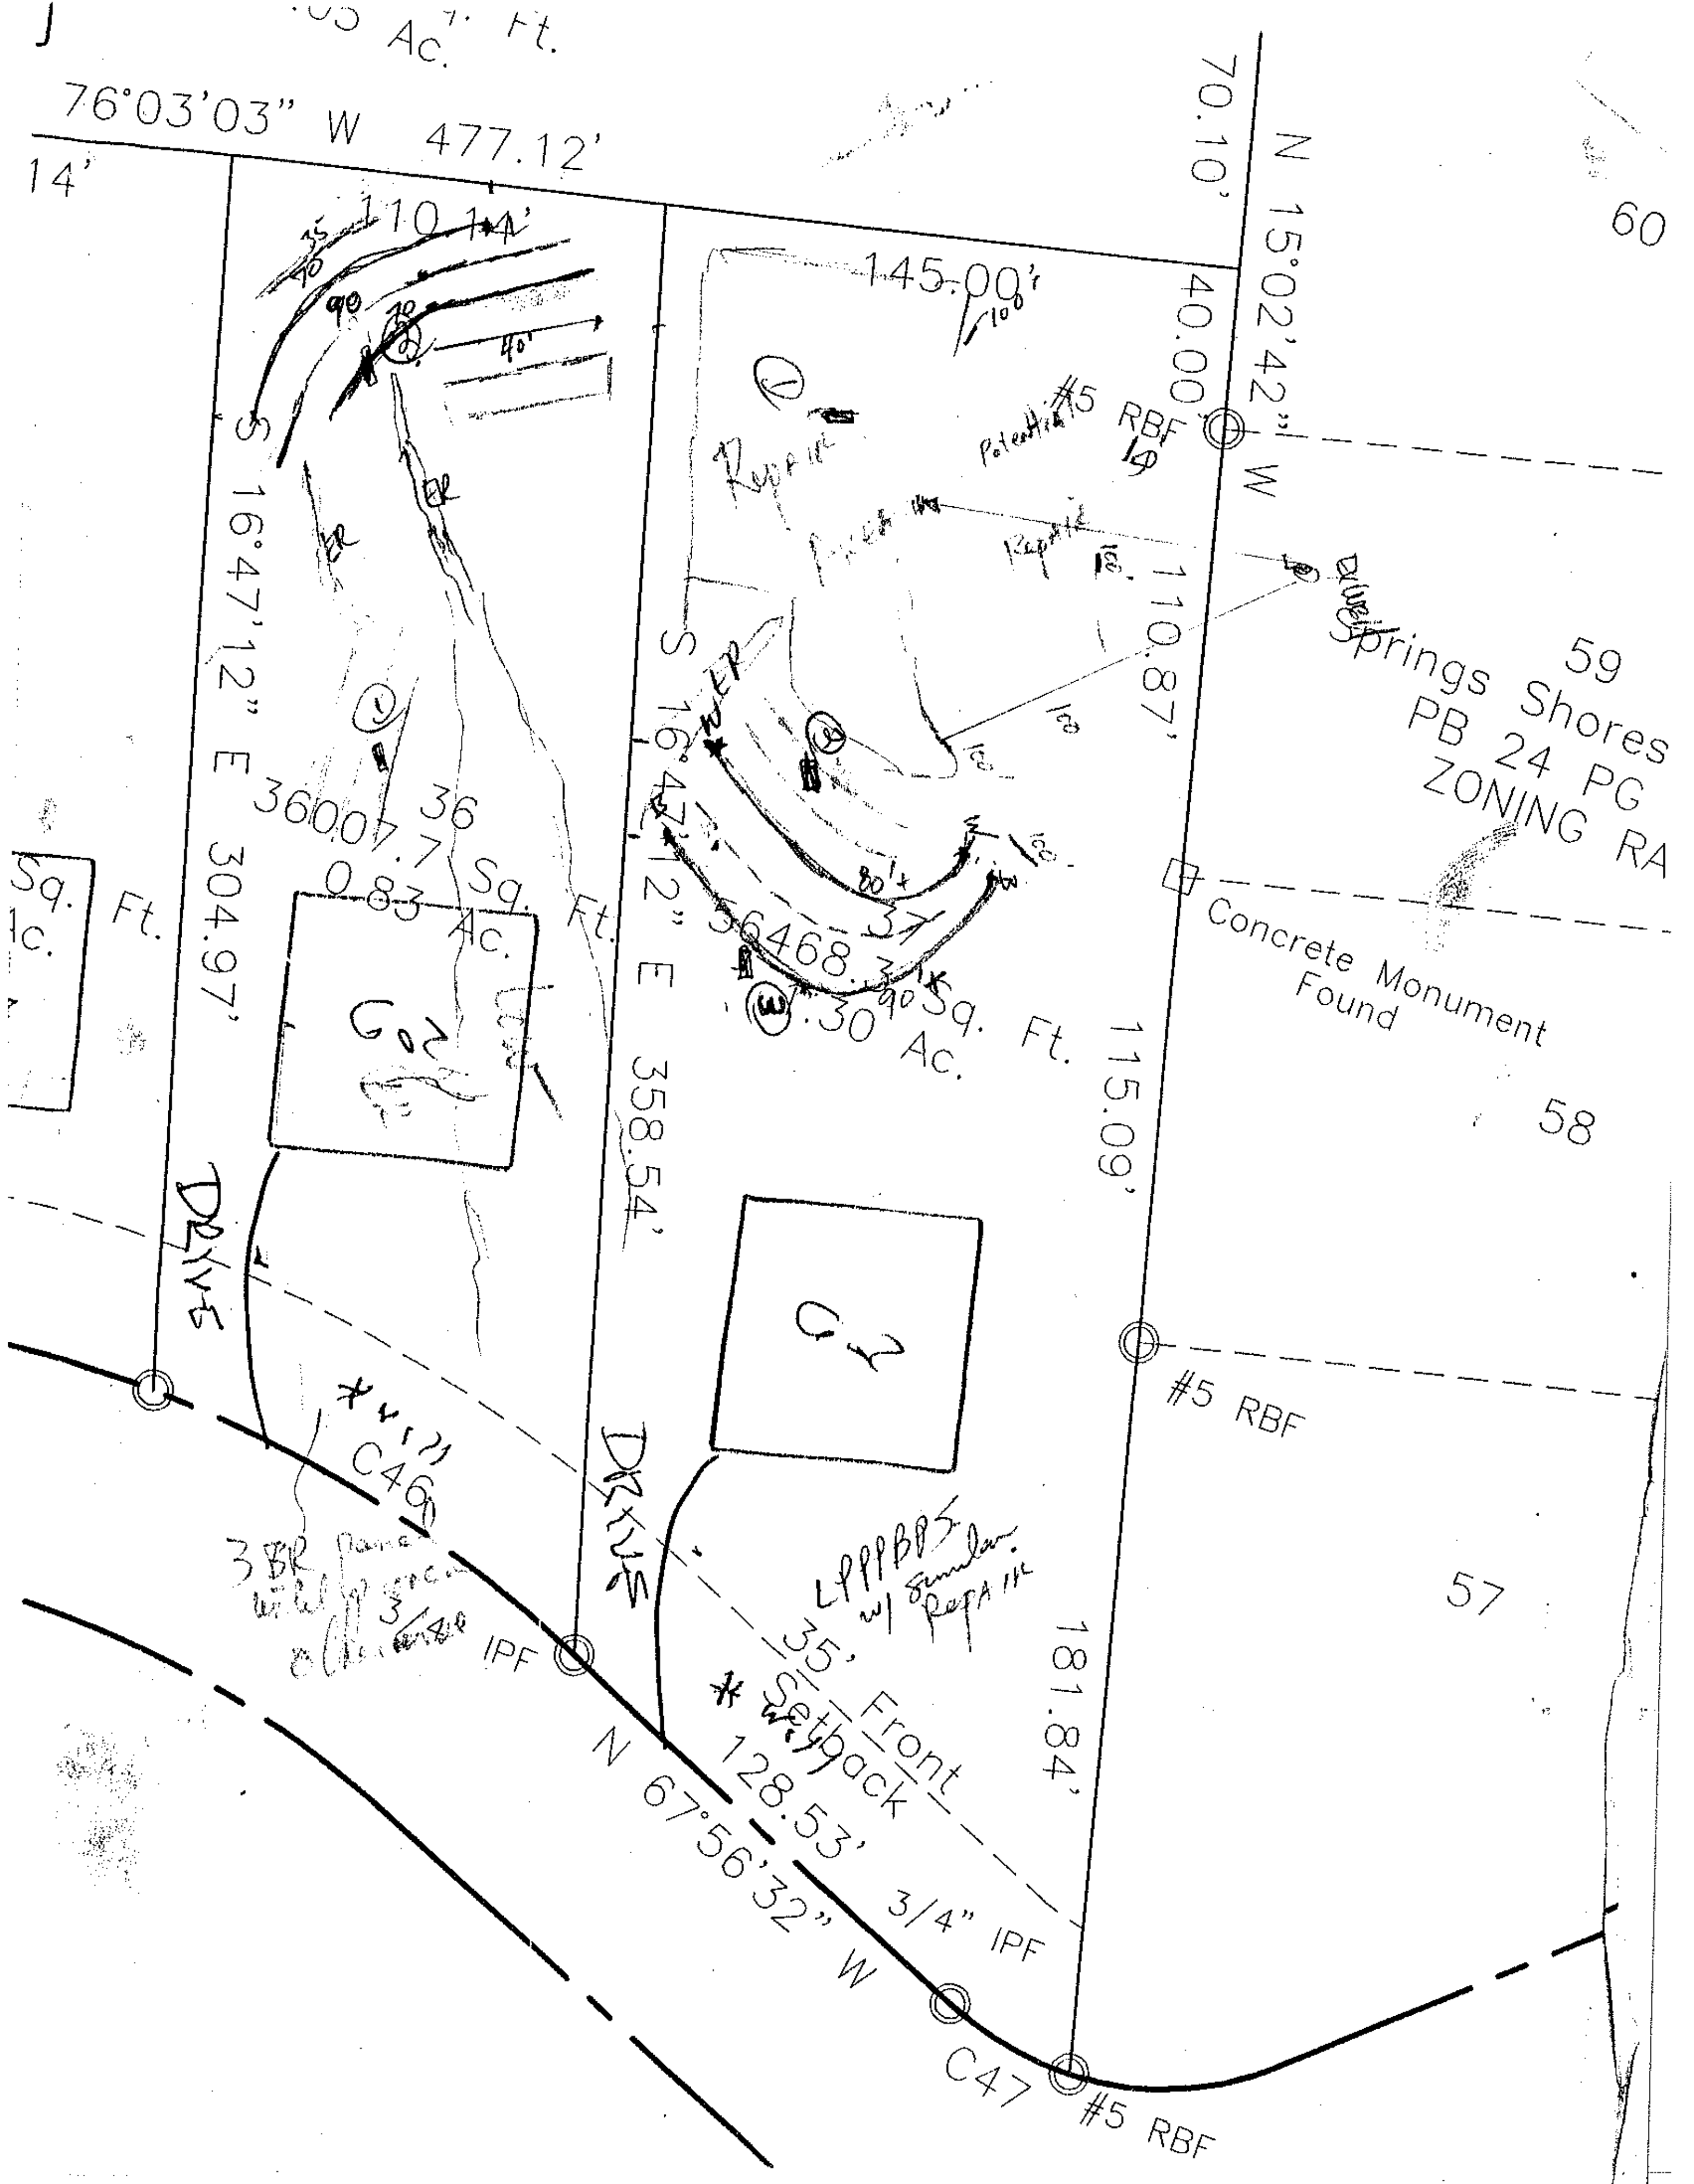

76°03'03" W 477.12'
14'
70.10'
N 15°02'42" W
40.00'
145.00'
#5 RBF
110.87'
S 16°47'12" E 360.07'
36007.7 Sq. Ft.
0.83 Ac.
304.97'
Sq. Ft.
S 16°47'12" E 358.54'
36468.3 Sq. Ft.
0.30 Ac.
115.09'
60
59
Springs Shores
PB 24 PG
ZONING RA
Concrete Monument Found
58
#5 RBF
57
C46
IPF
35' Front Setback
N 67°56'32" W 128.53'
181.84'
3/4" IPF
C47
#5 RBF