DEPARTMENT OF ENVIRONMENT, HEALTH, AND NATURAL RESOURCES
DIVISION OF ENVIRONMENTAL HEALTH
ON-SITE WASTEWATER SECTION

Sheet ___ of ___
PROPERTY ID #: _____
COUNTY: _____

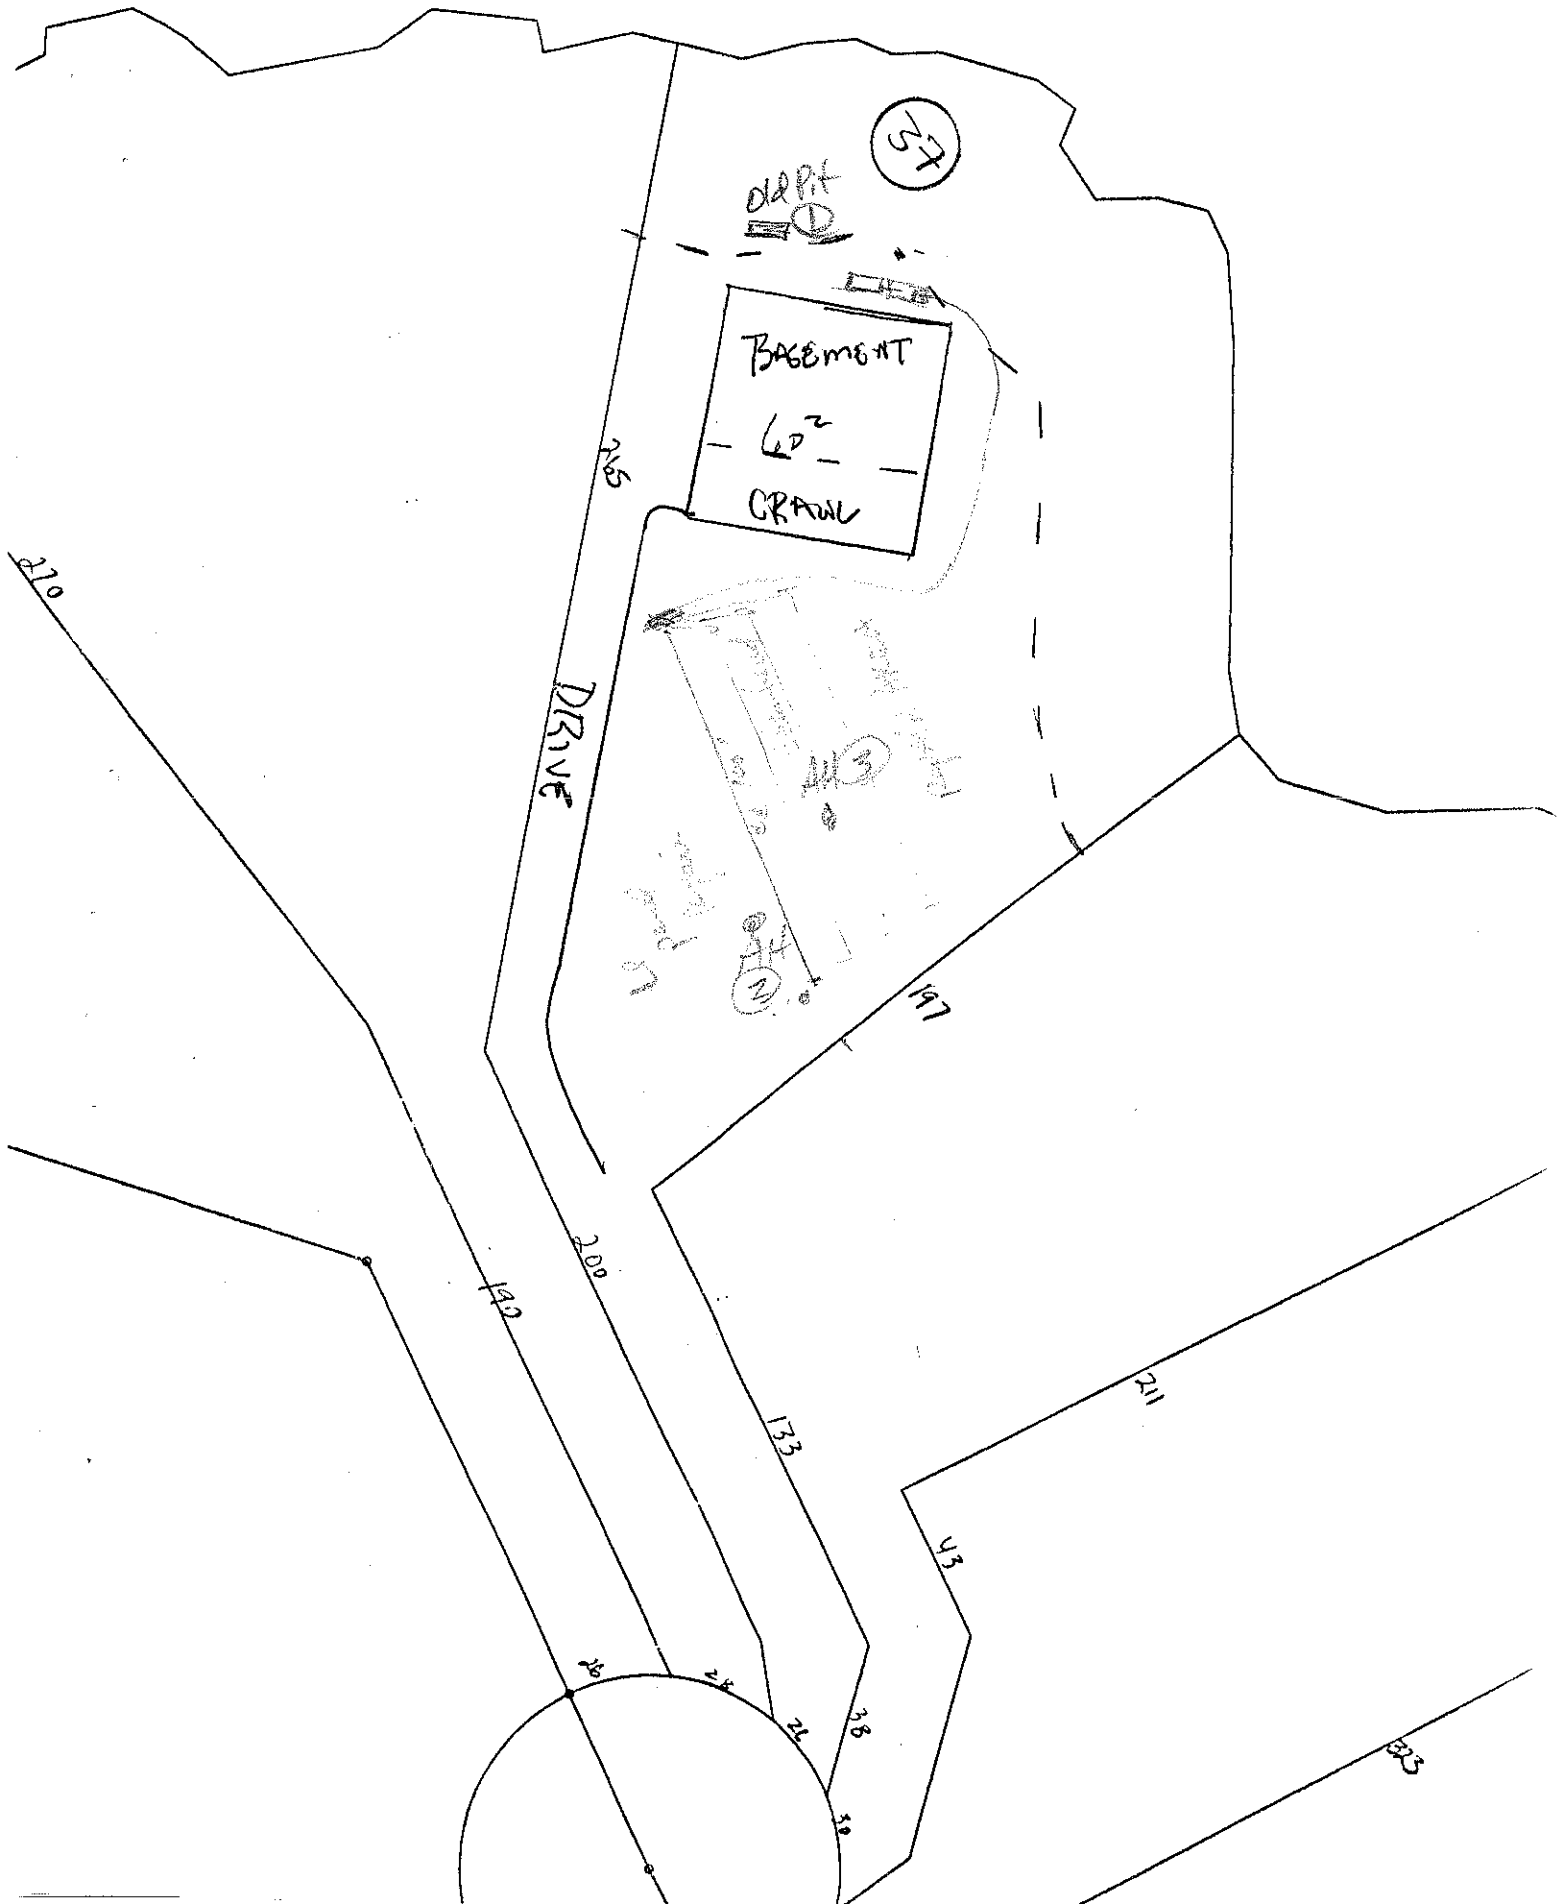
SOIL/SITE EVALUATION
for ON-SITE WASTEWATER SYSTEM

OWNER: CKI
ADDRESS: _____ APPLICANT: _____
PROPOSED FACILITY: _____ APPLICATION DATE: _____ DATE EVALUATED: 7-5-96
LOCATION OF SITE: Lot 37 Pennacle Pt PROPOSED DESIGN FLOW (.1949): _____ PROPERTY SIZE: _____
WATER SUPPLY: ☐ Private ☐ Public ☐ Well ☐ Spring ☐ Other _____ PROPERTY RECORDED: _____
EVALUATION METHOD: ☐ Auger Boring ☐ Pit ☐ Cut
TYPE OF WASTEWATER: ☐ Sewage ☐ Industrial Process ☐ Mixed

PROFILE #	1940 LANDSCAPE POSITION/ SLOPE %	HORIZON DEPTH (IN.)	SOIL MORPHOLOGY (.1941) 1941 STRUCTURE/ TEXTURE	SOIL MORPHOLOGY (.1941) 1941 CONSISTENCE/ MINERALOGY	OTHER PROFILE FACTORS 1942 SOIL WETNESS/ COLOR	1943 SOIL DEPTH	1956 SAPRO CLASS	1944 RESTR. HORIZ.	PROFILE CLASS & LTAR
1	L 5%	0-11	gr brn sL	fr					-3
		11-37	Sab R CL	fr sss pl:1					
		37-65	SL sap	vfr ss-ns np 1:1					
2	L 8-10%	0-10	gr-sab brn	r-brn sl/scl fr					-3
		10-18	sab r lgt	s-p 1:1					
		18-36+	ns sab r cl						
			w/ some quartz rock						
			stopped @ 36" due to rock						
3	L 8-10%	0-12	gr brn sl	fr					-3
		12-29	sab r lgt brn	fr ss pl:1					
		29-46	ns sab r cl	fr ss sp l:1					
			common fractures for flow						
4									

DESCRIPTION	INITIAL SYSTEM	REPAIR SYSTEM
Available Space (.1945)		
System Type(s)		
Site LTAR		

OTHER FACTORS (.1946): _____
SITE CLASSIFICATION (.1948): _____
EVALUATED BY: _____
OTHER(S) PRESENT: _____


57
OLD PIT
BASEMENT
40²
CRAWL
265
DRIVE
210
197
AIR 3
192
200
133
211
43
36
24
26
323