DENR/DEH

ON-SITE WASTEWATER SECTION

Sheet ___ of ___
PROPERTY ID #: _____
COUNTY: _____

SOIL/SITE EVALUATION
for ON-SITE WASTEWATER SYSTEM

OWNER: Gordon / Augusta Homes — APPLICATION DATE _____
ADDRESS: _____ — DATE EVALUATED: 3-7-11
PROPOSED FACILITY: 3 BD SFR — PROPOSED DESIGN FLOW (.1949): 360 gpd — PROPERTY SIZE: _____
LOCATION OF SITE: 7163 Morrison Farm Rd lot 2 Sub'd Crescent II — PROPERTY RECORDED: _____
WATER SUPPLY: • (Private) • Public • Well • Spring • Other _____
EVALUATION METHOD: • (Auger Boring) • Pit • Cut — TYPE OF WASTEWATER: • (Sewage) • Industrial Process • Mixed

PROFILE #	.1940 LANDSCAPE POSITION/ SLOPE %	HORIZON DEPTH (IN.)	SOIL MORPHOLOGY (.1941) .1941 STRUCTURE/ TEXTURE	.1941 CONSISTENCE/ MINERALOGY	OTHER PROFILE FACTORS .1942 SOIL WETNESS/ COLOR	.1943 SOIL DEPTH	.1956 SAPRO CLASS	.1944 RESTR HORIZ	PROFILE CLASS & LTAR
1	L 15% Adj. Pasture	0-12	gr-wk sbk scl	frssp	NONE	48"	NA	NA	.25-.3
		12-31	wk sbk c	fr s-ss, so sspp					
		31-48	wk sbk cl	frssp sspp					
2	L 15% Repair Area	0-9	wk sbk scl	frssp	NONE	48"	NA	NA	.3
		9-32	sbk c	fr ssp sspp					
		32-48	wk sbk cl	frssp sspp					
3									
4									

DESCRIPTION	INITIAL SYSTEM	REPAIR SYSTEM
Available Space (.1945)		
System Type(s)	Conv PPDS + Exist Bed	Conv PPDS
Site LTAR	.25	.3

OTHER FACTORS (.1946): _____
SITE CLASSIFICATION (.1948): PS
EVALUATED BY: _____
OTHER(S) PRESENT: Ken Wrenn of Augusta Homes

COMMENTS: Upgrading septic system from 2 bedroom to 3 bedroom capacity. Repair designated on permit is for additional bedroom. lot recorded in 1975

LEGEND

use the following standard abbreviations

LANDSCAPE POSITION	GROUP	SOIL TEXTURE	CONVENTIONAL .1955 LTAR*	LPP .1957 LTAR*	MINERALOGY/ CONSISTENCE	STRUCTURE
CC (Concave Slope)	I	S (Sand)	1.2 - 0.8	0.6 - 0.4	NEXP (Non-expansive)	G (Single Grain)
CV (Convex Slope)		LS (Loamy Sand)			SEXP (Slightly Expansive)	M (Massive)
D (Drainage Way)					EXP (Expansive)	CR (Crumb)
DS (Debris Slump)	II	SL (Sandy Loam)	0.8 - 0.6	0.4 - 0.3		GR (Granular)
FP (Flood Plain)		L (Loam)				SBK (Subangular Blocky)
FS (Foot Slope)						ABK (Angular Blocky)
H (Head Slope)	III	Si (Silt)	0.6 - 0.3	0.3 - 0.15		PL (Platy)
L (Linear Slope)		SiCL (Silty Clay Loam)				PR (Prismatic)
N (Nose Slope)		CL (Clay Loam)				
R (Ridge)		SCL (Sandy Clay Loam)			MOIST	WET
S (Shoulder Slope)		SiL (Silt Loam)				
T (Terrace)					VFR (Very Friable)	NS (Non-sticky)
	IV	SC (Sandy Clay)	0.4 - 0.1	0.2 - 0.05	FR (Friable)	SS (Slightly Sticky)
		SiC (Silty Clay)			FI (Firm)	S (Sticky)
		C (Clay)			VFI (Very Firm v. Very Sticky)	VS (Very Sticky)
		O (Organic)	None	None	EFI (Extremely Firm)	NP (Non-plastic)
						SP (Slightly Plastic)
						P (Plastic)
						VP (Very Plastic)

*Adjust LTAR due to depth, consistence, structure, soil wetness, landscape, position, wastewater flow and quality.


NOTES

HORIZON DEPTH	In inches below natural soil surface
DEPTH OF FILL	In inches from land surface
RESTRICTIVE HORIZON	Thickness and depth from land surface
SAPROLITE	S(suitable) or U(unsuitable)
SOIL WETNESS	Inches from land surface to free water or inches from land surface to soil colors with chroma 2 or less - record Munsell color chip designation
CLASSIFICATION	S (Suitable), PS (Provisionally Suitable), or U (Unsuitable)

Evaluation of saprolite shall be by pits.

Long-term Acceptance Rate (LTAR): gal/day/ft^2

Show profile locations and other site features (dimensions, reference or benchmark, and North).

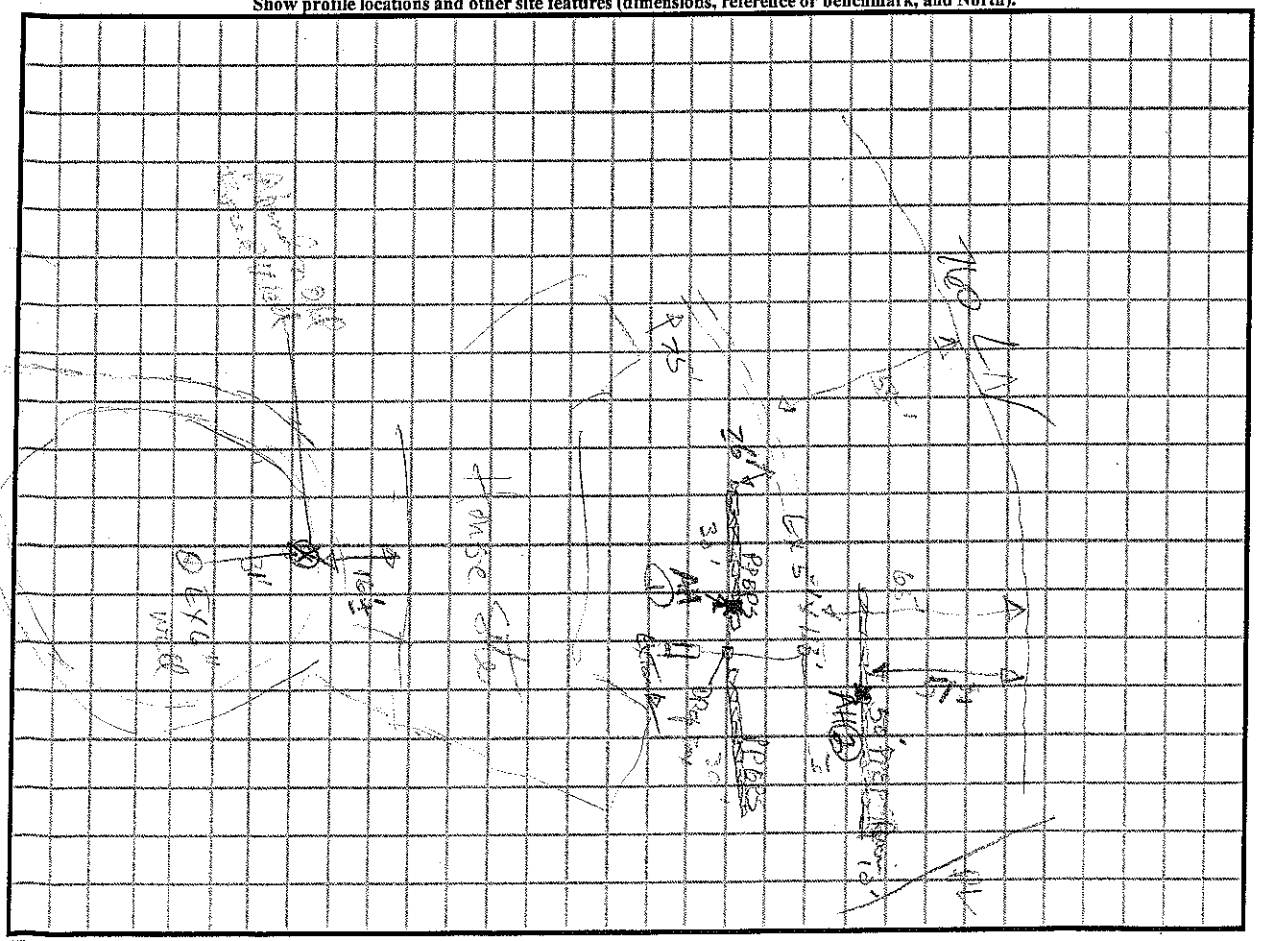

DENR (######)
Review (#####)