Department of Environment, Health, and Natural Resources
Division of Environmental Health
On-site Wastewater Section

Sheet: 1 OF 1
PIN #: 4634-89-1388
Lot #: 27
Permit #: 209535
AppID:


SOIL/SITE EVALUATION
for ON-SITE WASTEWATER SYSTEM

Owner: SANDRA BELTRAN
Applicant: SAME
Address: 120 ROYAL POINTE WAY
Date Evaluated: 5/15/2015
Proposed Facility: SFR
Design Flow (.1949) 360
Property Size: .49 AC
Location of Site: ROYAL POINTE 27
Property Recorded: YES
Water Supply: [ ] Public [X] Individual [X] Well [ ] Spring [ ] Other
Evaluation Method: [X] Auger Boring [ ] Pit [ ] Cut
Type of Wastewater: [X] Sewage [ ] Industrial Process [ ] Mixed

PROFILE #	.1940 Landscape Position/ Slope%	Horizon Depth (IN.)	SOIL MORPHOLOGY .1941 .1941 Structure/ Texture	.1941 Consistence Mineralogy	b PROFILE FACTORS .1942 Soil Wetness/ Color	.1943 Soil Depth (IN.)	.1956 Sapro Class	.1944 Restr Horiz	Profile Class & LTAR
AB 1	LINEAR 5%	0-42	CL,M,SBK	SS	NA	48"	COMM INC @ 42"	48"+	.3
		42-48	CL,W,SBK	SS					
AB 2	LINEAR 5%	0-31	CL,M,SBK	SS	NA	31"	S	48"+	.35
		31-48	SSAP	NS					

Description	Initial System	Repair System
Available Space (.1945)	PS	PS
System Type(s)	GRAVEL	PANEL BLOCK
Site LTAR		.3

Other Factors (.1946): MOVED REPAIR FOR POOL
Soil Evaluation By: BEN ALDRIDGE
Others Present: NONE
Site Classification (.1948): PS
Site Evaluation By: BEN ALDRIDGE
Others Present: NONE

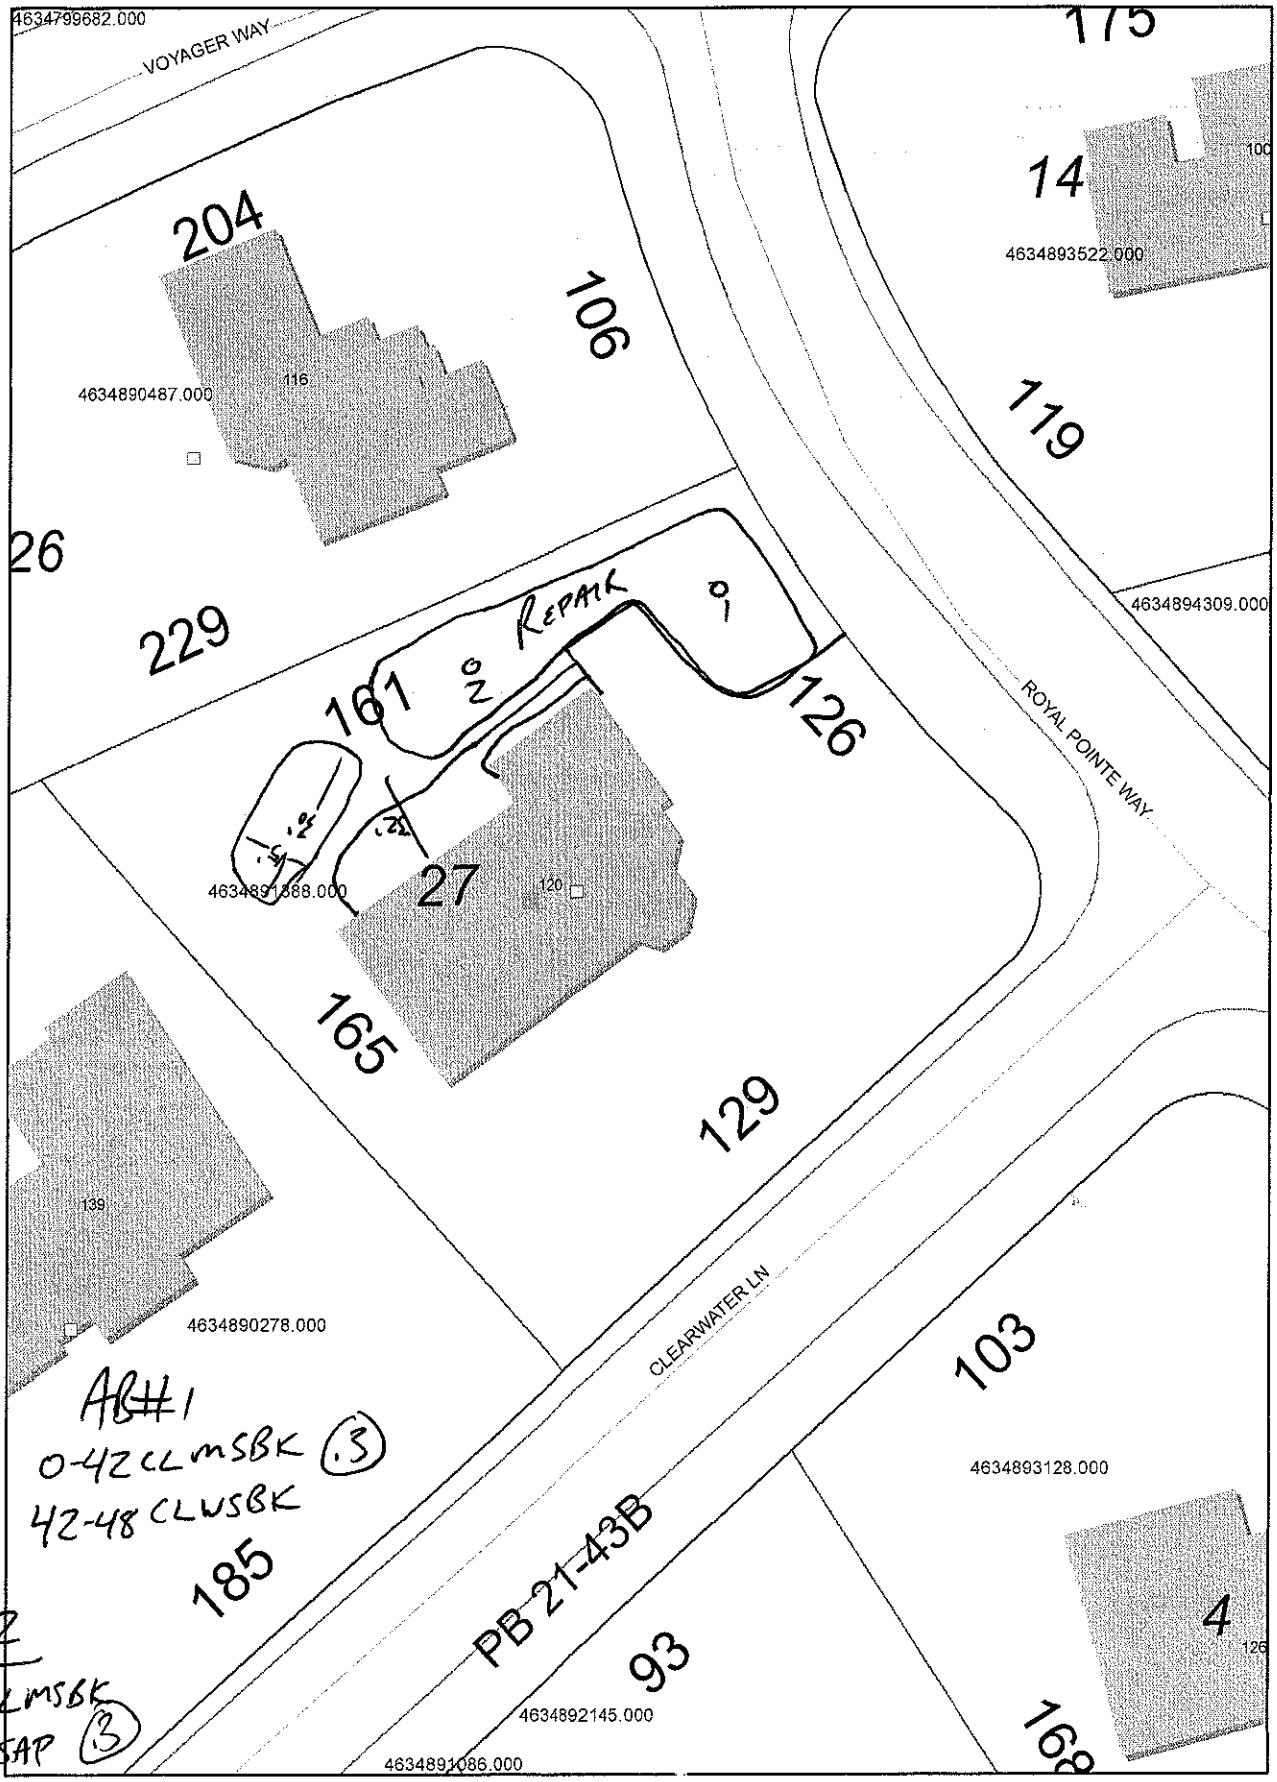

AB#1
0-42 CL MSBK (.3)
42-48 CL USBK

AB#2
0-31 CL MSBK (.3)
31-48 SSAP