SOIL/SITE EVALUATION
for ON-SITE WASTEWATER SYSTEM

OWNER: CPI APPLICANT: _____

ADDRESS: _____ APPLICATION DATE: _____ DATE EVALUATED: 11-8-96

PROPOSED FACILITY: _____ PROPOSED DESIGN FLOW (.1949): _____ PROPERTY SIZE: _____

LOCATION OF SITE: lot 16 The Knoll PROPERTY RECORDED: _____

WATER SUPPLY: ☐ Private ☐ Public ☐ Well ☐ Spring ☐ Other _____

EVALUATION METHOD: ☐ Auger Boring ☐ Pit ☐ Cut

TYPE OF WASTEWATER: ☐ Sewage ☐ Industrial Process ☐ Mixed

Now Lot 17

PROFILE #	1940 LANDSCAPE POSITION/ SLOPE %	HORIZON DEPTH (IN)	SOIL MORPHOLOGY (1941) 1941 STRUCTURE/ TEXTURE	SOIL MORPHOLOGY (1941) 1941 CONSISTENCE/ MINERALOGY	OTHER PROFILE FACTORS 1942 SOIL WETNESS/ COLOR	1943 SOIL DEPTH	1956 SAPRO CLASS	1944 RESTR. HORIZ	PROFILE CLASS & LTAR
1		0-7	vfsl-mscl/sil	fr ss/p					B5 .25
		7-23	lvm sicl/ E brn C	fr SP/SBP					
		23-49	vf sl/sicl m OL	fi ss/sp/p					
2	L 5%	0-8	mvfsl/sil	fi ss/p					B5 .25
		8-34	vf sl/sicl lvm C	fr SP					
		34-49	vf sl/sicl mpl	fi ss/sp/p					
			lvm sicl/ gry/ mott						
3									
4									

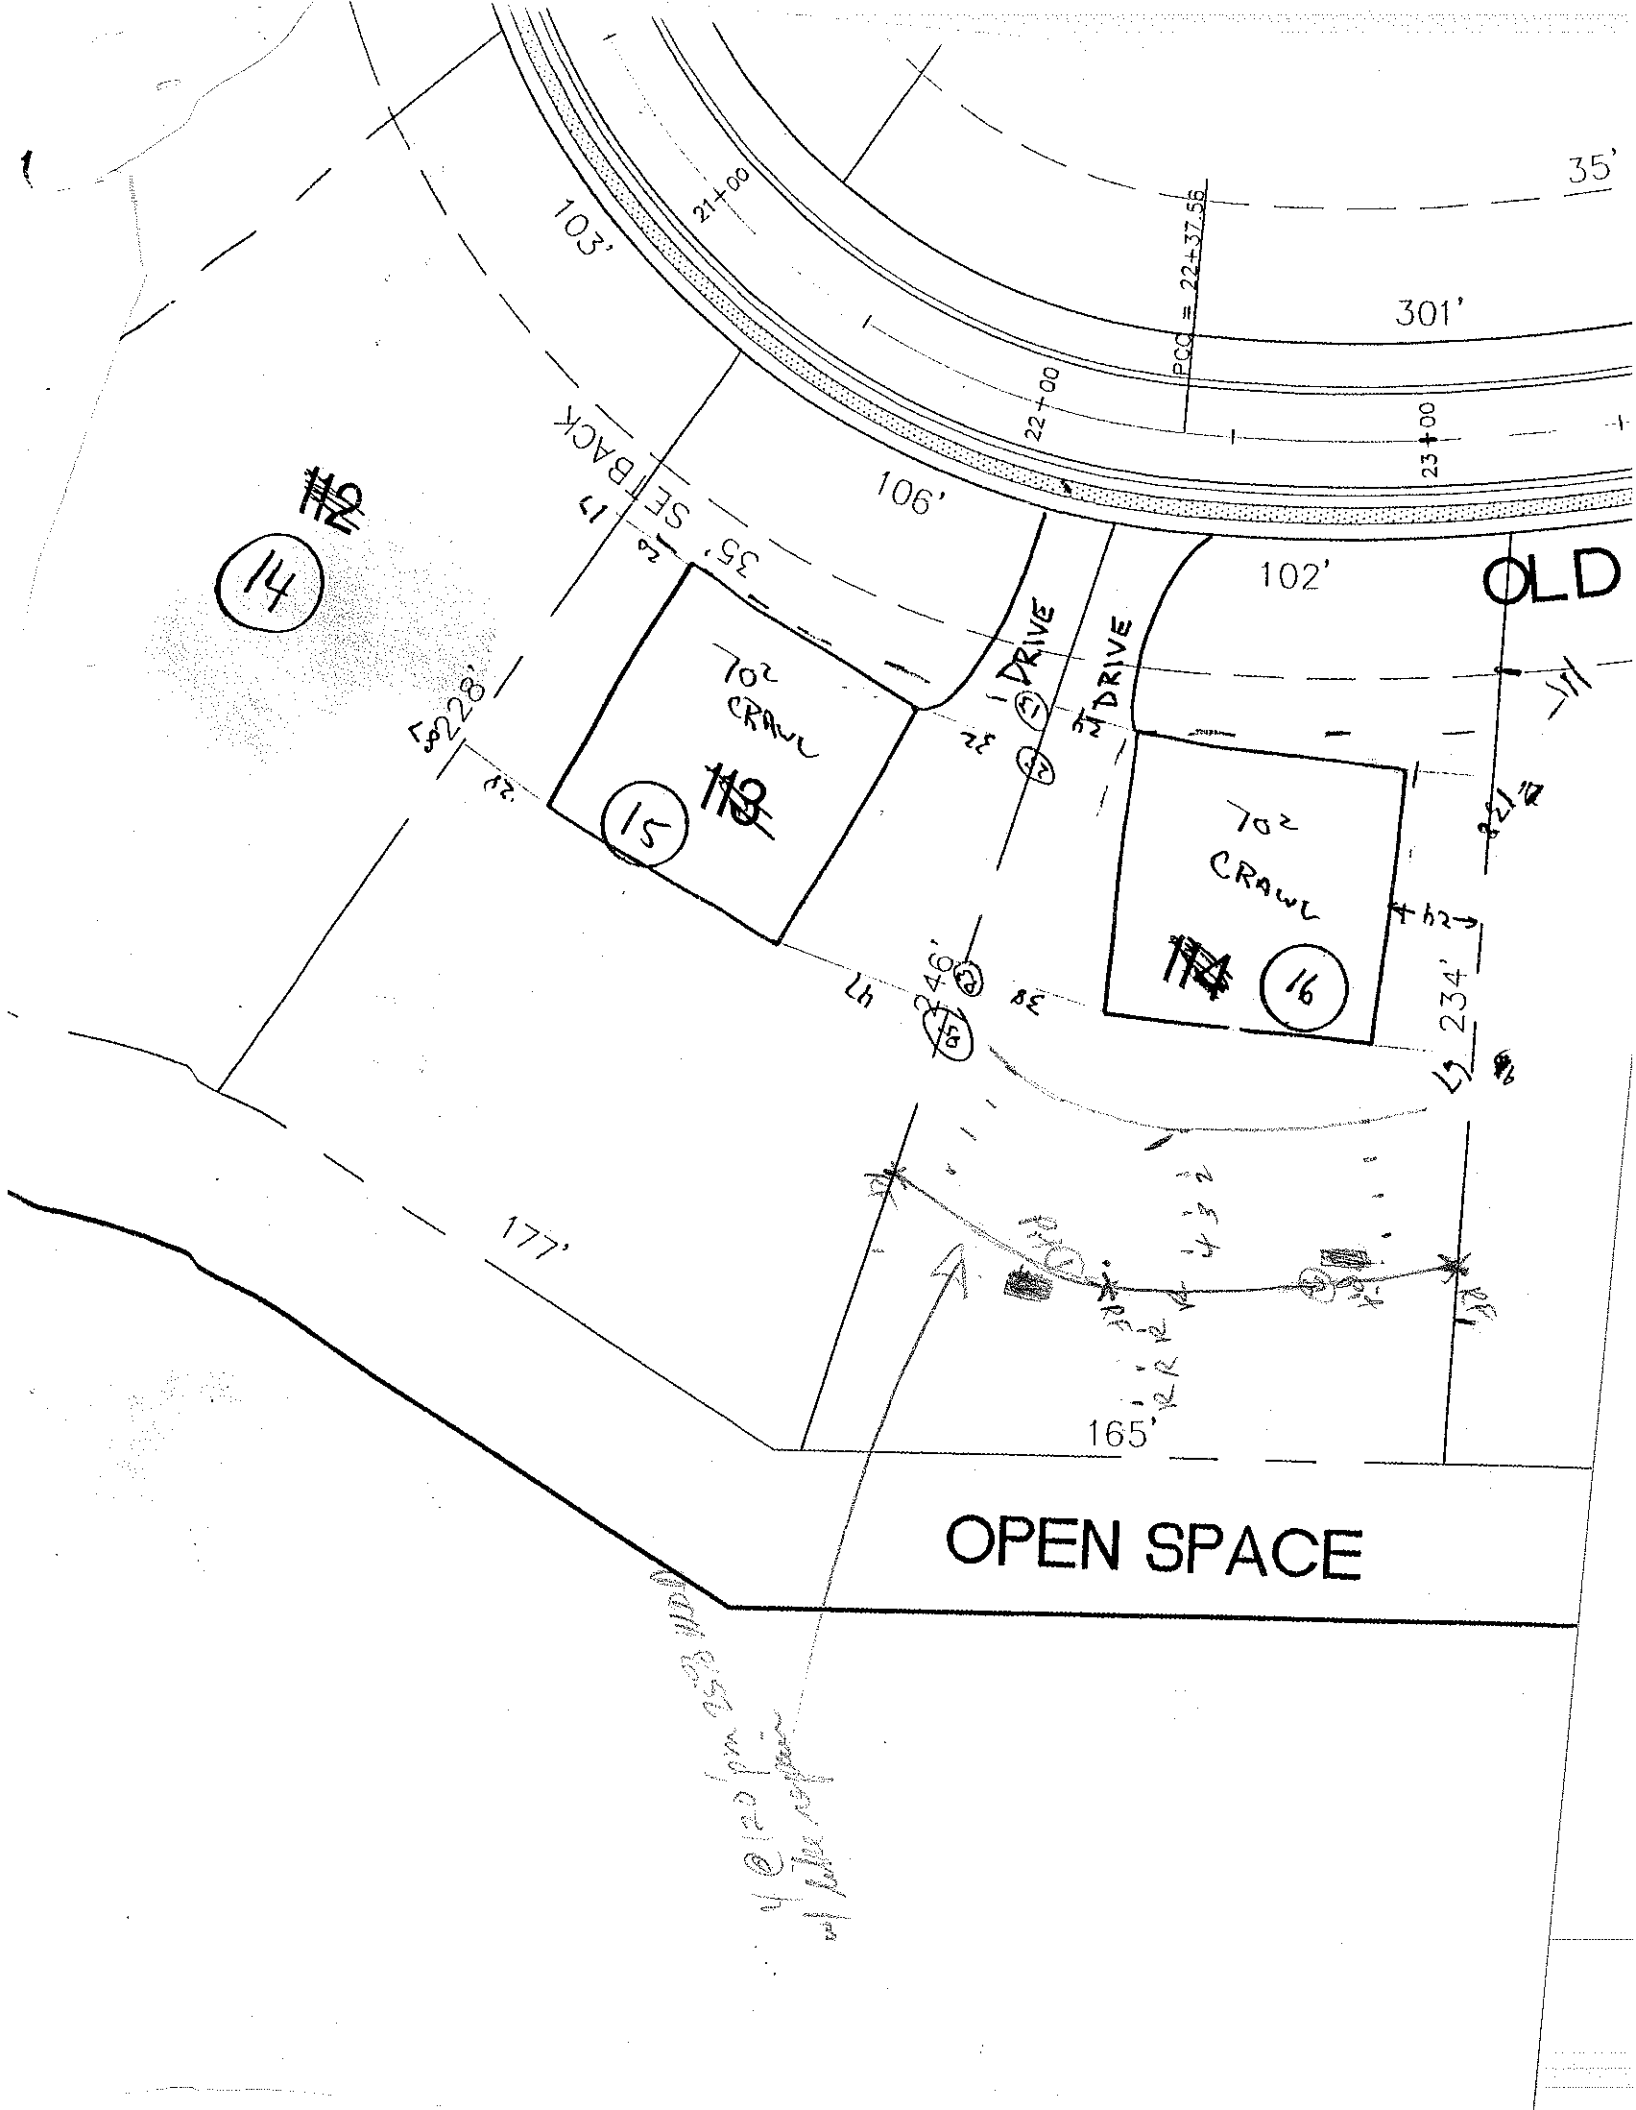
DESCRIPTION	INITIAL SYSTEM	REPAIR SYSTEM
Available Space (.1945)		
System Type(s)		
Site LTAR		

OTHER FACTORS (.1946): _____

SITE CLASSIFICATION (.1948): _____

EVALUATED BY: _____

OTHER(S) PRESENT: _____


35'
301'
103'
21+00
22+00
23+00
POC = 22+37.56
106'
102'
OLD
35' SETBACK
DRIVE
DRIVE
702 CRAWL
702 CRAWL
14
15
16
#12
#13
#14
S28°
246'
234'
177'
165'
OPEN SPACE