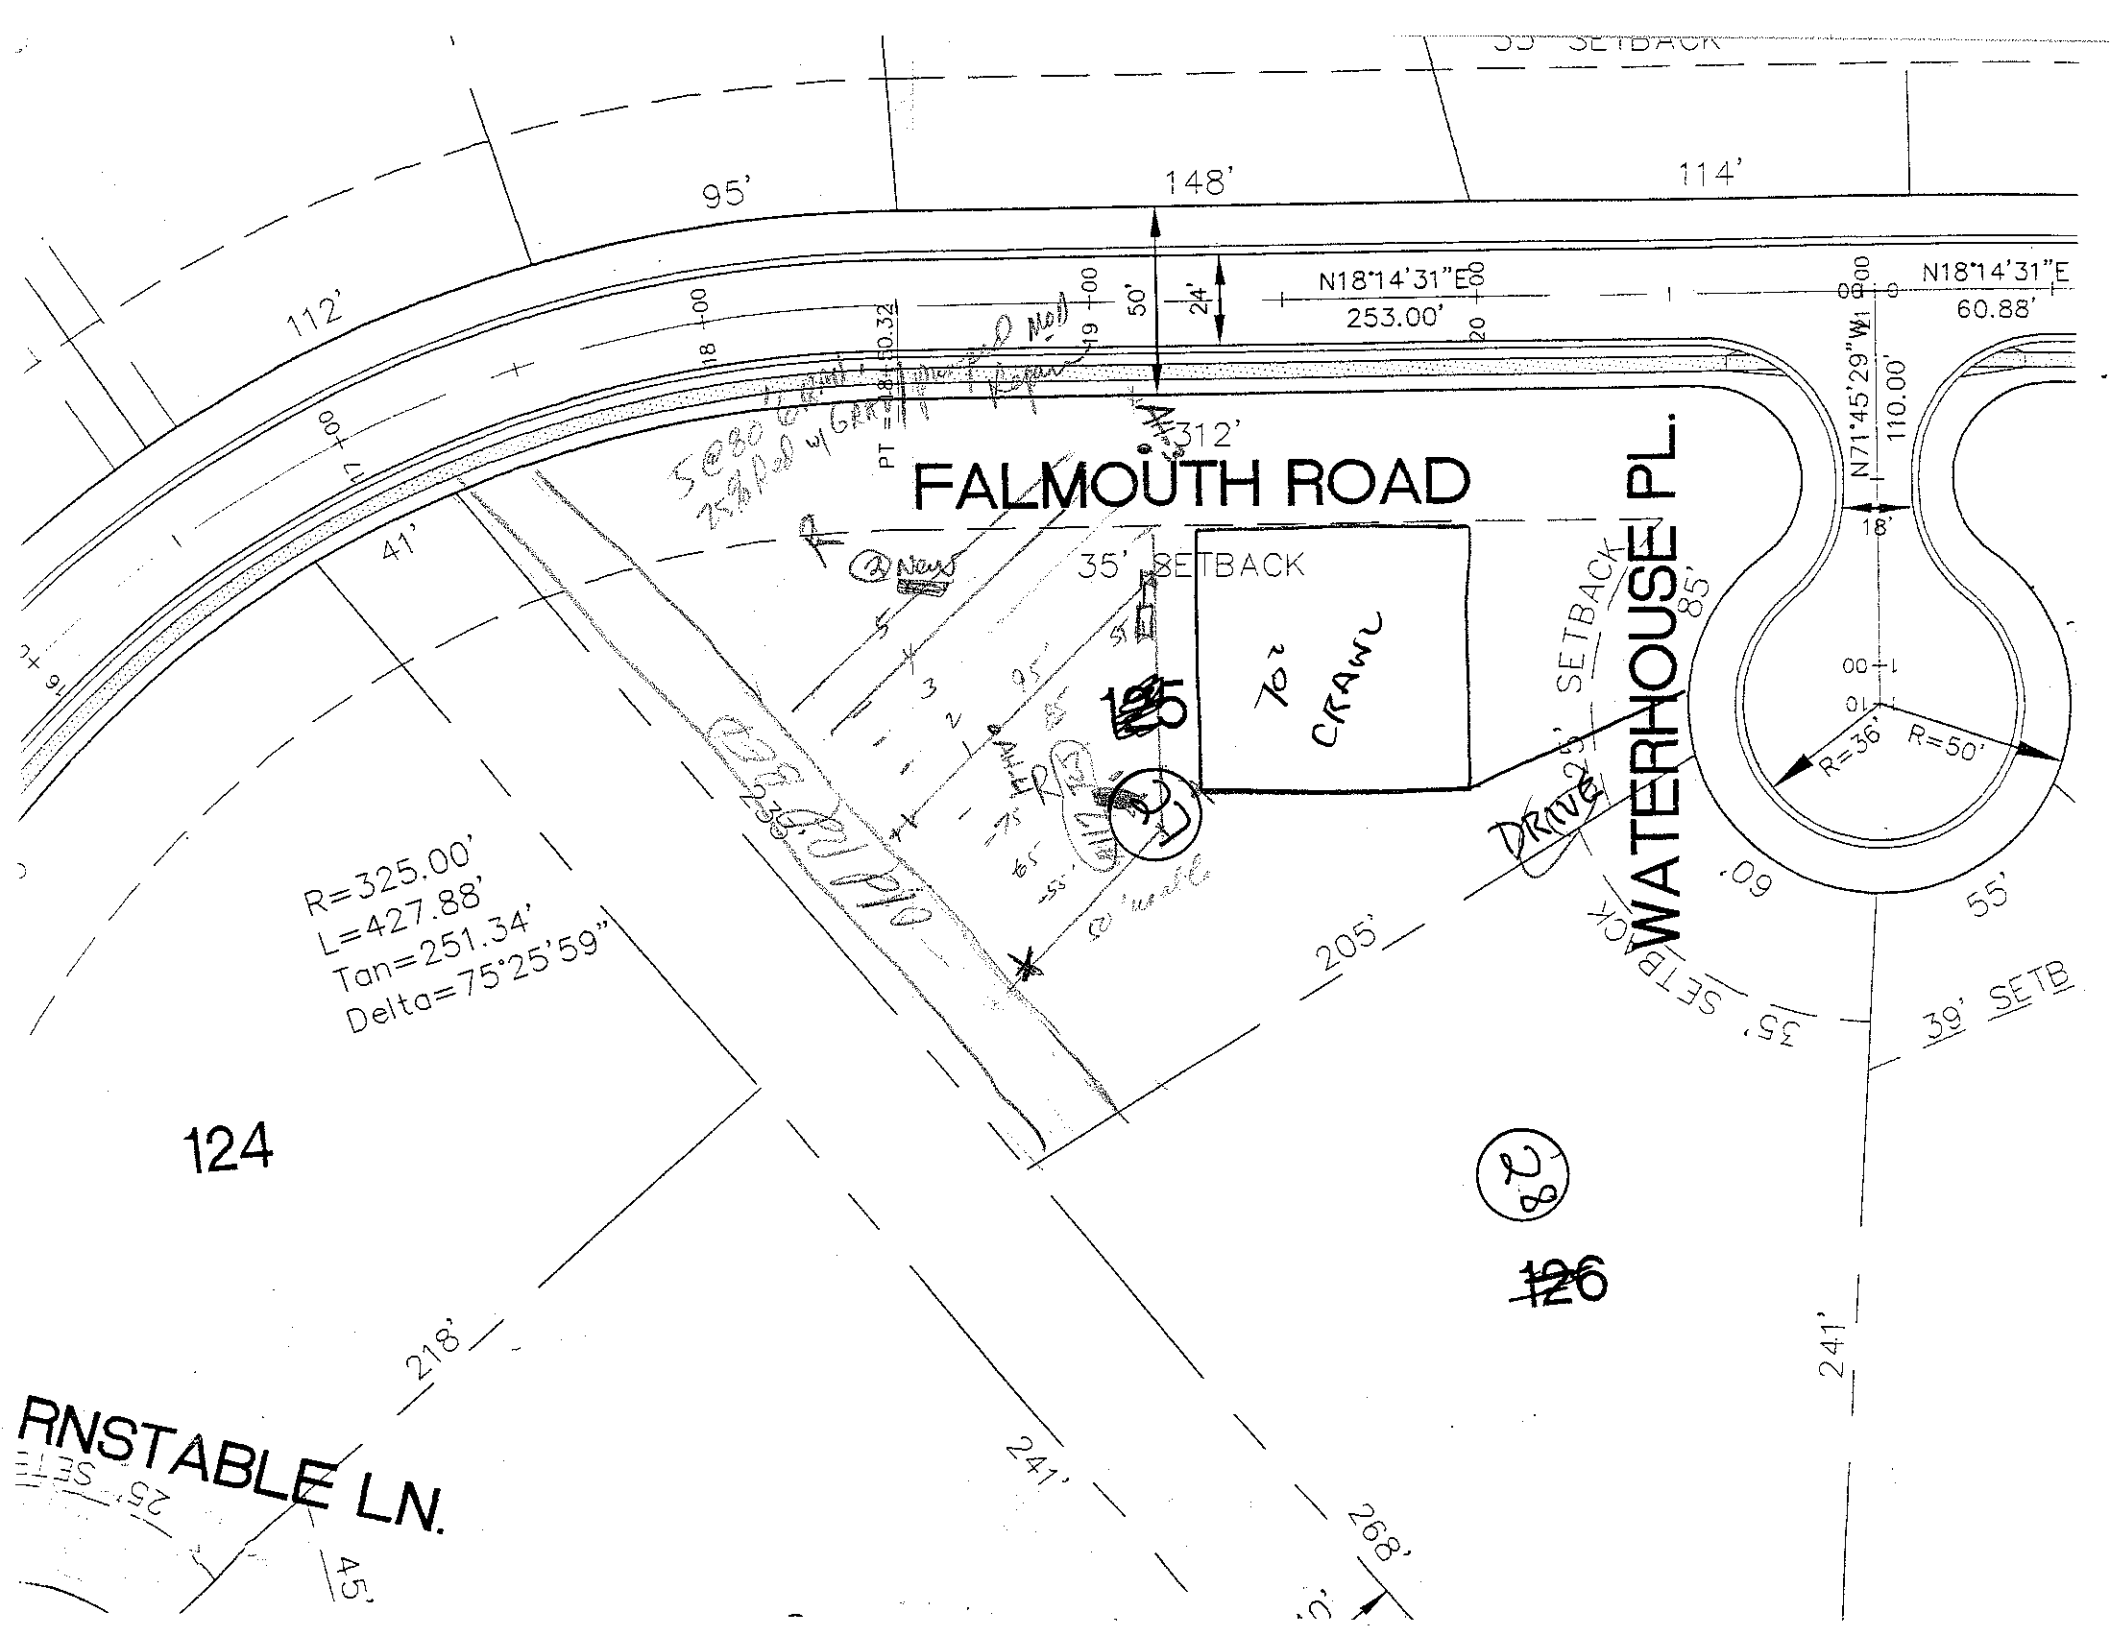

FALMOUTH ROAD
WATERHOUSE PL.
35' SETBACK
70' CRAWL
DRIVE
95'
148'
114'
112'
312'
253.00'
N18°14'31"E
60.88'
N71°45'29"W
110.00'
R=325.00'
L=427.88'
Tan=251.34'
Delta=75°25'59"
R=36'
R=50'
205'
241'
218'
268'
124
126
RNSTABLE LN.

DIVISION OF ENVIRONMENTAL HEALTH
ON-SITE WASTEWATER SECTION

PROPERTY ID #: _____
COUNTY: _____

SOIL/SITE EVALUATION
for ON-SITE WASTEWATER SYSTEM

OWNER: CRI APPLICANT: _____
ADDRESS: _____ APPLICATION DATE: _____ DATE EVALUATED: 3-24-93
PROPOSED FACILITY: _____ PROPOSED DESIGN FLOW (.1949): _____ PROPERTY SIZE: _____
LOCATION OF SITE: Lot 27 The Point PROPERTY RECORDED: _____
WATER SUPPLY: ☐ Private ☐ Public ☐ Well ☐ Spring ☐ Other _____
EVALUATION METHOD: ☐ Auger Boring ☐ Pit ☐ Cut
TYPE OF WASTEWATER: ☐ Sewage ☐ Industrial Process ☐ Mixed SE = Slight Exp.

PROFILE	1940 LANDSCAPE POSITION/ SLOPE %	HORIZON DEPTH (IN)	SOIL MORPHOLOGY (1941) 1941 STRUCTURE/ TEXTURE	1941 CONSISTENCE/ MINERALOGY	OTHER PROFILE FACTORS 1942 SOIL WETNESS/ COLOR	1943 SOIL DEPTH	1956 SAPRO CLASS	1944 RESTR HORIZ	PROFILE CLASS & LTAR
1	#17 TC	0-7	FR BRN SCL						PS .3
		7-45	structureless	FR firm					
2		0-7	brown SCL	FR					PS .25-.3
		7-28	mod blocky	FR SS					
		28-48	mod blocky heavy clay	FR SS					
			common manganese coating						
3		0-15	Brn SCL						PS .3
		15-48	Rd/Brn C/SCL mod blocky	FR SS, SP, SE, FR, FI					
4		0-6	Brn SCL	mSBK FR SE FR					PS .3
		6-48	Rd/Brn C/SCL mod blocky	FR SS, SP, SE, FR					

DESCRIPTION	INITIAL SYSTEM	REPAIR SYSTEM
Available Space (.1945)		
System Type(s)		
Site LTAR		

OTHER FACTORS (.1946): _____
SITE CLASSIFICATION (.1948): _____
EVALUATED BY: _____
OTHER(S) PRESENT: _____