IREDELL COUNTY HEALTH DEPARTMENT

13878

(SEPTIC TANK) IMPROVEMENTS PERMIT AND CERTIFICATE OF COMPLETION
(Ground Absorption Sewage Disposal System -- G. S. Chapter 130-Article 13C)

OWNER OR CONTRACTOR M I SCHOTTENSTEIN (HOWARTH) DATE 1/6/92 PERMIT NO. 2-623 A42

PHONE: Business _____ Home 704-542-7469

LOCATION S Side of Pine Rd, TL into Pine Isle to 4th lot on (L)

S. R. No. _____

SUBDIVISION NAME Pine Isle LOT NO. 42 SECTION OR BLOCK NO. _____

House (✓) Mobile Home ( ) Business ( ) Other _____


No. Bedrooms 4 No. Bathrooms 2.5

Garbage Disposal Unit	Yes ( )	No ( )	
Auto. Dishwasher	Yes ( )	No ( )	
Auto. Wash. Machine	Yes ( )	No ( )	
Site Suitable	Yes ( )	No ( )	

Character & Porosity of Soil P/cl-c
Percolation Rate .4
Topography 2-3%
Depth to Water Table 48"
Rock or other impervious formations None observed

Lot Area _____

_____ Basement with Plumbing _____ Basement without Plumbing ✓ No Basement

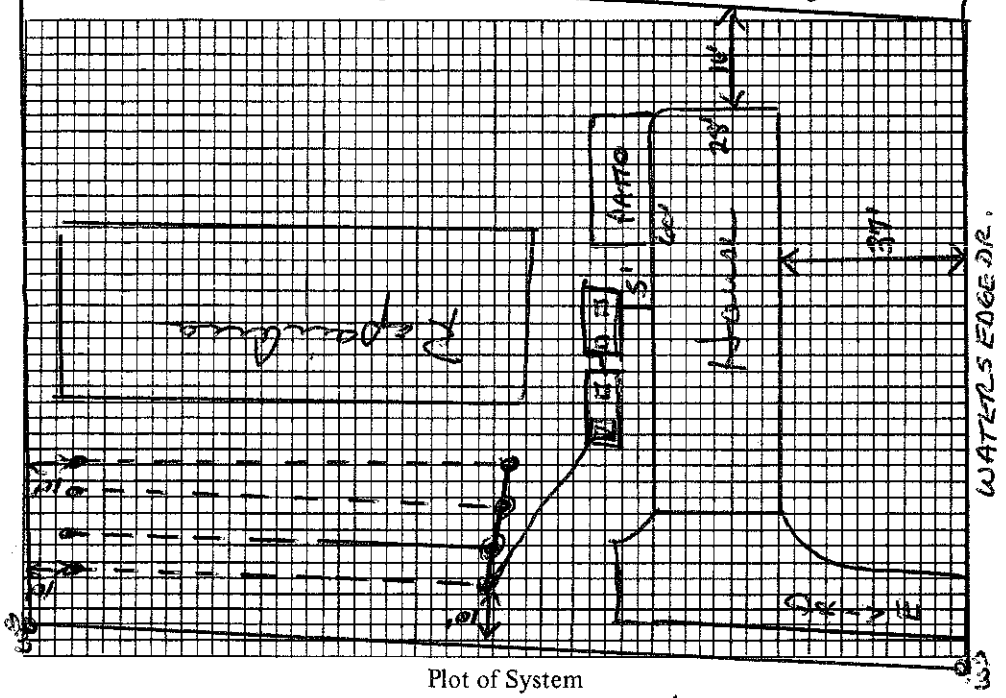

Plot of System

Size of Tank 1000/1000 Gals.
Nitrification Field:
No. of Lines 4 (E) 100' x 3'
Sq. Ft. 1200 Linear Ft. 400
Depth of Stone in Lines 12"
Water Supply: Individual ( ) comm. D/W
Public (✓)

Installed by _____

I understand and agree to install septic tank system as specified on this Improvements Permit.

Signed: Eddie Sharp

IMPROVEMENTS PERMIT BY Wesley Sparks RS.

COMMENTS: Pressure Conventional Trenches - 2" PVC with 3/16" hole on 5' centers; 2' stub pipe at end of each lateral drain line. 3' trenches with 12" gravel like conventional trenches. Trenches on 1/4" per 10' grade on trench bottom. Trenches shallow (36") to trench bottom.

CERTIFICATE OF COMPLETION BY _____ DATE _____

EXISTING SYSTEM CHECKED BY: _____ DATE _____

CONSTRUCTION MUST COMPLY WITH ALL OTHER APPLICABLE STATE AND LOCAL REGULATIONS.

Permit is VOID if any unauthorized changes are made in installation of system and/or if any false information is supplied in making Improvements Permit.

Health Dept. Copy: White Inspection Dept. Copy: Yellow Sanitarian's Copy: Pink Owner's Copy: Gold