IVISION OF ENVIRONMENTAL HEALTH
N-SITE WASTEWATER SECTION

Sheet ___ of ___
PROPERTY ID #: _____
COUNTY: _____

SOIL/SITE EVALUATION for ON-SITE WASTEWATER SYSTEM

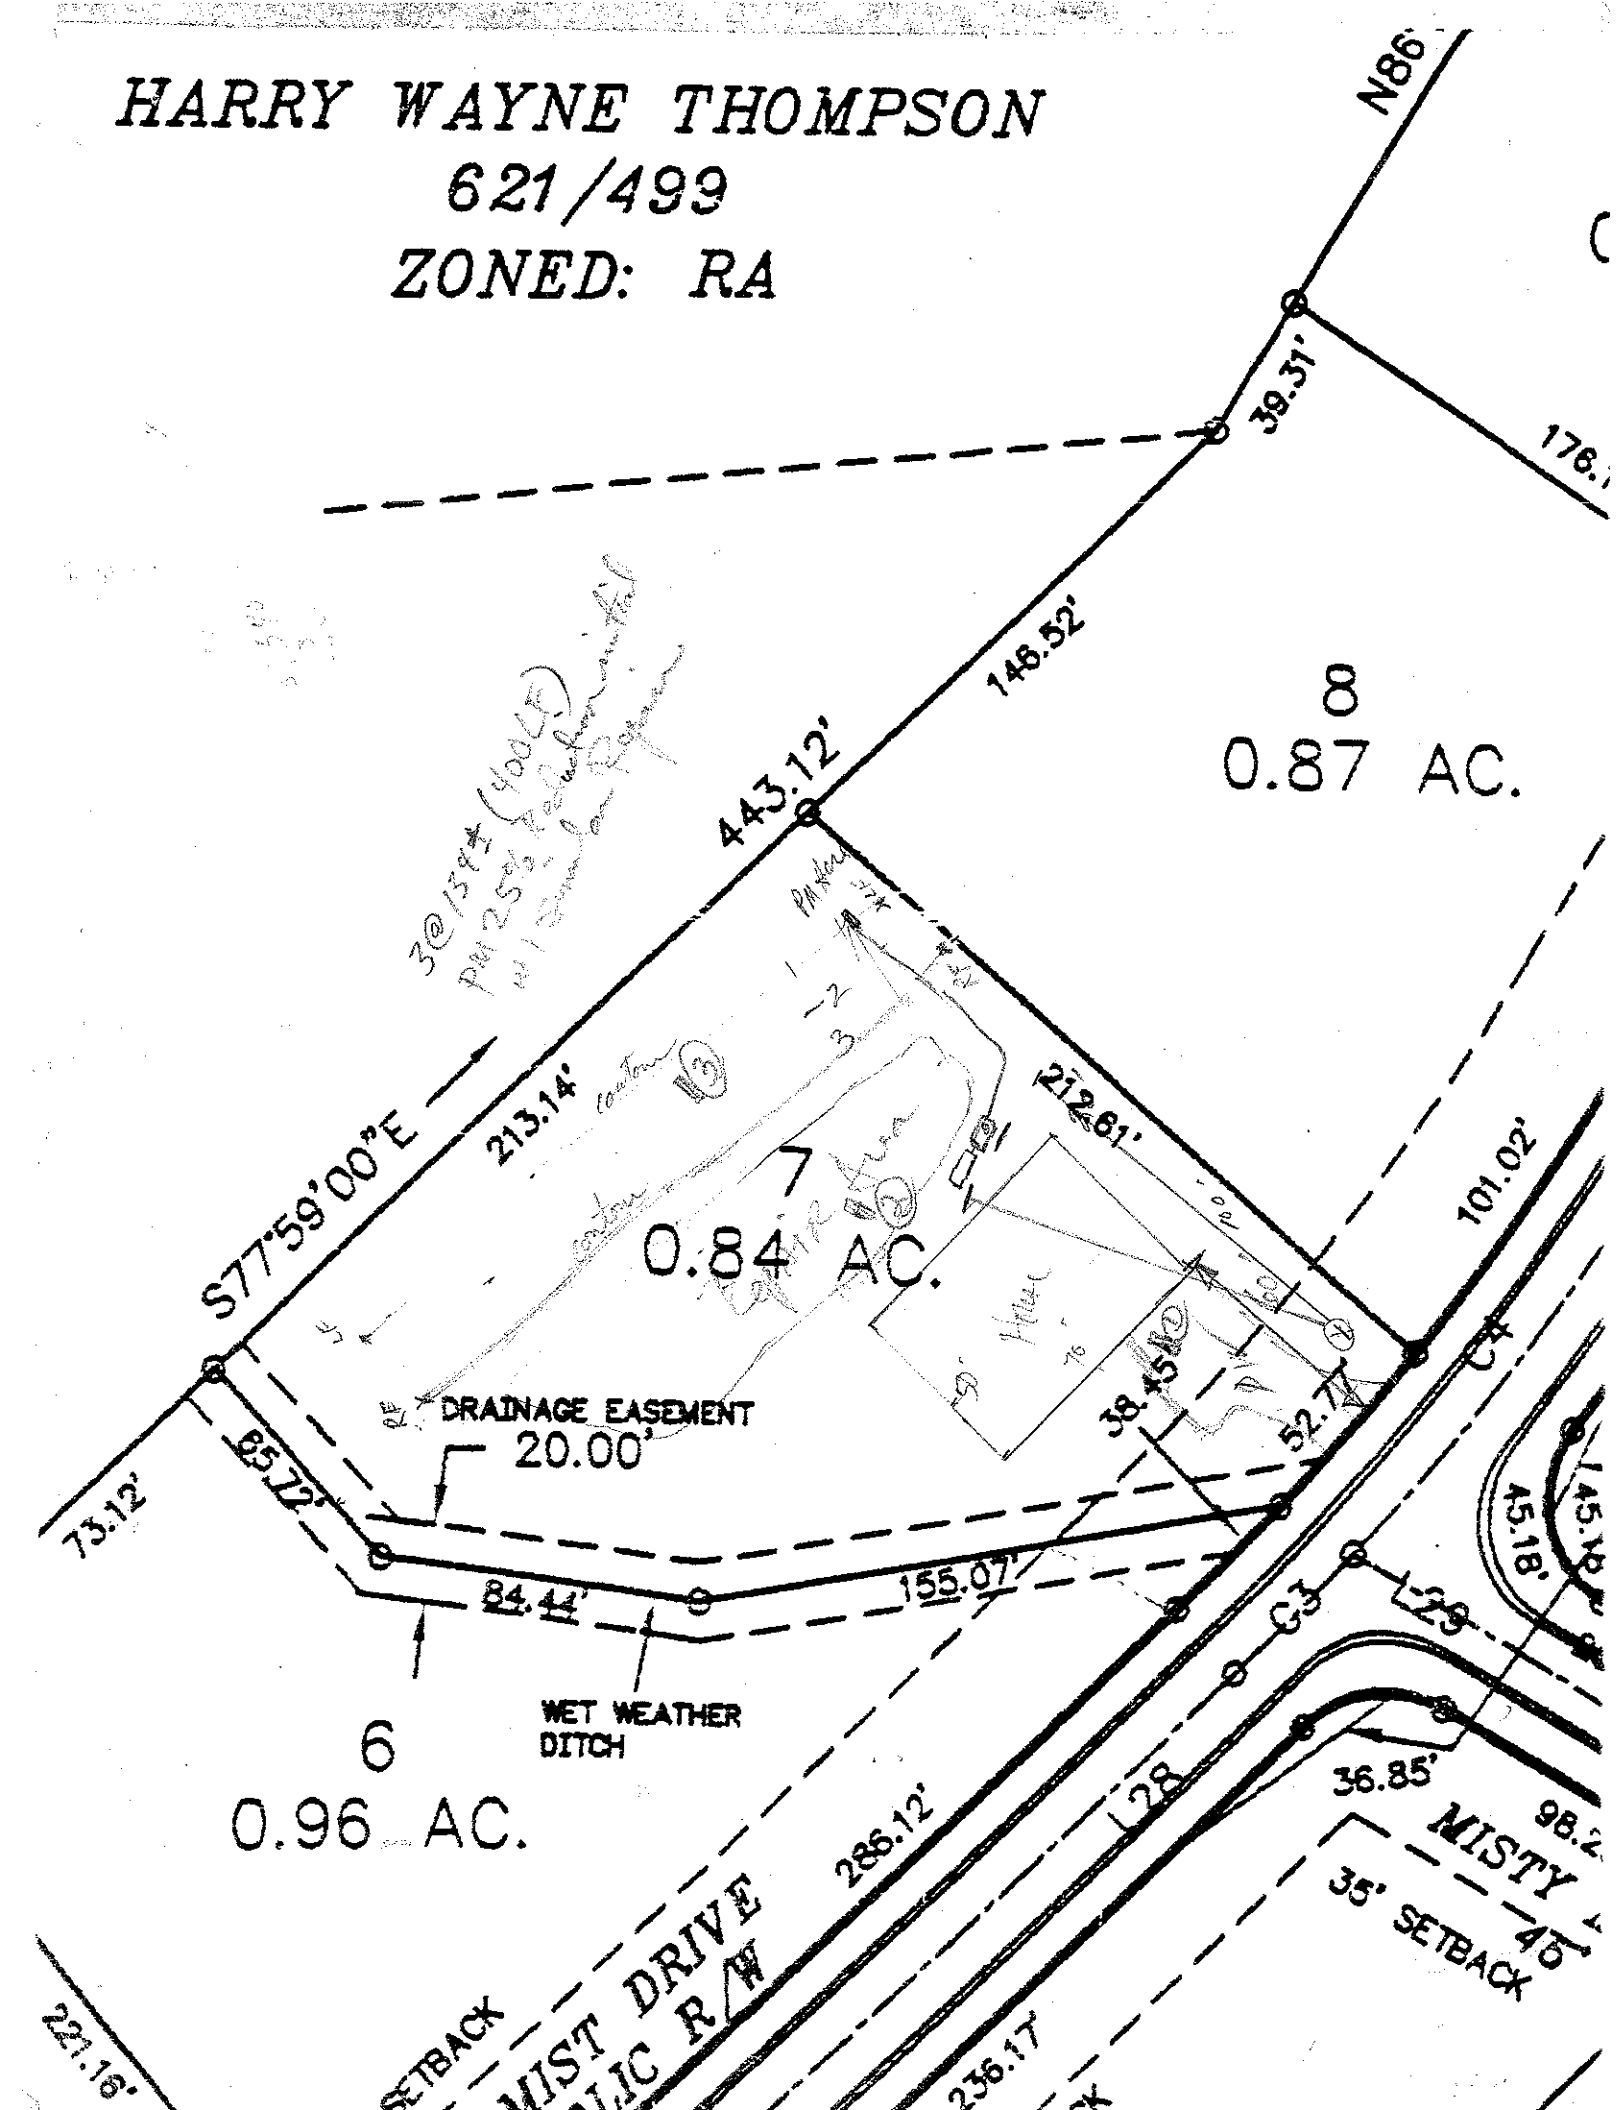
WNER: Ron Smith APPLICATION DATE _____
DDRESS: _____ DATE EVALUATED: 1-16-03
ROPOSED FACILITY: _____ PROPOSED DESIGN FLOW (.1949): 4 Bedroom PROPERTY SIZE: _____
OCATION OF SITE: Lot 7 Whisper Rock Wisconsin Dells PROPERTY RECORDED: _____
VATER SUPPLY: ☒ Private ☐ Public ☒ Well ☐ Spring ☐ Other _____
VALUATION METHOD: ☐ Auger Boring ☒ Pit ☐ Cut
YPE OF WASTEWATER: ☒ Sewage ☐ Industrial Process ☐ Mixed

PROFILE #	.1940 LAND-SCAPE POSITION/ SLOPE %	HORI-ZON DEPTH (IN.)	SOIL MORPHOLOGY (.1941) .1941 STRUCTURE/ TEXTURE	SOIL MORPHOLOGY (.1941) .1941 CONSISTENCE/ MINERALOGY	OTHER PROFILE FACTORS .1942 SOIL WETNESS/ COLOR	.1943 SOIL DEPTH	.1956 SAPRO CLASS	.1944 RESTR HORIZ	PROFILE CLASS & LTAR
1		0-5	gr wk fsk lms sl fr ss sp						.3
		5-19	lt brn sk ec fr sp fri lp						
		19-33	wk red mas rc fr ss sp common in lp						
		33-66	wk brn sk - massive l sm fr ss s p						
2		0-4	gr sk lms sl fr ss sp						.3
		4-31	mod brn sk rc fr sp						
		31-57	wk brn gr sk fr ss sp common in lp						
3	6-8%	0-4	gr gray-brown sl fr ss sp						.3
		4-17	wk brn sk rdsh brn sl fr ss sp						
		17-43	m-s lsk rc fr sp						
		43-64	wk lsk red fr ss sp common in lp						
4									

DESCRIPTION	INITIAL SYSTEM	REPAIR SYSTEM
Available Space (.1945)	PS	PS
System Type(s)	Pm 25% Red	Pm 25% Red
Site LTAR	.3	.3

OTHER FACTORS (.1946): _____
SITE CLASSIFICATION (.1948): PS
EVALUATED BY: DRH
OTHER(S) PRESENT: _____

OMMENTS: _____


HARRY WAYNE THOMPSON
621/499
ZONED: RA
N86°
39.31'
176.
148.52'
443.12'
8
0.87 AC.
S77°59'00"E
213.14'
212.61'
101.02'
7
0.84 AC.
DRAINAGE EASEMENT
20.00'
73.12'
65.72'
84.44'
155.07'
38.45'
52.77'
C4
45.18'
C3
L29
L28
WET WEATHER
DITCH
6
0.96 AC.
286.12'
36.85'
MISTY
35' SETBACK
221.16'
236.17'